

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave. St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 99.28**WELDING INSPECTION REPORT****Resident Engineer:** Pursell, Gary**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-012333**Date Inspected:** 24-Feb-2010**Project Name:** SAS Superstructure**OSM Arrival Time:** 645**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1845**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC) Chanxing Island**Location:** Shanghai, China

CWI Name:	N/A	CWI Present:	Yes	No
Inspected CWI report:	Yes No N/A	Rod Oven in Use:	Yes No N/A	
Electrode to specification:	Yes No N/A	Weld Procedures Followed:	Yes No N/A	
Qualified Welders:	Yes No N/A	Verified Joint Fit-up:	Yes No N/A	
Approved Drawings:	Yes No N/A	Approved WPS:	Yes No N/A	
		Delayed / Cancelled:	Yes No N/A	
Bridge No:	34-0006	Component:	OBG Segment 10BE	

Summary of Items Observed:

On this date Caltrans OSM Quality Assurance Inspector (QA), Vibin Kumar Selvanayaham, was present during the times noted above for observations relative to the work being performed.

Magnetic Particle Testing (MT)

This QA inspector performed Visual Testing (VT) on OBG Segment 9EW and VT indications are confirmed by Magnetic Particle Testing (MT) on area previously tested and accepted by ZPMC Quality Control personnel.

This QA Inspector generated an MT report for this date. The indications are clearly marked on the material near the weld for future repair. The members are identified as OBG Segment 9EW. The weld designations reviewed are as follows:

OBG Segment 9EW-PP85 East side

1. FB003-158-004
2. FB009-022-004

OBG Segment 9EW-PP85 West side

1. FB003-158-005
2. FB009-022-003

WELDING INSPECTION REPORT




(Continued Page 2 of 3)

OBG Segment 9DE-PP84 East side

1. FB003-144-004

Description of Incident: During random Quality Assurance Visual review of welds located on segment 9EW, this Quality Assurance Inspector (QA) discovered three (3) Transverse linear indications measuring approximately 4mm, 6mm & 7mm in lengths. The indications were discovered visually and confirmed by Magnetic particle Testing (MT) by Caltrans QA. ZPMC Quality Control MT Technicians claimed that magnetic particle testing have been performed on these welds that require 25% MT. The indication is clearly marked on the material near the weld. The welds are identified as FB003-158-004 and FB009-022-004. The panel point is identified as a PP85. This weld is a Fillet weld joining the Floor beam Web to Flange. The Floor Beam Flange weld is identified as Non SPCM. For further information, please see the attached pictures

Unless otherwise noted, all work observed on this date appeared to be in general compliance with the applicable contract documents.

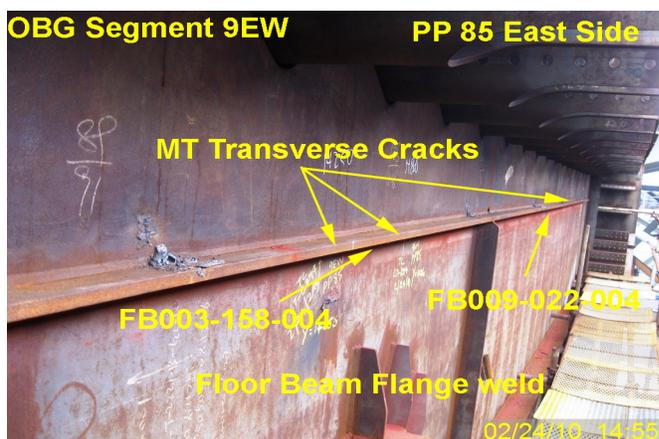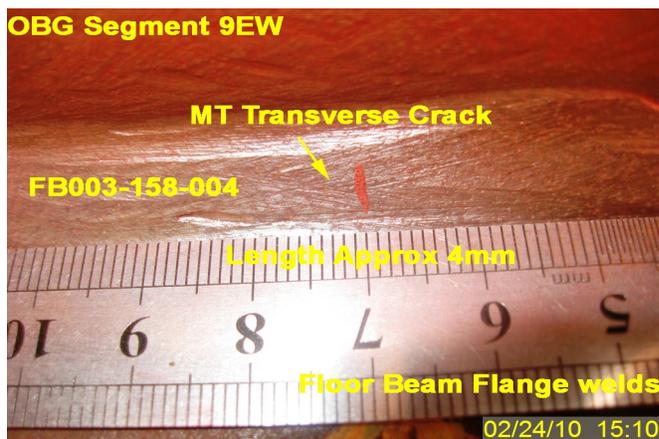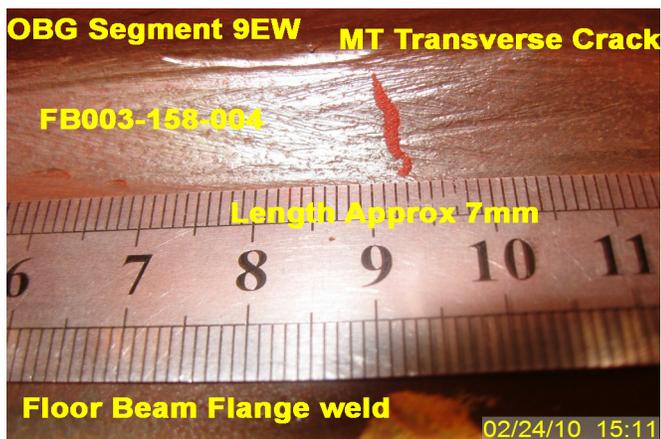

Summary of Conversations:

Only general conversation was held between QA and QC concerning this project.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

remedial efforts please contact , who represents the Office of Structural Materials for your project.

Inspected By:	Kumar,Vibin	Quality Assurance Inspector
----------------------	-------------	-----------------------------

Reviewed By:	McClendon,Timothy	QA Reviewer
---------------------	-------------------	-------------