

STATE OF CALIFORNIA	Job Stamp	7-day Const. Calendar	Day No. 483
DEPARTMENT OF TRANSPORTATION	SFOBB SAS	Project Work Day No.	Day No. 683
Form HC-10A (Rev. 6/80)	04-0120F4	Date	04/09/2008

Inspectors Hours	Start	0700	Stop	1530
Shift Hours	Start	0630	Stop	1500

ASSISTANT RESIDENT ENGINEER'S

CONTRACTOR - ABFJV

HOURS - ITEM NO.												REMARKS	
EQUIPMENT AND/OR LABOR:			48 - Bar Reinforcing Steel (Bridge)								IDLE OR DOWN	Name Contractor	
Equ ip. #	NO - M E N	DESCRIPTION (Of Equipment or Labor) Regional Steel										Name	Contractor
1	1	Superintendent	8									Gaige, Lance	RSC
2	1	Foreman	0									Van Brusselen, Jon	RSC
3	1	Ironworker	8									Vallarreal, Jose	RSC
4	1	Ironworker	8									Manzano, Jose	RSC
5	1	Ironworker	8									Lopez, Jorge	RSC
6	1	Ironworker	8									Greenlee, Tim	RSC
7	1	Ironworker	0									Rodriguez, Ernesto	RSC
8	1	Ironworker	0									Gomez, Daniel	RSC
9	1	Ironworker	0									Balderrama, Julio	RSC
10	1	Ironworker	8									Espinoza, Sal	RSC
11	1	Ironworker	0									Mortenson, Kurt	RSC
12	1	Ironworker	0									Bell, Joe	RSC
14	1	Ironworker	0									Stockton, Luke	RSC
15	1	Ironworker	8									Quiroz, Victor	RSC

Weather: Sunny, mild, wet ground, Hi 60 F Lo 46 F.

Description of Operation:

ABF

See L. Mathur's diary for labor, equipment and daily activities. Also see M. Bruce's diary for additional comments.

Daily for Regional Steel

Started installing internal (#36L15-L8Txx) and external (#36L15-L8Txx) rebar in west wall.  
 Started installing east transverse wall jacking saddle horizontal/vertical t-heads #29HT01/#29HV06-08 see sheet 49S7R1.  
 Started installing #25 and #29 vertical bars in transverse diaphragm based on vertical height surveyed by ABF

REC'D 08 MAY 31 #004969

Started installing northeast jacking saddle rebar designated as #29HV03-02 plan allow RSC to use 6 #29HV03 or as an alternative use 4 #32HV03 bars and 6 #36HV02 as oppose to 9 #29HV02. RSC chose to use 4 #32 and 6 #36 HV03 and HV02 respectively. See sheet 497S8R1.  
See M. Bruce & D. Chung diaries for additional comments.

NOTES:

- Provided Lance with access opening rebar layout.
- Lance installed west wall #36L15-L8 interior and exterior bars with the incorrect couplers at own risk. Is requesting thru RFI to splice correct coupler in for these bars.

Office

Attended weekly Concrete meeting with ABF and TYLin

**Inspector:**


Pamela Gagnier



Trans Engineer (C)/Asst. Struct. Rep



West wall rebar.

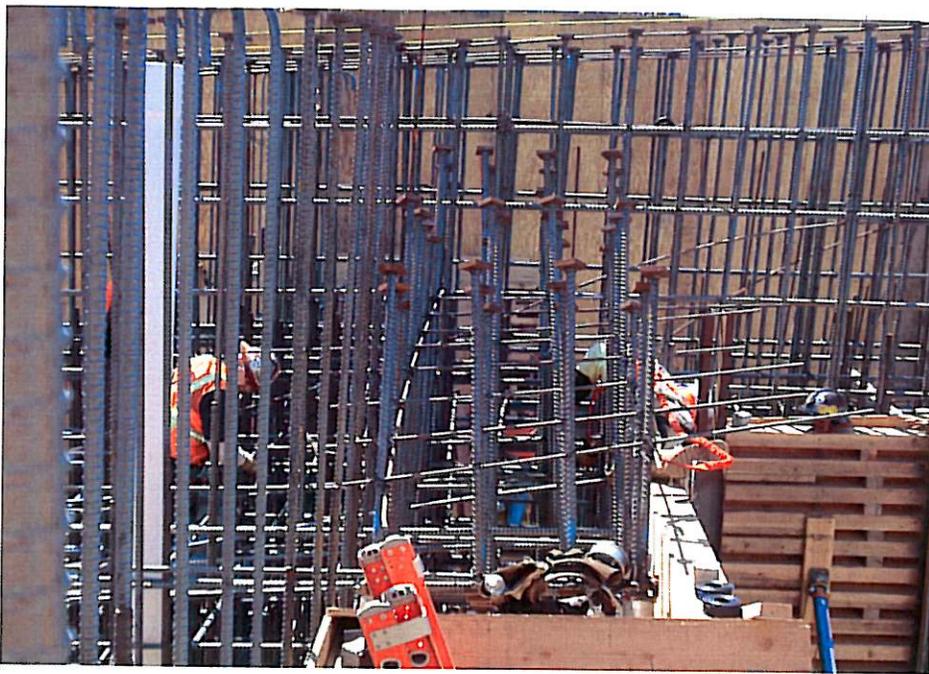

#32HV bar northeast jacking saddle block.



#25 & #29 vertical transverse rebar (from left to right) showing yellow string line surveyed by ABF.