

EA	04-0120F4
Co-Rte-KP (PM)	SF-080-13.2/13.9 (8.2/8.7)
Structure Rep.	Rick Morrow




File Name:	Nov-18-2008 W2 Cap 005
Date:	11-18-08
By Int:	M Bruce

Description: Ironworkers installing ducts for W-23B to W-35B at the east bulkhead with the assistance of ABF surveyors.

File Name:	Nov-18-2008 W2 Cap 008
Date:	11-18-08
By Int:	M Bruce

Description: Laborers are seen sandblasting the pour 4 construction joint. Also piledrivers are seen removing the templates for the vertical PT bars at the Hinge K assemblies.

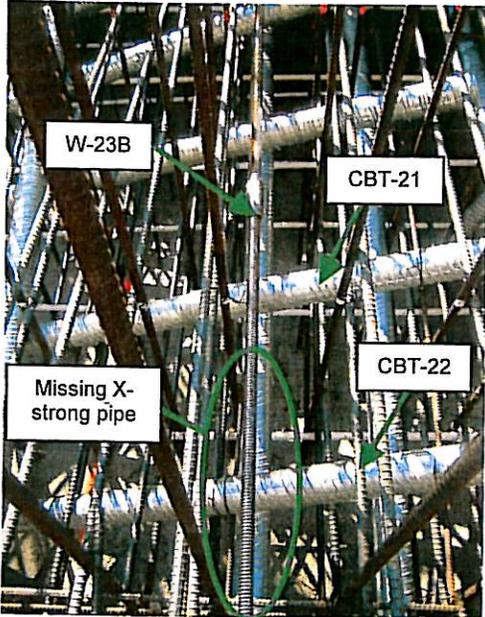

File Name:	Nov-18-2008 W2 Cap 011
Date:	11-18-08
By Int:	M Bruce

Description: The X-strong duct for W-23B was missing near the east bulkhead. I informed RS foreman Tim Greenlee of this issue and ironworkers were seen towards the end of the day installing the X-strong pipe.

File Name:	Nov-18-2008 W2 Cap 014
Date:	11-18-08
By Int:	M Bruce

Description: The curved ducts for W-23B to W-35B appeared to be adequate. However the ducts in the column cages are still not straight. ABF and RS have been informed about this issue on several occasions. This situation also occurred at W2E with continuity tendons E-30B through E-38B.