

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave. St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:** Pursell, Gary**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-016187**Date Inspected:** 05-Aug-2010**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1900**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:** Mr. Wu shi guo/Xu Tao**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** OBG**Summary of Items Observed:**

On this date Caltrans OSM Quality Assurance (QA) Inspector, Nagalingam Pandaram Pillai was present during the times noted above for observations relative to the work being performed.

In process Inspection

Bay #14

This QA Inspector observed the following work in progress:

SMAW in the 3F position for the OBG Segment 12BW X3P Plate, weld No: SEG3005B-056. The welder is identified as #045133. ZPMC QC is identified as Mr. Wang wei ming. The welding variables recorded by QC appear to comply with WPS-B-T-2113.

This QA Inspector observed the following work in progress:

FCAW in the 2G position for the OBG Segment 12BW Lifting lug, weld No: SEG3005D-256. The welder is identified as #045227. ZPMC QC is identified as Mr. Wang wei ming. The welding variables recorded by QC appear to comply with WPS-B-T-2232-TC-U5-F.

This QA Inspector observed the following work in progress:

SAW in the 1G position for the OBG Segment 13BW Bottom Plate weld No: SEG3014A-004. The welder is identified as #045270. ZPMC QC is identified as Mr. Wang xu. The welding variables recorded by QC appear to comply with WPS-B-T-2221-B-L2C-S-2. Please see the attached picture.

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

Bay #19

This QA Inspector observed the following work in progress:

FCAW in the 2G position for the Suspender Bracket weld No: SB016-072-049. The welder is identified as #062761. ZPMC CWI is identified as Mr. Xu Tao. The welding variables recorded by QC appear to comply with WPS-B-T-2232-TC-U4b-F. Please see the attached picture.

This QA Inspector observed the following work in progress:

FCAW in the 2F position for the Suspender Bracket weld No: SB020-080-006. The welder is identified as #062794. ZPMC CWI is identified as Mr. Xu Tao. The welding variables recorded by QC appear to comply with WPS-B-T-2132. Please see the attached picture.

This QA Inspector observed the following work in progress:

FCAW in the 2G position for the Suspender Bracket weld No: SB020-084-004. The welder is identified as #062783. ZPMC CWI is identified as Mr. Xu Tao. The welding variables recorded by QC appear to comply with WPS-B-T-2232-TC-U4b-F.

This QA Inspector observed the following work in progress:

FCAW in the 2G position for the Suspender Bracket weld No: SB019-076-025. The welder is identified as #062806. ZPMC CWI is identified as Mr. Xu Tao. The welding variables recorded by QC appear to comply with WPS-B-T-2232-TC-U4b-F.

Visual Inspection after Blast:-

Segment 10CW

This QA Inspector performed a preliminary random visual inspection after the grit blast of the Interior components of the Bottom panel, Side panel I-rips and longitudinal diaphragm of this segment. Areas of visual weld defects that will require welding were taped and will be repaired after the coating is applied. ZPMC QC personnel are aware of these areas and were present during the inspection.


Segment 10CE

This QA Inspector performed a preliminary random visual inspection after the grit blast of the Exterior components of the Deck panel, Bottom panel, Side panel and FL3 of this segment. Areas of visual weld defects that will require welding were taped and will be repaired after the coating is applied. ZPMC QC personnel are aware of these areas and were present during the inspection.

Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

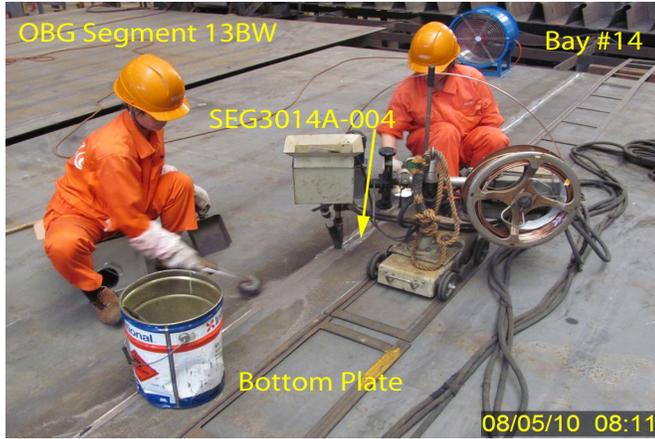

Summary of Conversations:

No Relevant Conversation.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric Tsang 150-0042-2372, who represents the Office of Structural Materials for your project.

Inspected By: Pillai,Pandaram

Quality Assurance Inspector

Reviewed By: McClendon,Timothy

QA Reviewer