

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave. St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 13.28**WELDING INSPECTION REPORT****Resident Engineer:** Pursell, Gary**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-007109**Date Inspected:** 10-Jun-2009**Project Name:** SAS Superstructure**OSM Arrival Time:** 2100**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 530**Contractor:** Oregon Iron Works Clackamas, Or.**Location:** Clackamas, Oregon**CWI Name:** Steve Barnett, Jon Nickolich**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** Hinge K Pipe Beams**Summary of Items Observed:**

On this date, Caltrans Quality Assurance Inspector (QA) Sherri Brannon is present at the Oregon Iron Works, Inc. (OIW) jobsite in Clackamas, Oregon for the purpose of observing fabrication of the Hinge K Pipe Beams.

OIW Fabrication Shop-Bay 1:

QA Inspector Brannon observed no production activity on Hinge K Pipe Beam sub assemblies noted below for the duration of the shift.

Hinge-K Pipe Beam Sub Assembly, cap plates MK#109.

OIW Fabrication Shop-Bay 3 (sub-assembly):

QA Inspector Brannon randomly observed OIW qualified welder's Mr. Mikhail Bannikov ID#B28 and Mr. Liam Bui ID#B10 welding fill pass's joining stiffener ring MK #a125 (HPS 485 W) to hinge K pipe beam half section MK#a124-15 (HPS 485 W). The partial joint penetration (PJP) groove weld is identified as weld joint #WM3-17. Mr. Bannikov was observed welding in the 1G (flat) position utilizing submerged arc welding (SAW) process with a 2.4mm diameter electrode, filler metal brand Lincoln Electric LA85 class F9A4-Eni5-G-H2. QA Inspector Brannon observed the OIW QC CWI Inspector's Mr. Steve Barnett and Mr. Jon Nickolich verifying that the pre-heat of 350°F and welding parameters were in accordance with the Welding Procedure Specification (WPS). Welding parameters measured by QA are as follows for root/fill: 586 amps, /36.0 volts and a travel speed of 457mm per minute appear to be in conformance with approved welding procedure specification WPS 4020 revision number 1.

OIW Fabrication Shop-Bay 3 (sub-assembly):

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

QA Inspector Brannon observed no production activity on Hinge K Pipe Beam sub assemblies noted below for the duration of the shift.

Hinge-K Pipe Beam Sub Assembly, MK#102A-1 - MK#a111-1 forging to MK#a110-1 base plate idle.

Hinge-K Pipe Beam Sub Assembly, MK#102A-4 - MK#a111-4 forging to MK#a110-4 base plate idle.

Hinge-K Pipe Beam Sub Assembly, MK#120A-4 – MK#a124-4 half fuse to MK#a124-13 half fuse.

Hinge-K Pipe Beam Sub Assembly, MK#120A-6 – MK#a124-1 half fuse to MK#a124-9 half fuse.

Hinge-K Pipe Beam Sub Assembly, Half fuse section MK#a124-15.

Note: QA Inspector Brannon also, observed pending CWR repair for MK#102A-1 weld joint W2-13 and MK#120A-4 weld joint W2-13 both have pending 1st time UT repairs.

OIW Fabrication Shop-Bay 6 (sub-assembly):

QA Inspector Brannon randomly observed OIW qualified welder's Mr. Bounheune Savanh ID#S74 and Vincent Vu ID#V7 welding low spots using soudotape 316L stainless steel overlay to hinge k pipe beam fuse sub-assembly 120A-3. The weld joint is identified as 316L 3rd layer. Mr. Savanh and Mr. Vu was observed welding in the flat position utilizing automatic electro slag welding (ESW) overlay process with a .5mm x 60mm soudotape 316L stainless electrode, filler metal brand Soudotape class EQ316L automatic. QA Inspector Brannon observed the OIW QC CWI Inspector's Mr. Steve Barnett and Mr. Jon Nickolich verifying that the pre-heat of 20°C and welding parameters were in accordance with Welding Procedure Specification (WPS). Welding parameters observed by QA Inspector Brannon are as follows: 1180 amps, 25.7 volts and a travel speed of 267mm per minute appear to be in conformance with approved welding procedure specification (WPS 7003) revision number 0.

OIW Fabrication Shop-Bay 6 (sub-assembly):

QA Inspector Brannon observed no production activity on Hinge K Pipe Beam sub assemblies noted below for the duration of the shift.

Hinge-K Pipe Beam Sub Assembly, MK#120A-1 – MK#a124-6 half fuse to MK#a124-7 half fuse.

OIW Storage Yard

Hinge-K Pipe Beam Sub Assembly, MK#102A-2 - MK#a111-2 forging to MK#a110-2 base plate idle.

Hinge-K Pipe Beam Sub Assembly, MK#102A-3 - MK#a111-3 forging to MK#a110-3 base plate idle.

Hinge-K Pipe Beam Sub Assembly, MK#120A-2 – MK#a124-3 half fuse to MK#a124-11 half fuse.

Note: QA Inspector Brannon also, observed pending repairs for MK#102A-2 weld joint W2-13 and MK#102A-3 weld joint W2-13 both have pending 1st time UT repairs.

Caltrans Status and Production Tracking:

QA Inspector Brannon also updated Caltrans status and production tracking logs for tracking of check samples, procedure qualification record (PQR), critical weld repairs (CWR), non-critical welding repairs (WRR), completed and in process welding, QC/QA non-destructive testing.


Material, Equipment, and Labor Tracking:

QA Inspector Brannon performed a verification of personnel at OIW. QA Inspector Brannon observed 2 Supervisor, 2 Quality Control and 4 production personnel on this date.

The following digital photograph below illustrates observation of the activities being performed.

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

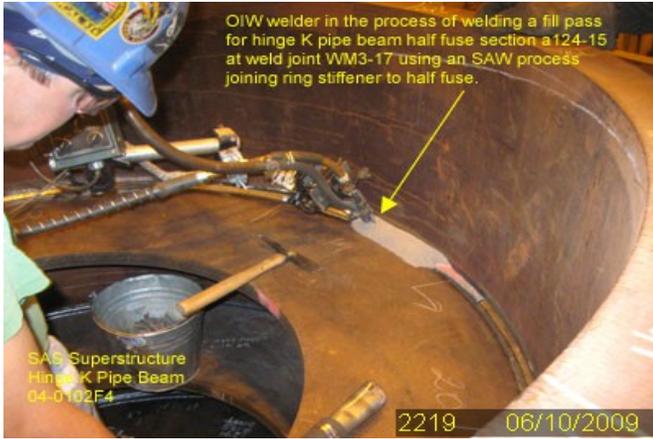

Summary of Conversations:

As noted within this report.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Mohammad Fatemi (916) 813-3677, who represents the Office of Structural Materials for your project.

Inspected By:	Brannon, Sherri	Quality Assurance Inspector
Reviewed By:	Adame, Joe	QA Reviewer
