

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave. St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 1.28**WELDING INSPECTION REPORT****Resident Engineer:** Siegenthaler, Peter**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-020558**Date Inspected:** 10-Feb-2011**Project Name:** SAS Superstructure**OSM Arrival Time:** 800**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1630**Contractor:** American Bridge/Fluor Enterprises, a JV**Location:** Job Site

CWI Name:	William Sherwood and John Pagliuca			CWI Present:	Yes	No	
Inspected CWI report:	Yes	No	N/A	Rod Oven in Use:	Yes	No	N/A
Electrode to specification:	Yes	No	N/A	Weld Procedures Followed:	Yes	No	N/A
Qualified Welders:	Yes	No	N/A	Verified Joint Fit-up:	Yes	No	N/A
Approved Drawings:	Yes	No	N/A	Approved WPS:	Yes	No	N/A
				Delayed / Cancelled:	Yes	No	N/A
Bridge No:	34-0006			Component:	Orthotropic Box Girder		

Summary of Items Observed:

Caltrans Office of Structural Material (OSM) Quality Assurance Inspector (QAI) Joselito Lizardo was present at the Self Anchored Suspension (SAS) job site as requested to perform observations on the welding of components for the San Francisco Oakland Bay Bridge (SFOBB) Project.

At OBG 9E/10E side plate 'E1' inside, QA randomly observed ABF/JV qualified welder Sungtao, Huang ID # 3794 continuing to perform CJP groove (splice) welding fill pass on the splice butt joint. The welder was observed perform automatic welding in the 3G (vertical) position utilizing a dual shield Flux Cored Arc Welding (FCAW-G) with E71T-1M, 1/16" diameter wire electrode and implementing Caltrans approved Welding Procedure Specification (WPS) ABF-WPS-D15-3042B-1. The joint being welded has a single V-groove butt joint with backing bar. The splice joint was preheated and maintained to greater than 150 degrees Fahrenheit using Miller Proheat 35 Induction Heating System heater blankets located at the opposite side of the plate prior/during welding. During welding, ABF Quality Control (QC) Steve Jensen was noted monitoring the welding parameters of the welder. At the end of the shift, fill pass welding was still continuing and should remain tomorrow.

QA randomly observed ABF/JV qualified welders Rory Hogan continuing to perform CJP groove (splice) back welding cover pass on Orthotropic Box Girder (OBG) 8W/9W side plate 'C1' outside. The welder was observed back welding in the 4G (overhead) position utilizing a dual shield Flux Cored Arc Welding (FCAW-G) with E71T-1M, 1/16" diameter wire electrode and implementing Caltrans approved Welding Procedure Specification (WPS) ABF-WPS-D15-3110-4. The welder was using a track mounted welder holder assembly that was remotely controlled. The joint being welded has the backing bar gouged using the Esab Plasma Arc machine and was ground smooth. The gouged and ground splice butt joint was also Non Destructive Testing (NDT) tested using the

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

Magnetic Particle Testing (MT). The splice joint was preheated and maintained to greater than 150 degrees Fahrenheit using Miller Proheat 35 Induction Heating System located on top of the plate prior welding and by moving the blanket to the side of the weld being welded during welding. The vicinity was also properly protected from wind and other climatic conditions. ABF Quality Control (QC) Fred Von Hoff was noted monitoring the welding parameters of the welder. During the shift, cover pass welding was completed at this location was completed and the welder has moved to side plate 'C2' of the same OBG splice.

At OBG 8W/9W side plate 'E' outside, QA randomly observed ABF personnel perform plasma arc gouging on the backing bar removal of the splice butt joint. The personnel were using an Esab plasma arc gouging machine that has the nozzle holder attached to a Bug-o track. Gouging of the backing bar was not completed today and should continue tomorrow.

At OBG 9W/10W top deck plate 'A3' outside, QA randomly observed ABF/JV qualified welder Wai Kitlai perform CJP repair welding. The welder was noted welding in 1G (flat) position utilizing SMAW with 1/8" diameter E7018H4R electrode implementing new Caltrans approved Welding Procedure Specification (WPS) ABF-WPS-D15-1003 Repair. The new repair procedure includes putting in place a copper backing alongside the typical steel backing bar when the repair excavation is expected to occur at the edge of the steel backing. The welding repairs were excavated to a boat shape profile and were tested with Magnetic Particle Testing (MT) prior welding. During welding, ABF QC John Pagliero was noted monitoring the welder and his welding parameters. QA noted parameter during welding was 130 amperes which appears in compliance to the WPS. The locations of the repairs were noted below;

Location	Y-dimension	Length	Width	Depth	Remarks
1. A3	3260mm	100mm	15mm	14mm	Completed
2. A3	2040mm	200mm	20mm	14mm	Completed
3. A3	1540mm	85mm	20mm	15mm	Completed
4. A3	690mm	110mm	20mm	12mm	Completed

At OBG 6W-PP46.5-W5 deck access hole inside, QA randomly observed ABF/JV qualified welder Jorge Lopez perform CJP groove welding repair. The welder was observed welding in the 3G (vertical) & 4G (overhead) position utilizing Shielded Metal Arc Welding (SMAW) with 1/8" diameter E7018H4R electrode implementing welding procedure ABF-WPS-D15-1001-Repairs. The repair excavations were preheated to more than 140 degree Fahrenheit using propane gas torch prior welding. During the shift, ABF QC William Sherwood was noted monitoring the welder. Prior welding, ABF QC William Sherwood was also observed performing Magnetic Particle Testing (MT). The locations of the repairs were noted below;

Location	Y-dimension	Length	Width	Depth	Remarks
1. Transverse Stiffener	190mm	50mm	20mm	9mm	Completed
2. Deck Access Hole	85mm	70mm	23mm	9mm	Completed


WELDING INSPECTION REPORT

(Continued Page 3 of 3)

At OBG 9W/10W top deck plate 'A3' outside, slag inclusions were noted on the repair during the excavation.



At OBG 6W-PP46.5-W5-S deck access hole to top deck plate inside, ABF welder Jorge Lopez was observed performing 4G Shielded Metal Arc Welding (SMAW) welding repair on welded butt joint.

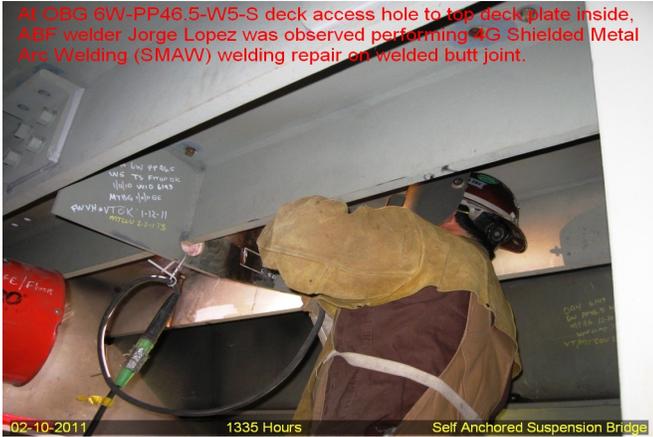

Summary of Conversations:

No significant conversation occurred today.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact SMR Nina Choy 510-385-5910, who represents the Office of Structural Materials for your project.

Inspected By: Lizardo, Joselito

Quality Assurance Inspector

Reviewed By: Levell, Bill

QA Reviewer