

**DEPARTMENT OF TRANSPORTATION**

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch  
690 Walnut Ave. St. 150  
Vallejo, CA 94592-1133  
(707) 649-5453  
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 1.28**WELDING INSPECTION REPORT****Resident Engineer:** Casey, William**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-029551**Date Inspected:** 11-May-2013**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1730**Contractor:** American Bridge/Fluor Enterprises, a JV**Location:** Job Site**CWI Name:** See below.**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** Tower ESW Welds**Summary of Items Observed:**

Quality Assurance Inspector (QA) Fritz Belford was at the American Bridge/Fluor (ABF) job site at Yerba Buena Island in California between the times noted above in order to monitor Quality Control functions and the in process work being performed by ABF personnel. The following items were observed:

**Welder Mike Jimenez #4671:**

The welder was observed performing weld repairs on the excavation on weld ESW E403 "Q" face A, at Y location 5375 to 6145 as per Request for Weld Repair (RWR) #201304-011. The excavation is in way of Ultrasonic Testing Shear Wave (UTSW) rejected indications. The welder was observed preheating the weld to 300 degrees Fahrenheit prior to welding using the Miller ProHeat 35 with heat induction blankets. The welder utilized the Welding Procedure Specification (WPS) ABF-WPS-D15-1000-Repair Rev.3 for Shield Metal Arc Welding (SMAW) using an E7018 H4R with a 5/32" diameter rod with current measured at 166 amps. The welding parameters were verified by QC Inspector Bernard Docena throughout the day and appeared to be in compliance with the WPS noted above.

The completed and accepted work observed at this location appeared to be in compliance with the contract specifications.


Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

---

# WELDING INSPECTION REPORT

( Continued Page 2 of 2 )

---

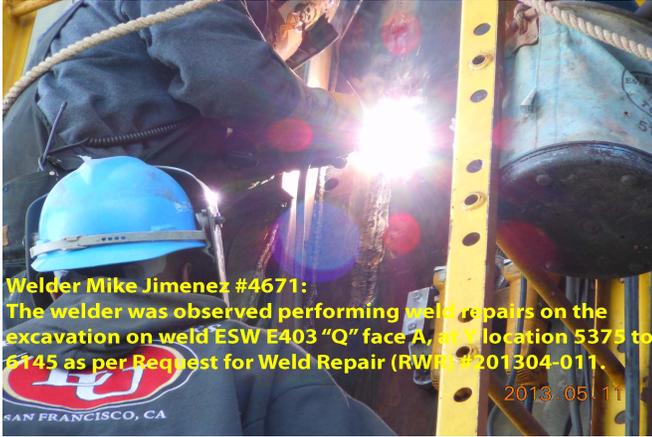

## Summary of Conversations:

Conversations this day as required for scope of work.

## Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Gary Thomas - (916) 764 - 6027, who represents the Office of Structural Materials for your project.

---

<b>Inspected By:</b>	Belford,Fritz	Quality Assurance Inspector
<b>Reviewed By:</b>	Mertz,Robert	QA Reviewer

---