

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave. St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 1.28**WELDING INSPECTION REPORT****Resident Engineer:** Casey, William**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-029955**Date Inspected:** 27-Aug-2013**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1730**Contractor:** American Bridge/Fluor Enterprises, a JV**Location:** Job Site

CWI Name:	Jesse Cayabyab, Bernie Docena	CWI Present:	Yes	No	
Inspected CWI report:	Yes No N/A	Rod Oven in Use:	Yes	No	N/A
Electrode to specification:	Yes No N/A	Weld Procedures Followed:	Yes	No	N/A
Qualified Welders:	Yes No N/A	Verified Joint Fit-up:	Yes	No	N/A
Approved Drawings:	Yes No N/A	Approved WPS:	Yes	No	N/A
		Delayed / Cancelled:	Yes	No	N/A
Bridge No:	34-0006	Component:	SAS Tower		

Summary of Items Observed:

Caltrans Quality Assurance Inspector (QA) Joe Adame arrived at the American Bridge/Fluor (ABF) JV job site between the times noted above in order to monitor ABF Quality Control activities and the in process work being performed by ABF production personnel. The following items were observed:

ESW Repair excavation

RWR-201308-003

ESW E-043, Location "Q"-Face A:

The QA Inspector was later present to observe ABF welder Donald Plumb (WID-0891) performing Shield Metal Arc Welding (SMAW) on the repair excavation on Electroslag Weld (ESW) "Q", at face A. The locations and repair information are listed in Request for Weld Repair (RWR) 201308-003 from Ultrasonic Testing indications designated for repair. The repair locations were noted as:

Y= 3800mm~4300mm

L= 500mm

W= 80mm

D= 70mm

Prior to welding ABF QC Inspector Bernie Docena performed informational Magnetic particle testing on the repair excavation to check for discontinuities that may have occurred during cooling overnight. Welder -0891 was observed preheating the weld to over 350° Fahrenheit prior to welding using the Miller ProHeat 35 with heat induction blankets. The welder was using 4.0mm diameter electrode (E7018-1 HR4) per ABF Welding Procedure Specification (WPS) ABF-WPS-D15-1000-Repair Rev.3. The welding parameters were verified by Mr. Docena with a Fluke 337 current clampmeter and preheat was verified with temperature indicators. The QC Inspector

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

performed welding parameters verifications at random intervals throughout the shift. The welding observed appeared to be in compliance with the WPS noted above.

ESW Repair excavation

ESW E-043, Location "Q"-Face B:

ABF-RFI-003457R00

RWR-201306-002

The QA Inspector was present to observe ABF welder Wai Kit Lai (WID-2953) performing Shield Metal Arc Welding (SMAW) on the repair excavation on Electroslag Weld (ESW) "Q", at face B. The locations and repair information are listed in Request for Weld Repair (RWR) 201306-002 from Ultrasonic Testing & Magnetic particle testing indications designated for repair. The repair locations were noted as:


Y=5800mm~6150mm

L=350mm

W=50mm

D=31mm

Prior to welding, Mr. Lai was observed preheating the weld to over 350° Fahrenheit prior to welding using the Miller ProHeat 35 with heat induction blankets. The welder was using 4.0mm diameter electrode (E7018-1 HR4) per ABF Welding Procedure Specification (WPS) ABF-WPS-D15-1000-Repair Rev.3. The welding parameters were verified by ABF QC Inspector Bernie Docena with a Fluke 337 current clampmeter and preheat was verified with temperature indicators. Mr. Docena performed welding parameters verifications at random intervals throughout the shift. The welding observed appeared to be in compliance with the WPS noted above.

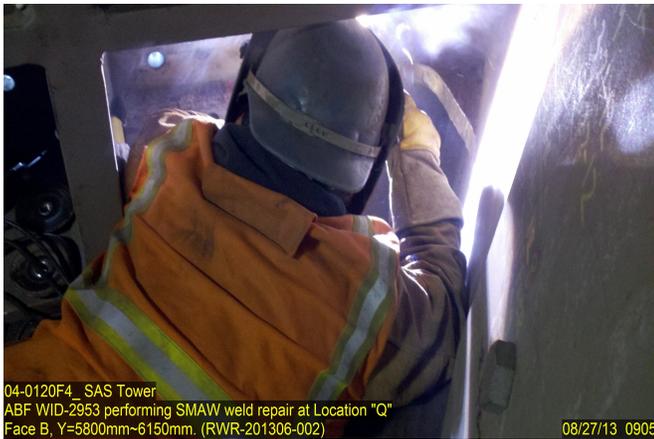

Summary of Conversations:

Only general conversations with ABF/JV QC NDT personnel relevant to work and testing performed during this shift.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Gary Thomas (916) 764-6027, who represents the Office of Structural Materials for your project.

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

Inspected By:	Adame,Joe	Quality Assurance Inspector
----------------------	-----------	-----------------------------

Reviewed By:	Mertz,Robert	QA Reviewer
---------------------	--------------	-------------