**DEPARTMENT OF TRANSPORTATION**
DIVISION OF ENGINEERING SERVICES
Office of Structural Materials
Quality Assurance and Source Inspection

Bay Area Branch
690 Walnut Ave.St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4
Cty: SF/ALA Rte: 80 PM: 13.2/13.9
File #: 69.28

# WELDING INSPECTION REPORT

**Resident Engineer:** Pursell, Gary
**Address:** 333 Burma Road
**City:** Oakland, CA 94607

**Report No:** WIR-010173
**Date Inspected:** 26-Oct-2009

**Project Name:** SAS Superstructure
**Prime Contractor:** American Bridge/Fluor Enterprises, a JV
**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island

**OSM Arrival Time:** 645
**OSM Departure Time:** 1845
**Location:** Shanghai, China

| | | | | | | | |
|---|---|---|---|---|---|---|---|
| **CWI Name:** | Shen Fu You | | | **CWI Present:** | ☑ Yes | ☐ No | |
| **Inspected CWI report:** | ☐ Yes | ☑ No | ☐ N/A | **Rod Oven in Use:** | ☐ Yes | ☐ No | ☑ N/A |
| **Electrode to specification:** | ☐ Yes | ☐ No | ☑ N/A | **Weld Procedures Followed:** | ☐ Yes | ☐ No | ☑ N/A |
| **Qualified Welders:** | ☐ Yes | ☐ No | ☑ N/A | **Verified Joint Fit-up:** | ☑ Yes | ☐ No | ☐ N/A |
| **Approved Drawings:** | ☑ Yes | ☐ No | ☐ N/A | **Approved WPS:** | ☐ Yes | ☐ No | ☑ N/A |
| | | | | **Delayed / Cancelled:** | ☐ Yes | ☑ No | ☐ N/A |

**Bridge No:** 34-0006
**Component:** OBG Components

**Summary of Items Observed:**

On this date Caltrans OSM Quality Assurance (QA) Inspector, Hiranch Patel, was present during the times noted above for observations relative to the work being performed.

Segment6CW

Caltrans Quality Assurance Inspector found three (03) Rejectable Indication inside the cope hole in segment6CW, weld#Seg031F-025 (18mm in length) and Seg031F-027 (two indications having 15 and 12 mm in length) during 10% Magnetic Particle Testing on the weld previously inspected and accepted by ZPMC. For further information, please see the attached pictures below.

Segment 6CW

This QA inspector performed MT of approximately 15% of the area previously tested and accepted by ZPMC Quality Control personnel. This QA Inspector generated an MT report for this date. The member is identified as OBG Components. The weld designations reviewed are as follows:

-(SSD031-PP45.5-049, 050, 051, 052, 053, 054, 055, 056, 057, 058, 059, 060)
-(SSD031-PP45.5-037, 038, 039, 040, 041, 042, 043, 044, 045, 046, 047, 048)
-(SSD031-PP45.5-085, 086, 086, 088, 089, 090, 091, 092, 093, 094, 095, 096)

Segment 6CW

This QA inspector performed MT of approximately 15% of the area previously tested and accepted by ZPMC Quality Control personnel. This QA Inspector generated an MT report for this date. The member is identified as OBG Components. The weld designations reviewed are as follows:

-(Seg031D-023, 024, 020, 022, 004, 005, 027, 025)
-(Seg031D-023, 024, 022, 020, 004, 005)

-(Seg031F-025, 027)- found Linear Indications
Segment 6CW
This QA inspector performed MT of approximately 15% of the area previously tested and accepted by ZPMC Quality Control personnel. This QA Inspector generated an MT report for this date. The member is identified as OBG Components. The weld designations reviewed are as follows:
-(SSD12-PP046-108, 110, 112, 114, 115, 116, 118)
-(SSD12-PP046-096, 098, 100, 102, 104, 106)
-(SSD12-PP046-037, 039, 041, 043, 045, 047)
-(SSD11-PP045-006, 008, 010, 012, 104, 016)
Segment 6CW
This QA inspector performed MT of approximately 15% of the area previously tested and accepted by ZPMC Quality Control personnel. This QA Inspector generated an MT report for this date. The member is identified as OBG Components. The weld designations reviewed are as follows:
-(SSD12A-PP046-034, 036, 038, 040, 042, 044)
-(Seg031B-010, 015)

Unless otherwise noted, all observed on this date appeared to generally comply with applicable contract documents.

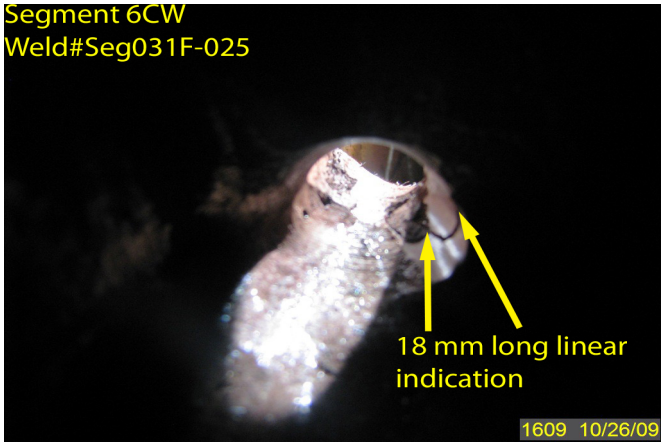


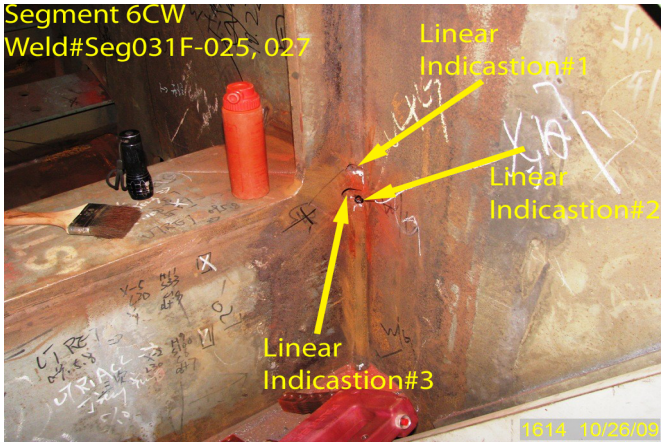


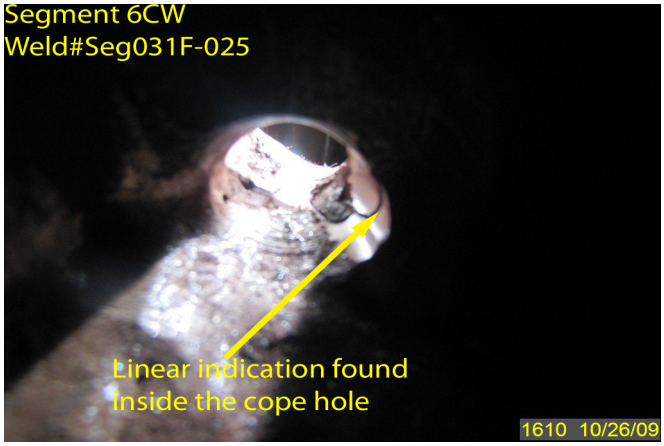


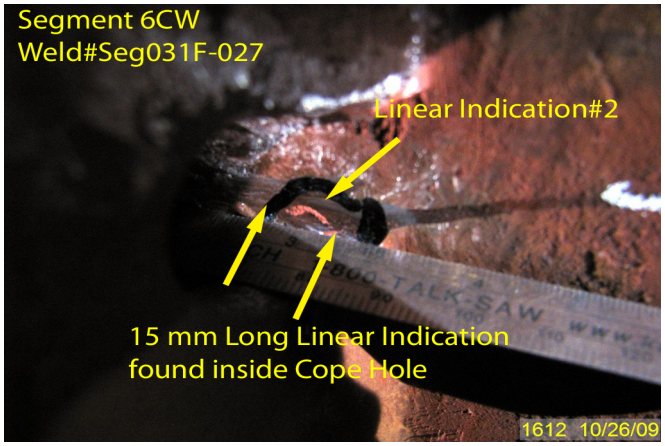


**Summary of Conversations:**

No relevant conversations.

**Comments**

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric Tsang 150-0042-2372, who represents the Office of Structural Materials for your project.

| | | |
|---|---|---|
| **Inspected By:** | Patel,Hiranch | Quality Assurance Inspector |
| **Reviewed By:** | Patterson,Rodney | QA Reviewer |