DEPARTMENT OF TRANSPORTATION
DIVISION OF ENGINEERING SERVICES
Office of Structural Materials
Quality Assurance and Source Inspection

Bay Area Branch
690 Walnut Ave.St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4
Cty: SF/ALA Rte: 80 PM: 13.2/13.9
File #: 69.28

WELDING INSPECTION REPORT

Resident Engineer: Pursell, Gary
Address: 333 Burma Road
City: Oakland, CA 94607

Report No: WIR-015744
Date Inspected: 20-Jul-2010

Project Name: SAS Superstructure
Prime Contractor: American Bridge/Fluor Enterprises, a JV
Contractor: Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island

OSM Arrival Time: 645
OSM Departure Time: 1845
Location: Shanghai, China

CWI Name: Yang Bai Qian.

Inspected CWI report:	☐ Yes	☑ No	☐ N/A	**Rod Oven in Use:**	☐ Yes	☐ No	☑ N/A
Electrode to specification:	☑ Yes	☐ No	☐ N/A	**Weld Procedures Followed:**	☑ Yes	☐ No	☐ N/A
Qualified Welders:	☑ Yes	☐ No	☐ N/A	**Verified Joint Fit-up:**	☑ Yes	☐ No	☐ N/A
Approved Drawings:	☑ Yes	☐ No	☐ N/A	**Approved WPS:**	☑ Yes	☐ No	☐ N/A
				Delayed / Cancelled:	☐ Yes	☑ No	☐ N/A

CWI Present: ☑ Yes ☐ No

Bridge No: 34-0006
Component: Orthotropic Box Girder(OBG)

Summary of Items Observed:

On this date Caltrans OSM Quality Assurance (QA) Inspector, Amit K. Juvekar, was present during the times noted above for observations relative to the work being performed.

Subassembly, Bay 04, 13CE, Deck panel to U-rib.

FCAW Repair welding of partial penetration weld joints DP3107-001-005, 003, 138, 179; located on subassembly, Bay 04, 13CE. Welder is identified as 062265; ZPMC Quality Control Inspector (QC) is identified as Yang Bai Qian. The welding variables recorded by Quality Control Inspector (QC) appeared to comply with the Applicable WPS: WPS-345-FCAW-2G(2F)-FCM-REPAIR. The attached photographs provide additional detail.

Y-Locations of repairs were;
W005 – 4550, 2250, 3450mm.
W003 – 3450, 1150, 4550mm.
W138 – 1050mm.
W179 – 2150mm.

Subassembly, Bay 04, 13AE, Deck Panel U-ribs.

During Random Visual in process Inspection, this QA inspector observed ZPMC NDT personnel “Tany Xingshan” carrying out Ultrasonic Testing (UT) for Lack of Penetration (LOP) on Deck panel to U-rib weld on repair locations. Deck Panel identified as DP3078-001. The attached photographs provide additional detail.

Subassembly, Bay 04, 13CE, Deck panel to U-rib.

WELDING INSPECTION REPORT

(Continued Page 2 of 2)

FCAW Repair welding of partial penetration weld joints DP3106-001-001, 006; located on subassembly, Bay 04, 13CE. Welder is identified as 062265; ZPMC Quality Control Inspector (QC) is identified as Yang Bai Qian. The welding variables recorded by Quality Control Inspector (QC) appeared to comply with the Applicable WPS: WPS-345-FCAW-2G(2F)-FCM-REPAIR.

Y-Locations of repairs were;
W001 – 2450, 4250, 4650mm.
W006 – 4650mm.

Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

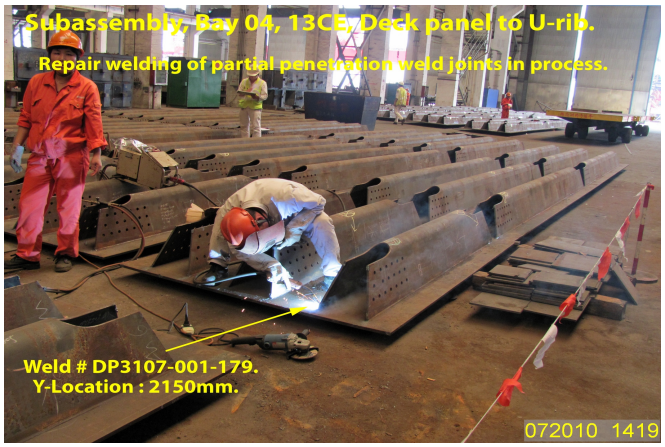

Summary of Conversations:
No relevant conversations.

Comments
This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric Tsang, 1500.042.2372, who represents the Office of Structural Materials for your project.

Inspected By:	Juvekar,Amit	Quality Assurance Inspector
Reviewed By:	Carreon,Albert	QA Reviewer