

Dist	COUNTY	ROUTE	POST MILES TOTAL PROJECT	SHEET TOTAL SHEETS


 REGISTERED CIVIL ENGINEER
 October 30, 2015
 PLANS APPROVAL DATE
 THE STATE OF CALIFORNIA OR ITS OFFICERS OR AGENTS SHALL NOT BE RESPONSIBLE FOR THE ACCURACY OR COMPLETENESS OF SCANNED COPIES OF THIS PLAN SHEET.




REGISTERED PROFESSIONAL ENGINEER
 Robert B. Hoggan
 No. 667378
 Exp. 9-30-16
 CIVIL
 STATE OF CALIFORNIA

LEGEND

 SPALL REPAIR

- NOTES:**
1. See Project Plans for spall repair locations.
 2. Combine spall repair areas closer than 2' apart.
 3. If the spall repair area is less than 6" from a joint, extend the repair to the joint.
 4. Cut at least 2" beyond the rectangular limits of unsound concrete determined by the Engineer. Determine the saw cut depth using the following table:

Conc MATERIAL	SAW CUT DEPTH	
	Min	Max
FAST-SETTING	2"	3 1/2"
POLYESTER	1 1/2"	3 1/2"

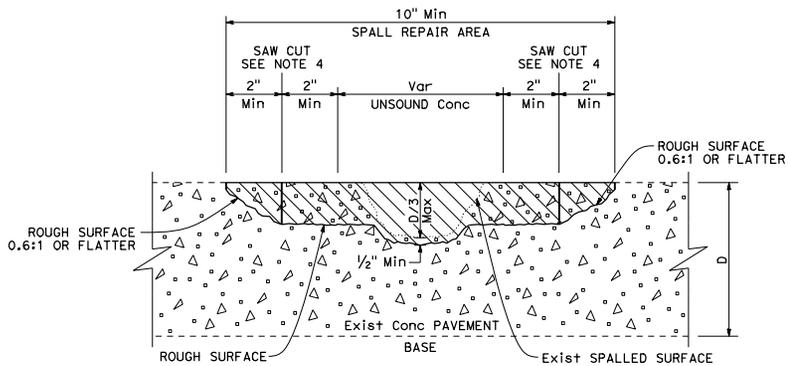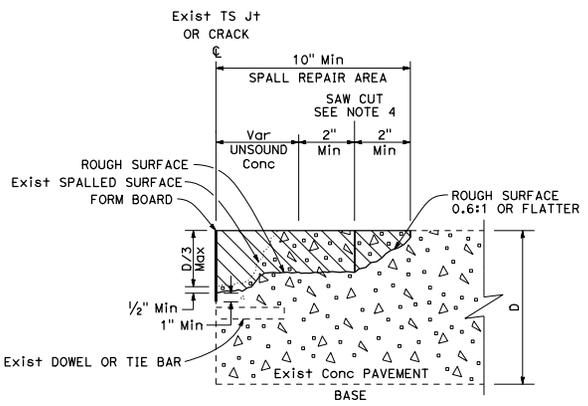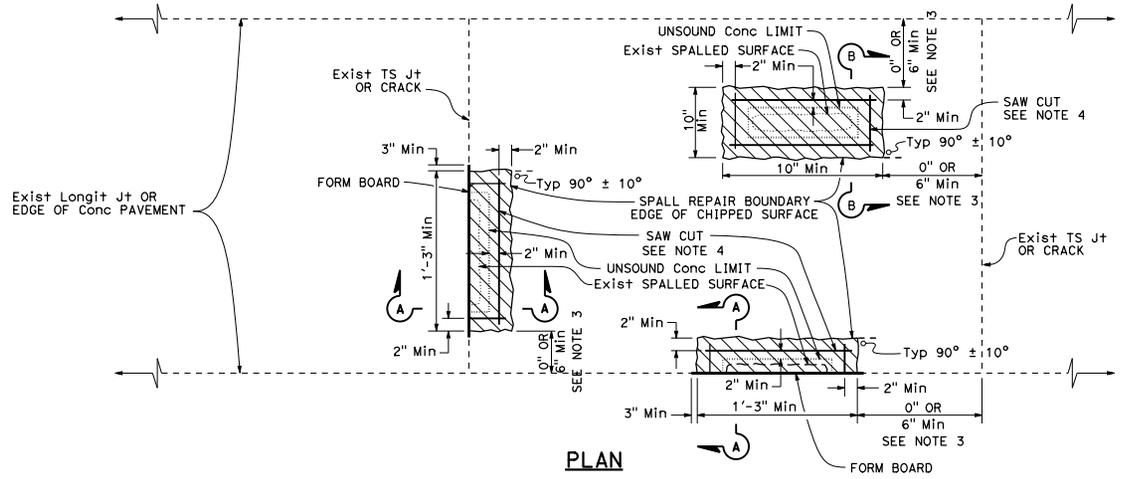

JOINT, CRACK, OR EDGE OF CONCRETE PAVEMENT REPAIR

MISCELLANEOUS SPALL REPAIR

STATE OF CALIFORNIA
 DEPARTMENT OF TRANSPORTATION
SPALL REPAIR
 NO SCALE