

Job Stamp 04-0120F4 SFOBB SAS

Const. Calendar:	415
Project Work Day No.:	625
Date	02/01/2008
Inspectors	Start 09:00 Stop 14:20
Hours	
Shift Hours	07:00 15:30

ASSISTANT RESIDENT ENGINEER'S **CONTRACTOR – ABFJV, Sub RPS**

Weather: Partly cloudy, light rain in the afternoon with mild temperature - Hi 53 F Lo 38 F (per weather.com forecast)

Description of Operations @ W2 Cap Beam:

ABF

- Clean-up of forms (picking-up tie wire, vacuuming) in the south 1/3 section in preparation for the concrete placement scheduled for Tuesday February 5th.
- Continued to address falsework punchlist items.
- Construction of the stay-form blockout for the vertical bars continues in the northwest corner of the W2 cap beam. Also construction of stay forms continued on the north 1/3 section.
- Installed Hinge K embedded plates used to support Macalloy bars.
- Notified Branden Bedwell that VT 1, 7, 14, & 16 blockouts/bearing plates near W2E marked in yellow on the duct need to be plumb, see picture below. He indicated that RPS is aware that the spirals need to be fixed in addition to the bearing plate being plumb.

RPS

- Placed #16 angle bars near the trumpet near the CBT blockouts in the south. See sheets 499R2, 504R1, 505R1, and Pamela's diary for more details
- Continued to address punchlist items see Pamela's diary for details.
- Spirals still need to be centered over the bearing plate, the spiral pitch needs to be adjusted, and the proper distance between the bearing plate and the spiral reinforcing needs to be maintained.
- Installed #19 formsavers at the W2E bulkhead, see picture below.

Office Work:

- Wrote today's diary.


Survey Work:

- Set marks with David Bradd on W2 falsework pipes to monitor settlement and elastic shortning.

Inspector:

Matt Bruce Matt Bruce Transportation Engineer (D)

EA	04-0120F4
Co-Rte-KP (PM)	SF-080-13.2/13.9 (8.2/8.7)
Structure Rep.	Rick Morrow

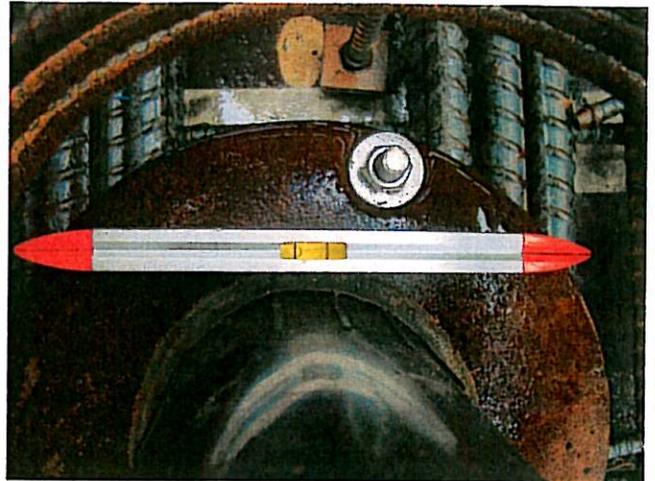


File Name:	DSC00775		
Date:	02-01-08	By Int:	S Song

Description: Installation of #19 form-savers near W2E OBG bulkhead.

File Name:	DSC00789		
Date:	02-01-08	By Int:	S Song

Description: VT near W2E bearing plate not plumb.

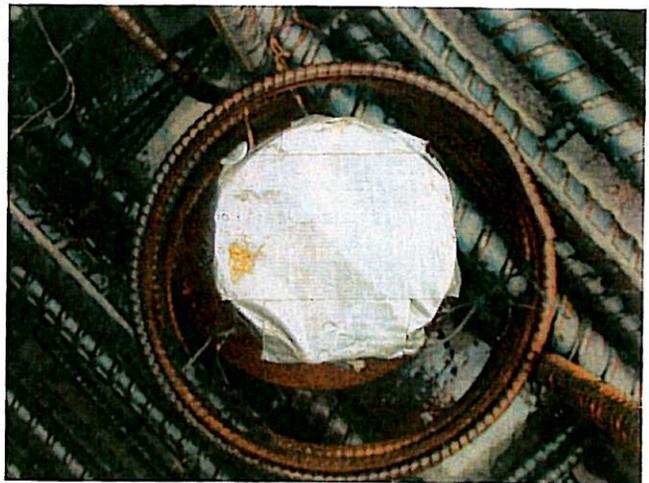

File Name:	DSC00790		
Date:	02-01-08	By Int:	S Song

Description: Bearing plates/blockouts that were not plumb and marked yellow as seen on the duct.

File Name:	DSC00783		
Date:	02-01-08	By Int:	S Song

Description: Spiral not centered over the bearing plate