

Job Stamp  
**04-0120F4**  
**SFOBB SAS**

Const. Calendar Day No. 538  
Project Work Day No. 748  
Date **06/03/2008**  
Shift Hours Start 6:30 Stop 3:00  
Inspector Shift 06:30 AM to 4:00 PM

**ASSISTANT RESIDENT ENGINEER'S CONTRACTOR - ABFJV**

EQUIPMENT AND/OR LABOR:			HOURS - ITEM NO.										REMARKS				
Equip. #	NO. MEN	DESCRIPTION (Of Equipment or Labor)	#38 Str. Concrete, Bridge	# 48 Bar Reinforcement Steel											IDLE OR DOWN	Name	Contractor
1	1	Gen. Foreman	9													Terry Cronk	ABF
2	1	Pile Driver	8													Tony Crieghton	ABF
3	1	Pile Driver	8													George Mcneil	ABF
4	1	Laborer	8													Jose Molina	ABF
5	1	Laborer	8													Rickie Campos	ABF
6	1	Crane Operator	9													Dale Thomas	ABF
7	1	Pile Driver												8		Rodney Thompson	ABF Pier 7
8	1	Pile Driver J/M	8													Audre Hudson	ABF
9	1	Operator Apprentice/Forklift and Elevator	8													Douglas Greene	ABF
10	1	Pile Driver/Welder	9													Harry Wheat	ABF
11	1	Elevator Operator	9													Howard Schroyer	ABF
12	1	Pile Driver	9													Nigel Lohse	ABF Foreman
13	1	Pile Driver														Terry Brown	ABF Gone for 2-3 months
14	1	Pile Driver												8		Eddy Mondassa	ABF Pier 7
15	1	Pile Driver	8											8		Josh Menchaca	ABF to Pier 7
16	1	Pile Driver														Tony Bragg	ABF Laid off as of today.
18	1	Pile Driver	8													Paul Mason	ABF
19	1	Pile Driver	8													Andy Adam	ABF
20	1	Pile Driver	8													Kurt Chaffion	ABF
21	1	Pile Driver	8													Jesse Johnasen	ABF
22	1	Pile Driver Foreman												8		Leo Vego	ABF to Pier 7
23	1	Pile Driver												8		Henry Wheat	ABF to Pier 7
24	1	Pile Driver												8		Rickie Yembo	ABF to Pier 7
25	1	Pile Driver												8		Paul Eckstrom	ABF to Pier 7
25	1	Pile Driver												8		Ken Reynolds	ABF
26	1	Iron worker														Tim Greenlee	ABF/RSC
	1	1 <sup>st</sup> Man Lift S-125															Hertz Rental
	1	Lincoln Vantage Welding M/C 768-50-4005	8														ABF
	1	Lincoln Vantage Welding M/C 768-50-4009															ABF
	1	Lincoln Vantage Welding M/C 768-30-4032												8			Hertz Rental

1	Lincoln Vantage Welding M/C 768-30-4014	8											Hertz Rental
1	MQ Power Generator 220	9											ABF Main power
1	MQ Whisper Watt 7000 549-07-5006	8											ABF
1	MQ Whisper Watt 7000 549-20-4007								8				ABF
1	MQ Whisper Watt 7000 549-20-4044								8				ABF
1	Ingersoll Rand Air compressor 20-2183								8				ABF central
1	Ingersoll Rand Air Compressor 006-18-4293								8				ABF
1	Ingersoll Rand Air Compressor 185R								8				ABF Deck
1	Ingersoll Rand Air Compressor 006-18-4297	8											ABF
1	Ingersoll Rand Flood Lights 536-40-6831												ABF power
1	Genie 541-4000N Flood Lights 536-40-7044	8											ABF deck S-E
1	Genie 541-4000N Flood Lights 536-40-4839								8				ABF power
1	Genie 541-4000N Flood Lights 536-40-4843								8				ABF power
1	Genie 541-4000N Flood								8				ABF power
1	Genie 541-4000N Flood								8				ABF power
1	Forklift Hertz Rental 544D-10	8											ABF
1	Pickup	2											ABF
1	Elevator	9											ABF

**Weather:** Coudy earlier, sunny later, wind medium to high, Hi 68 F Lo 55 F

**Description of Operation:**

ABF continues cleaning/removing the sand blasting material from the top and the concrete floor.

ABF/CT conducted the inspection of sand blasted surface this morning. The west half of the pour had some spots with lot of fines which needed to be removed to expose the aggregates. The east half of the pour had lot of cracks, specially at the locations of the horizontal rebars with welded heads. But this area was relatively free of fine accumulations requiring additional sand blasting.

ABF erected the 3<sup>rd</sup> Hinge K Assemblies at about noon time. ABF was trying to secure the Assembly on the supporting frames.

ABF is installing the block outs on the north-west wall.

RSC is installing the PT ducts in the north cages.

ABF surveyors are giving the alignment for the supporting frames for Hinge K on the north side. It was off on all corners by 6 mm to 14 mm and these corners needed to be corrected.

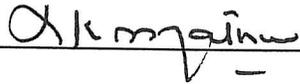
By end of the day, it was clear that the 3<sup>rd</sup> Hinge K Assembly was not properly secured nor was it properly aligned. It was found shaking in the east west direction with an amplitude of 1 to 2 inches. Terry of ABF was too worried to leave it like this for the night. Steve Marco agreed with this. ABF finally decided to put additional bracing support to the vertical frames supporting the Assembly. A crew of 4-5 people stayed about 1 hour extra.

**Additional Work on/off site:**

- (a) The Temporary Tower Foundation work continues.
- (b) CC Myers continues to work for the W3 and Temporary Foundations for moving the existing bridge in the vicinity.

- (c) Conducted inspection of the sand blasted surface along with John Beede, Ron Matin, Pamela and David Chung. 9 AM.
- (d) Lalit and Matt worked an hour OT to finish securing the 3<sup>rd</sup> assembly of Hinge K by ABF. ABF added additional braces to secure the supporting frames.

**Inspector:**

Lalit Mathur  Trans Engineer (D)/Asst. Struct. Rep