

STATE OF CALIFORNIA	Job Stamp	7-day Const. Calendar	Day No. 490
DEPARTMENT OF TRANSPORTATION	SFOBB SAS	Project Work Day No.	Day No. 700
Form HC-10A (Rev. 6/80)	04-0120F4	Date	04/16/2008

Inspectors Hours	Start	0630	Stop	1700
Shift Hours	Start	0630	Stop	1700

ASSISTANT RESIDENT ENGINEER'S

CONTRACTOR - ABFJV

		HOURS - ITEM NO.												
EQUIPMENT AND/OR LABOR:		Regular	OT									IDLE OR DOWN	REMARKS	
Equip. #	NO. MEN	DESCRIPTION (Of Equipment or Labor)											Name	Contractor
		DB-5 Marine Barge	8											
		Big Digger Marine Barge	8											
		Operator	8	2									Kirt Dillard	Traylor Dutra
		Operator	8	2									Ernie Hamilton	Traylor Dutra
		Pile driver Journeyman	8	2									Robert Utley	Traylor Dutra
		Pile driver Journeyman	8	2									Travis Logsdon	Traylor Dutra
		Pile Driver Journeyman	8	2									Danny Vega	Traylor Dutra
		Pile driver Journeyman	8	2									Richard Hiebert	Traylor Dutra
		Pile Driver Appentice	8	2									Gary Lewis	Traylor Dutra
		Operator	8	2									Joe Boracci	Traylor Dutra
		Operator	8	2									Bud Germany	Traylor Dutra
		Operator	8	2									Theo Rohr	Traylor Dutra
		Pile driver Journeyman	8	2									Lee Tacker	Traylor Dutra
		Pile driver Journeyman	8	2									Steve Gordon	Traylor Dutra

Weather: Partly Cloudy Hi 67 °F, Lo 46 °F.

Description of Operation:
Temporary Towers D,F and G

Activities:

1. Office work:

- Review plans, special provisions and ABF submittals # 756 for Temporary towers D, F and G

2. Field work:

- Berth 7: Traylor Dutra crew continued mobilization their equipment on two barges BD # 5 and Big Digger.
- The inspection of double beams for Temporary Tower D false work has found that there are two issues about the actual work don't complied with the submitted plans such as:
 - There are six splicing joints in six double beams W36x230x40' which are not indicated in approved drawings. (photos attached)
 - On site double beam W36x230x40', stiffeners are **extended out 1/4"** of the flange edge. In the general notes # 4 sheet 08-002B-01 is **extend to within 1/4"** of the flange edge. (photos attached)


3. Overtime reasons

Stayed two hours to observed construction activities, because contractor worked overtime

REC'D 08 JUN-28 #005250

THANH V. LE
[Signature]

A.S.R.

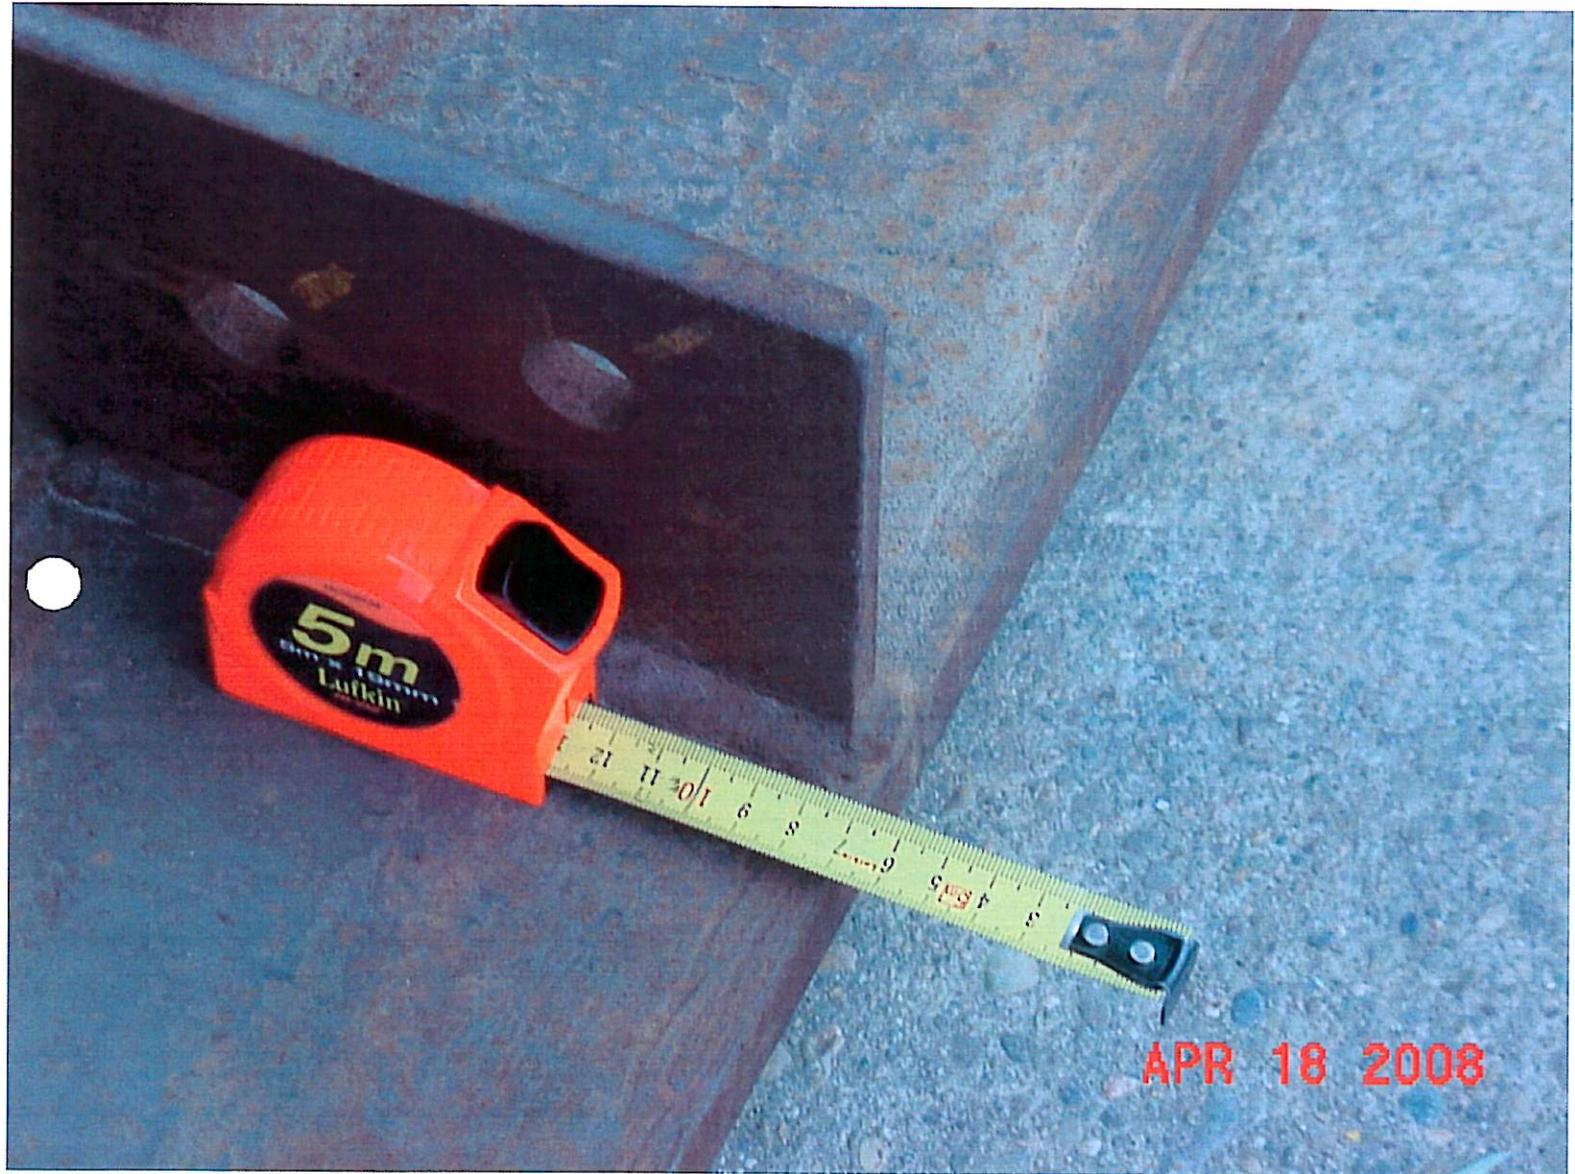





APR 15 2008



APR 16 2008



APR 16 2008

