

Job Stamp

04-0120F4

SFOBB SAS

Const. Calendar: 897

Project Work Day No.: 1107

Date 05/28/2009

Inspectors Start 09:00 Stop 15:20

Hours

Shift Hours 07:00 15:30

AKM

ASSISTANT RESIDENT ENGINEER'S

CONTRACTOR - ABFJV, sub Bigge

HOURS - ITEM NO.

EQUIPMENT AND/OR LABOR:

Equip. #	NO. MEN	DESCRIPTION (Of Equipment or Labor)	#38 Str. Concrete, Bridge W2													IDLE OR DOWN	REMARKS	
				Name	Contractor													
1	1	General Foreman	8														Terry Cronk	ABF
2	1	W2 Pile Driver Foreman	8														Nigel Lohse	ABF
3	1	Pile Driver	8														Richard Yambao	ABF
4	1	Pile Driver	8														George McNeil	ABF
5	1	Laborer	8														Jose Molina	ABF
6	1	Laborer	8														Rigiberto Campos	ABF
7	1	Pile Driver J/M	8														Audre Hudson	ABF
8	1	Pile Driver/Welder	8														Henry Wheat	ABF
9	1	Elevator Operator	8														Howard Schroyer	ABF
10	1	Pile Driver	8														Andrew Adams	ABF
11	1	Pile Driver	8														Kurt Chaisson	ABF
12	1	Pile Driver	8														Jesse Johnsen	ABF
13	1	Crane Operator	8														Dale Thomas	ABF
14	1	Operator Apprentice/Oiler	8														Scott Ross	ABF
15	1	Pile Driver	8														Abasi Delley	ABF
16	1	Laborer	8														Pedro Garod	ABF
17	1	Laborer	8														Ignacio Garcia	ABF
18	1	Piledriver	8														Daniel Schwartz	ABF
19	1	Crane Operator	8														Ben Scott	ABF
20	1	Laborer	8														Byron Contreras	ABF
21	1	Ironworker Foreman	8														Bobby Leyva	Bigge
LR1300	1	Crane	8														Liebherr	ABF
	1	Elevator	8															ABF
5573-140	1	Forklift 544D-10	4												4		Hertz Rental	ABF
481-93-6013	1	Manlift S-125	8														Hertz Rental	ABF
481-93-6009	1	Manlift S-125	8														Hertz Rental	ABF
VY8T66	1	Crane	8														Bragg Grove RT890E	ABF
768-50-4005	1	Welding Machine	8														Lincoln	ABF
768-50-4009	1	Welding Machine	8														Lincoln	ABF

EA	04-0120F4
Co-Rte-KP (PM)	SF-080-13.2/13.9 (8.2/8.7)
Structure Rep.	Rick Morrow



File Name:	May-28-2009 W2 Cap 001		
Date:	05-28-09	By Int:	M Bruce

Description: Progress to date on the north CBT-23 to 36 blackout formwork. Some rebar for the CBT-25 to 27 blackout appeared to be missing.


File Name:	May-28-2009 W2 Cap 003		
Date:	05-28-09	By Int:	M Bruce

Description: Skewed anchor rods numbers C16 and C27 were seen while surveying the ends of the anchor rods.



File Name:	May-28-2009 W2 Cap 004		
Date:	05-28-09	By Int:	M Bruce

Description: Skewed anchor rods numbers C4 and C11 on the top row and C18 and C25 on the bottom row were seen while surveying the ends of the anchor rods.

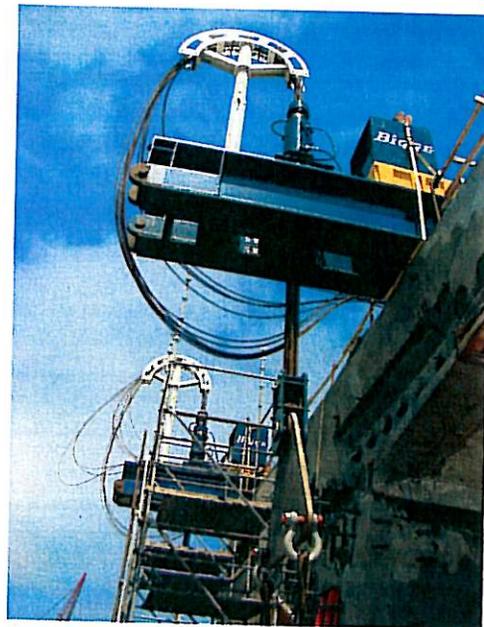

File Name:	May-28-2009 W2 Cap 005		
Date:	05-28-09	By Int:	M Bruce

Description: Northwest strand jack "A" assembly prepared to lift/hold the soffit cap and stringer beams. As mentioned yesterday ABF piledrivers cut the spreader plate at the top due to a clearance issue with the lift anchor supplied by Bigge. This condition exists on the northwest and southwest strand jacks only.