

**DEPARTMENT OF TRANSPORTATION**

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch  
690 Walnut Ave. St. 150  
Vallejo, CA 94592-1133  
(707) 649-5453  
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:** Pursell, Gary**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-011566**Date Inspected:** 22-Jan-2010**Project Name:** SAS Superstructure**OSM Arrival Time:** 645**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1845**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:** Liu Fawen**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** Orthotropic Box Girder (OBG) Components**Summary of Items Observed:**

On this date Caltrans Office of Structural Materials Quality Assurance Inspector, Sandeep Kumar (QA) was present during the times noted above for observations relative to the work being performed.

**BAY 2**

This QA Inspector observed the following work in progress:

**Flux Core Arc Welding (FCAW):**

Repair welding of a weld joint # 014 according to weld repair report #B-WR10250 located on Traveler Rail 10TR2 – 016. Welder is identified as 045240. ZPMC Quality Control (QC) Inspector is identified as Yang Qing Feng. The welding variables recorded by QC appeared to comply with the WPS – 345 – FCAW – 2G (2F) – Repair – 1.

Weld joint # 005 located on Traveler Rail 20TR1 – 016. Welder is identified as 062708. ZPMC Quality Control (QC) Inspector is identified as Yang Qing Feng. The welding variables recorded by QC appeared to comply with the WPS – B – T – 2231 – Tc – U5 – F.

Repair welding of a weld joint # 014 according to weld repair report #B-WR10271 located on Traveler Rail 10TR1 – 023. Welder is identified as 045227. ZPMC Quality Control (QC) Inspector is identified as Yang Qing Feng. The welding variables recorded by QC appeared to comply with the WPS – 345 – FCAW – 2G (2F) –

---

---

## WELDING INSPECTION REPORT

( Continued Page 2 of 3 )

---

---

Repair – 1.

Weld joint # 001 located on Traveler Rail 20TR1 – 013. Welder is identified as 207465. ZPMC Quality Control (QC) Inspector is identified as Yang Qing Feng. The welding variables recorded by QC appeared to comply with the WPS – B – T – 2231 – Tc – U5 – F.

BAY 3

This QA Inspector observed the following work in progress:

Flux Core Arc Welding (FCAW):

Weld joint # 011 located on Traveler Rail 20TR2 – 005. Welder is identified as 214945. ZPMC Quality Control (QC) Inspector is identified as Guo Yuan Ting. The welding variables recorded by QC appeared to comply with the WPS – B – T – 2231 – Tc – U5 – F.

Weld joint # 013 located on Traveler Rail 20TR2 – 015. Welder is identified as 204338. ZPMC Quality Control (QC) Inspector is identified as Guo Yuan Ting. The welding variables recorded by QC appeared to comply with the WPS – B – T – 2231 – Tc – U5 – F.

Weld joint # 013 located on Traveler Rail 20TR2 – 011. Welder is identified as 206623. ZPMC Quality Control (QC) Inspector is identified as Guo Yuan Ting. The welding variables recorded by QC appeared to comply with the WPS – B – T – 2231 – Tc – U5 – F.

BAY 5

This QA Inspector observed the following work in progress:

Flux Core Arc Welding (FCAW):

Repair welding of a weld joint # 014 according to weld repair report #B-WR10046 located on Traveler Rail 10TR3 – 007. Welder is identified as 215185. ZPMC Quality Control (QC) Inspector is identified as Shen Jian Guo. The welding variables recorded by QC appeared to comply with the WPS – 345 – FCAW – 2G (2F) – Repair – 1.

Repair welding of a weld joint # 005 according to weld repair report #B-WR10018 located on Traveler Rail 10TR2 – 018. Welder is identified as 204342. ZPMC Quality Control (QC) Inspector is identified as Shen Jian Guo. The welding variables recorded by QC appeared to comply with the WPS – 345 – FCAW – 2G (2F) – Repair – 1.

Repair welding of a weld joint # 006 according to weld repair report #B-WR10014 located on Traveler Rail 10TR2 – 012. Welder is identified as 215250. ZPMC Quality Control (QC) Inspector is identified as Shen Jian Guo. The welding variables recorded by QC appeared to comply with the WPS – 345 – FCAW – 2G (2F) – Repair – 1.

BAY 7

---

---

# WELDING INSPECTION REPORT

( Continued Page 3 of 3 )

---

---

This QA Inspector observed the following work in progress:

Flux Core Arc Welding (FCAW):


Weld joint # 014 located on Traveler Rail 10TR3 – 004. Welder is identified as 066695. ZPMC Quality Control (QC) Inspector is identified as Cui Junjie. The welding variables recorded by QC appeared to comply with the WPS – B – T – 2232 – Tc – U5 – F.

Weld joint # 006 located on Traveler Rail 10TR2 – 006. Welder is identified as 067036. ZPMC Quality Control (QC) Inspector is identified as Cui Junjie. The welding variables recorded by QC appeared to comply with the WPS – B – T – 2232 – Tc – U5 – F.

Weld joint # 005 located on Traveler Rail 10TR3 – 004. Welder is identified as 066401. ZPMC Quality Control (QC) Inspector is identified as Cui Junjie. The welding variables recorded by QC appeared to comply with the WPS – B – T – 2232 – Tc – U5 – F.

See attached photo:-

Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

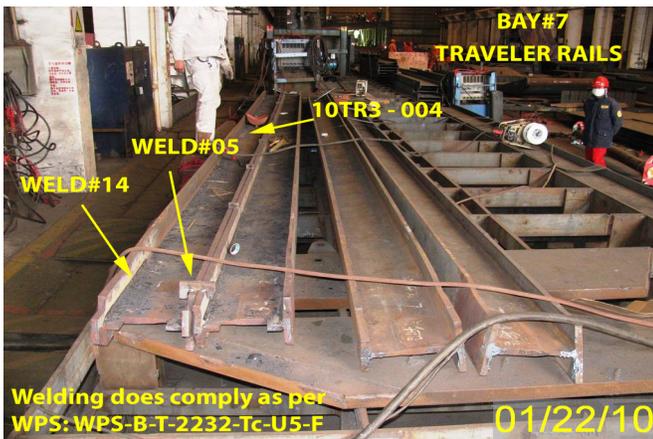

### Summary of Conversations:

No Relevant Conversations.

### Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric Tsang - 15000422372, who represents the Office of Structural Materials for your project.

---

**Inspected By:** Kumar,Sandeep

Quality Assurance Inspector

**Reviewed By:** Hall,Steven

QA Reviewer