

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave. St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:** Pursell, Gary**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-014128**Date Inspected:** 05-May-2010**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1900**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:** Li Lin**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** Tower Components**Summary of Items Observed:**

On this date Caltrans Office of Structural Materials Quality Assurance Inspector, Sandeep Kumar (QA) was present during the times noted above for observations relative to the work being performed.

BAY#11

This QA Inspector observed the following work in progress:

Shielded Metal Arc Welding (SMAW):

Weld joint # 018 located on Tower Strut ND1 – STSA4 – 6 – 135M – 2. Welder is identified as 206189. ZPMC Quality Control (QC) Inspector is identified as Xu Jin long. The welding variables recorded by QC appeared to comply with the WPS – B – T – 2113. (See attached photo)

Weld joint # 01B located on East Tower Lift-5 ESD1 – TL5 – 2B/F. Welder is identified as 040690. ZPMC Quality Control (QC) Inspector is identified as Li Bin. The welding variables recorded by QC appeared to comply with the WPS – B – T – 3213 – B – U3b.

Weld joint # 083 located on Tower Strut ED1 – STSA4 – 6 – 139M – 1. Welder is identified as 046769. ZPMC Quality Control (QC) Inspector is identified as Xu Jin long. The welding variables recorded by QC appeared to comply with the WPS – B – T – 2113. (See attached photo)

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

Tower


MEASUREMENTS OF TOWER STRUTS

This QA Inspector carried out the measurements on Tower Struts to check the length, flange to flange distance, stiffener to stiffener distance and as well as fillet weld termination at the cope hole of stiffeners. Measurements were recorded on the data sheet and submitted to the assigned task leader. The identified component designations reviewed are as follows

TOWER STRUTS

1. ED1 – STSA3 – 2 – 109M – 2
2. ND1 – STSA3 – 1 – 99M – 1
3. ED1 – STSA3 – 2 – 89M – 1
4. ED1 – STSA3 – 2 – 99M – 2
5. ED1 – STSA3 – 2 – 89M – 2
6. ND1 – STSA3 – 1 – 89M – 1
7. ND1 – A6002 – 17
8. ND1 – A6002 – 5
9. ND1 – A6002 – 4
10. ND1 – A6002 – 16

Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

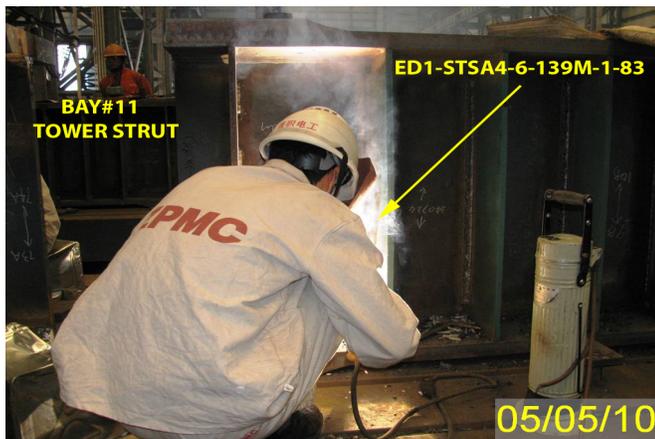

Summary of Conversations:

No Relevant Conversations.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Skyler Guest - 15000422360, who represents the Office of Structural Materials for your project.

Inspected By: Kumar,Sandeep

Quality Assurance Inspector

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

Reviewed By: Clifford, William

QA Reviewer