

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave. St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:** Pursell, Gary**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-015354**Date Inspected:** 04-Jul-2010**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1900**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China

CWI Name:	Mr. Huang min		
Inspected CWI report:	Yes	No	N/A
Electrode to specification:	Yes	No	N/A
Qualified Welders:	Yes	No	N/A
Approved Drawings:	Yes	No	N/A

CWI Present:	Yes	No	
Rod Oven in Use:	Yes	No	N/A
Weld Procedures Followed:	Yes	No	N/A
Verified Joint Fit-up:	Yes	No	N/A
Approved WPS:	Yes	No	N/A
Delayed / Cancelled:	Yes	No	N/A

Bridge No: 34-0006**Component:** Orthotropic Box Girder (OBG)**Summary of Items Observed:**

This CALTRANS OSM Quality Assurance Inspector (QA) Surendra Prabhu was present during the times noted above for observations relative to the fabrication of the Self Anchored Suspension (SAS) Superstructure being performed by Zhenhua Port Machinery Company (ZPMC) at Changxing Island, in Shanghai, China. QA observed and/or found the following:

BAY- 1

This QA Inspector performed dimension check for the below mentioned Traveler Rail, measured length Thickness, deformation, depth and tilt of the TR. Inspection was being performed as per the ZPMC submitted notification No. 06117 dated: 04th July 2010. The measured readings were fed in spread sheet, generated the report and submitted to the Team Leader for further action.

1. 21TR1-002.**BAY- 5**

The following Non Destructive Testing (NDT) Inspection carried out as per the ZPMC submitted Notification No. 06119.

Ultrasonic Testing (UT)

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

This QA performed UT of approximately 10% of the area previously tested and accepted by ZPMC Quality Control (QC) personnel. This QA generated UT report for this date. The members are identified as OBG Traveler Rail weld Components. Total number of welds UT Tested: 25 No's. The weld designations are review as follows:

1. 20TR2-008-009,013,015,017,011.
2. 20TR2-015-009,013,015,017,011.
3. 20TR2-007-009,013,015,017,011.
4. 20TR2-011-009,013,015,017,011.
5. 20TR2-003-009,013,015,017,011.

Signed off the following green tag:

1. 13291.

BAY- 6

This QA Inspector Randomly observed the following work in progress:

Shielded Metal Arc Welding (SMAW) welding of weld joint WJF-0-462. Welder is identified as 215083. ZPMC Quality Control (QC) is identified as Mr. Zhao Jian Hang. The welding variables appeared to comply with the Applicable WPS: WPS-B- T-3112-1.

Submerged Arc Welding (SAW) of weld joint WJF-0-185. Welder is identified as 054458. ZPMC Quality Control (QC) is identified as Mr. Zhao Jian Hang. The welding variables appeared to comply with the Applicable WPS: WPS-B- T-3221-TC-U4a-S-1.

BAY- 7

SMAW Tack welding of weld joint EP3020-001-031/032. Welder is identified as 250833. ZPMC Quality Control (QC) is identified as Mr. Cui jun jie. The welding variables appeared to comply with the Applicable WPS: WPS-B- P-2112. Refer the attached photos for reference.

SMAW Tack welding of weld joint EP3013-001-045/046. Welder is identified as 046813. ZPMC Quality Control (QC) is identified as Mr. Cui jun jie. The welding variables appeared to comply with the Applicable WPS: WPS-B- P-2112. Refer the attached photos for reference.

Flux Cored Arc Welding (FCAW) of weld joint BP3058-001-003/004. Welder is identified as 053609. ZPMC Quality Control (QC) is identified as Mr. Guo Pan. The welding variables appeared to comply with the Applicable WPS: WPS-B- T-2132-3.


FCAW of weld joint BP3058-001-007/008. Welder is identified as 214342. ZPMC Quality Control (QC) is identified as Mr. Guo Pan. The welding variables appeared to comply with the Applicable WPS: WPS-B- T-2132-3.

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

FCAW of weld joint BP3058-001-011/012. Welder is identified as 217185. ZPMC Quality Control (QC) is identified as Mr. Guo Pan. The welding variables appeared to comply with the Applicable WPS: WPS-B-T-2132-3.

Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

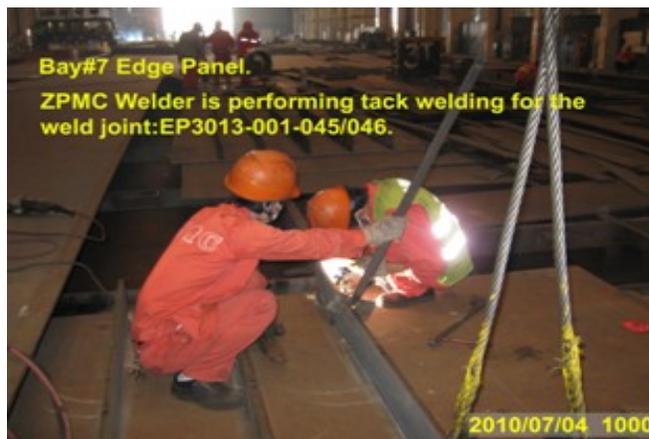

Summary of Conversations:

Only general conversation was held between QA and Quality Control (QC) concerning this project.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric Tsang 15000422372, who represents the Office of Structural Materials for your project.

Inspected By:	Prabhu,Surendra	Quality Assurance Inspector
Reviewed By:	Hall,Steven	QA Reviewer
