

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave. St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 99.28**WELDING INSPECTION REPORT****Resident Engineer:** Siegenthaler, Peter**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-019658**Date Inspected:** 10-Jan-2011**Project Name:** SAS Superstructure**OSM Arrival Time:** 1500**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 300**Contractor:** Zhenhua Port Machinery Company, LTD(ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:** Wang Xu**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** OBG**Summary of Items Observed:**

On this date Caltrans OSM Quality Assurance (QA) Inspector, Robin Sharma was present during the times noted above for observations relative to the work being performed at ZPMC.

This QA Inspector observed the following work in progress:

BAY # 14

Shielded Metal Arc Welding (SMAW) on weld joint SEG3007J-032 located on bottom plate to floor beam in 13East in bay 14. The Welder is identified as 215553. ZPMC Quality Control (QC) is identified as Zhong Guo Hui. The welding variables recorded by QC appeared to comply with WPS-345-SMAW-2G (2F)-FCM-Repair & repair report B-WR17428.

Shielded Metal Arc Welding (SMAW) on weld joint SEG3011E-408 located on V.P. stiffener to V.P. stiffener in 13East in bay 14. The Welder is identified as 067571. ZPMC Quality Control (QC) is identified as Zhong Guo Hui. The welding variables recorded by QC appeared to comply with WPS-B-P-2214-B-U2-FCM-1.

Shielded Metal Arc Welding (SMAW) on weld joint SEG3007Y-422 located on floor beam stiffener to S.A. 13East in bay 14. The Welder is identified as 066416 ZPMC Quality Control (QC) is identified as Zhong Guo Hui. The welding variables recorded by QC appeared to comply with WPS-B-P-2211-TC-U4b-FCM-1.

Shielded Metal Arc Welding (SMAW) on weld joint SEG3019AL-008 located on floor beam to side plate in 14East in bay 14. The Welder is identified as 037723. ZPMC Quality Control (QC) is identified as Zhong Guo Hui. The welding variables recorded by QC appeared to comply with WPS-B-P-2214-TC-U4b-FCM-1.

Shielded Metal Arc Welding (SMAW) on weld joint SEG3007AT-082 located on B.P. to stiffener in 13East in bay

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

14. The Welder is identified as 216086. ZPMC Quality Control (QC) is identified as Zhong Guo Hui. The welding variables recorded by QC appeared to comply with WPS-345-SMAW-2G (2F)-FCM-Repair & repair report B-WR19145.

Flux Cored Arc Welding (FCAW) on weld joint SEG3007C-066 located on floor beam to bottom plate stiffener in 13East in bay 14. The Welder is identified as 069683. ZPMC Quality Control (QC) is identified as Zhong Guo Hui. The welding variables recorded by QC appeared to comply with WPS-B-T-223-ESAB.

Shielded Metal Arc Welding (SMAW) on weld joint SEG3019AL-009 located on floor beam to side plate in 14East in bay 14. The Welder is identified as 069683. ZPMC Quality Control (QC) is identified as Zhong Guo Hui. The welding variables recorded by QC appeared to comply with WPS-B-P-2214-TC-U4b-FCM-1. For details see image below

ZPMC personnel performing UT on weld joint DP3162-001-023 located on PL3438A+PL3438B For details see image below

BAY # 14

The following Non Destructive Testing (NDT) inspection carried out as per the ZPMC submitted Notification No 08121

Magnetic Particle Testing (MT)

This QA inspector performed Magnetic Particle Testing (MT) of approximately 15% of an area that has been previously tested and accepted by ZPMC Quality Control (QC) personnel. This QA Inspector generated an MT report for this date. The member is identified as OBG 13AW. The welds designations reviewed are as follows

SEG3013AW-081, 084, 022


SEG3013RS3486-002

SEG3013AW-080, 023, 085, 093, 092, 019

SEG3013AX-177, 049, 180, 050, 190, 053

SEG3013RS3484-002, 001

SEG3013AT-069, 071

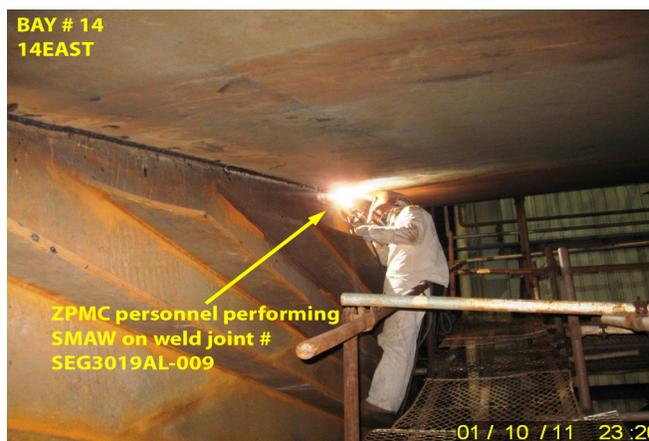

Summary of Conversations:

No relevant conversations.

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Thomas Ho (150002048250) , who represents the Office of Structural Materials for your project.

Inspected By:	Sharma,Robin	Quality Assurance Inspector
----------------------	--------------	-----------------------------

Reviewed By:	Clifford,William	QA Reviewer
---------------------	------------------	-------------