

**DEPARTMENT OF TRANSPORTATION**

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch  
690 Walnut Ave. St. 150  
Vallejo, CA 94592-1133  
(707) 649-5453  
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 99.28**WELDING INSPECTION REPORT****Resident Engineer:** Siegenthaler, Peter**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-021840**Date Inspected:** 14-Mar-2011**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1900**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai**CWI Name:** Tian Lei, Liu Fa Wen**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** OBG**Summary of Items Observed:**

On this date Caltrans OSM Quality Assurance (QA) Inspector R. Hernandez was present during the time noted above and conducted observations relative to the work being performed.

The QA Inspector randomly observed the following work in progress:

Bay Number 1

SMAW welding of complete joint penetration welds located on Traveler Rails component identified as 20TR2-036 as identified on weld repair data sheet B-WR-20368 for repaired complete joint penetration welds identified as weld no.(s): 017. Welder is identified as welder no. 057795. The welding variables recorded by ZPMC QC identified as Tian Lei appeared to comply with applicable WPS(s) WPS-345-SMAW-1G(1F)-Repair.

ZPMC personnel heat straightening Orthotropic Box Girder (OBG) traveler rail member identified as 20TR2-037 for weld(s) 009, 011, 013, 015, & 017. Distortion appeared to be caused by welding. ZPMC Quality Control (QC) inspector identified as Mr. Tian Lei was present to monitor the heat straightening process. The heat straightening appeared to comply with Heat Straightening Report (HSR) no. HSR(B)-461.

Bay Number 3

This inspector did not observe any work being performed in this bay at this time.

---

---

# WELDING INSPECTION REPORT

( Continued Page 2 of 3 )

---

---

Bay Number 8


FCAW welding of complete joint penetration welds located on Saddle Housing component identified as SA7047 weld no.(s) 001 & 002. Welder is identified as welder no. 054459. The welding variables recorded by ZPMC QC identified as Liu Fa Wen appeared to comply with applicable WPS(s) WPS-B-T-2231-ESAB.

SAW welding of complete joint penetration welds located on Saddle Housing component identified as SA7535 weld no.(s) 001 & 002. Welder is identified as welder no. 251393. The welding variables recorded by ZPMC QC identified as Liu Fa Wen appeared to comply with applicable WPS(s) WPS-B-T-2221-B-L2-S-2.

This QA inspector performed MT of approximately 15% of the area previously tested and accepted by ZPMC Quality Control personnel. This QA Inspector generated an MT report for this date. All components were as listed on NWIT notification no. 08541 & 08542. The member(s) is/are identified as OBG Bike Path as component BK4A6-060 with the following identifying weld no.(s):

1. BK004A3-060-002, 003, 007, 010.
2. BK004A5-060-002, 003, 006, & 008.
3. BK004A8-060-003~006, 121~124, 008~011, 125~128, 037~039, 129, 025~028.
4. BK004A6-060-003~006, 150~153, 008~011, 128, 154~157, 037, 039, 161, 035, 159, 027, 125

Unless otherwise noted above all items observed on this day appeared to be in general compliance with the applicable contract documents

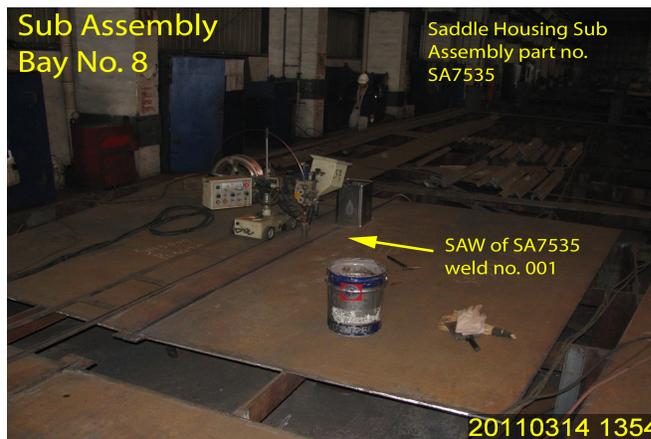

### Summary of Conversations:

Pertinent conversations are included in the body of the report.

### Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric Tsang 1500-0042-02372, who represents the Office of Structural Materials for your project.

---

---

# WELDING INSPECTION REPORT

*( Continued Page 3 of 3 )*

---

---

---

<b>Inspected By:</b>	Hernandez,Rene	Quality Assurance Inspector
----------------------	----------------	-----------------------------

---

<b>Reviewed By:</b>	Hall,Steven	QA Reviewer
---------------------	-------------	-------------

---