

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave. St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:** Siegenthaler, Peter**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-023308**Date Inspected:** 10-Apr-2011**Project Name:** SAS Superstructure**OSM Arrival Time:** 1500**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 300**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China

CWI Name:	Mr. Geng Wei		
Inspected CWI report:	Yes	No	N/A
Electrode to specification:	Yes	No	N/A
Qualified Welders:	Yes	No	N/A
Approved Drawings:	Yes	No	N/A

CWI Present:	Yes	No	
Rod Oven in Use:	Yes	No	N/A
Weld Procedures Followed:	Yes	No	N/A
Verified Joint Fit-up:	Yes	No	N/A
Approved WPS:	Yes	No	N/A
Delayed / Cancelled:	Yes	No	N/A

Bridge No: 34-0006**Component:** OBG Segment Assembly**Summary of Items Observed:**

On this date Caltrans OSM Quality Assurance (QA) Inspector, Ramesh Gade, was present during the times noted above for observations relative to the work being performed.

OBG Segment 14E / Bay 14

This QA Inspector observed the following work in progress:

Shielded Metal Arc Welding (SMAW) in the 4G position of EP to Sp repair weld # SEG3019AE-017, as per B-WR # 20621. The welder is identified as 058087. Quality Control (QC) is identified as Xie Ming Feng. The welding variables recorded by QC appeared to comply with WPS-345-SMAW-4G(4F)-FCM-Repair. See attached photograph Pic_001.

OBG Segment 14E / Bay 14

This QA Inspector observed the following work in progress:

Shielded Metal Arc Welding (SMAW) in the 3G position of weld # SEG3019V-017. The welder is identified as 066422. Quality Control (QC) is identified as Xie Ming Feng. The welding variables recorded by QC appeared to comply with WPS-B-P-2213-TC-U4b-FCM-1.

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

OBG Segment 14E / Bay 14

This QA Inspector observed the following work in progress:

Shielded Metal Arc Welding (SMAW) in the 3G position of weld # SEG3019K-005. The welder is identified as 044779. Quality Control (QC) is identified as Xie Ming Feng. The welding variables recorded by QC appeared to comply with WPS-B-P-2213-B-U2-FCM-1.

OBG Segment 14E / Bay 14

This QA Inspector observed the following work in progress:

Shielded Metal Arc Welding (SMAW) in the 3G position of weld # SEG3019K-006. The welder is identified as 066418. Quality Control (QC) is identified as Xie Ming Feng. The welding variables recorded by QC appeared to comply with WPS-B-P-2213-B-U2-FCM-1.

OBG Segment 14E / Bay 14

This QA Inspector observed the following work in progress:

Shielded Metal Arc Welding (SMAW) in the 3G position of weld # SEG3019K-008. The welder is identified as 043661. Quality Control (QC) is identified as Xie Ming Feng. The welding variables recorded by QC appeared to comply with WPS-B-P-2213-B-U2-FCM-1.

OBG Segment 14E / Bay 14

This QA Inspector observed the following work in progress:

Flux Core Arc Welding (FCAW) in the 2G position of weld # SEG3019D-1-325. The welder is identified as 055491. Quality Control (QC) is identified as Xie Ming Feng. The welding variables recorded by QC appeared to comply with WPS- B-T-2232-ESAB.

OBG Segment 14E / Bay 14

This QA Inspector observed the following work in progress:

Flux Core Arc Welding (FCAW) in the 2G position of weld # SEG3019V-005. The welder is identified as 055564. Quality Control (QC) is identified as Xie Ming Feng. The welding variables recorded by QC appeared to comply with WPS- B-T-2232-ESAB. See attached photograph Pic_002.


OBG Segment 14E / Bay 14

This QA Inspector observed the following work in progress:

Flux Core Arc Welding (FCAW) in the 2G position of weld # SEG3019L-061. The welder is identified as 051356. Quality Control (QC) is identified as Xie Ming Feng. The welding variables recorded by QC appeared to comply with WPS- B-T-2232-ESAB.

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

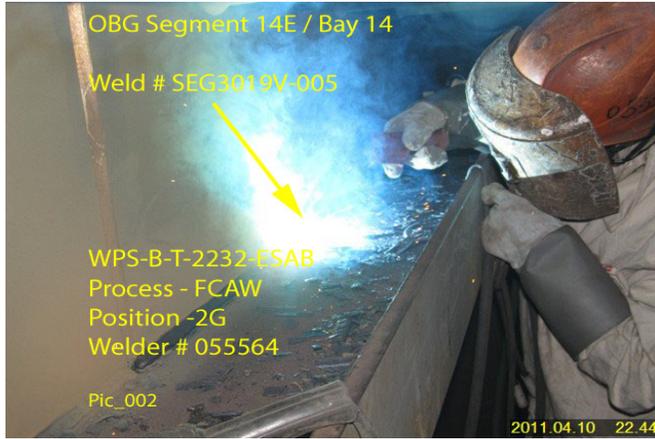

Summary of Conversations:

No relevant conversations reported on this date.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric Tsang (+86)15000 42 2372, who represents the Office of Structural Materials for your project.

Inspected By:	Gade,Ramesh	Quality Assurance Inspector
Reviewed By:	McClendon,Timothy	QA Reviewer
