

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave. St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:** Pursell, Gary**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-003060**Date Inspected:** 02-Jun-2008**Project Name:** SAS Superstructure**OSM Arrival Time:** 1400**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 2330**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China

CWI Name:	N/A	CWI Present:	Yes	No
Inspected CWI report:	Yes No N/A	Rod Oven in Use:	Yes No N/A	
Electrode to specification:	Yes No N/A	Weld Procedures Followed:	Yes No N/A	
Qualified Welders:	Yes No N/A	Verified Joint Fit-up:	Yes No N/A	
Approved Drawings:	Yes No N/A	Approved WPS:	Yes No N/A	
		Delayed / Cancelled:	Yes No N/A	
Bridge No:	34-0006	Component:	OBG	

Summary of Items Observed:


CALTRANS Quality Assurance (QA) Inspector, Erik Prue was present for the fabrication scheduled for this project at the ZPMC facility in Shanghai, China for the San Francisco Oakland Bay Self Anchored Suspension Bridge.

New OBG Bay 1: QA UT Inspector performed Ultrasonic (UT) verification testing after ZPMC Quality Control (QC) acceptable UT inspection of OBG Segment 013A-001 Complete Joint Penetration (CJP) Butt joint joining Side Plates SP009-001-004 and SP017-001-004. The Ultrasonic Testing (UT) was performed to verify that 10% of the weld meets the requirements of the contract documents and AWS D1.5-2002. The weld and base metal were scanned utilizing a Krautkramer Branson USN 60 #01RN5T. QA Inspector performed a base metal lamination check using a 25mm diameter 2.25 MHz transducer and a shear wave scan using a 20mm x 15mm 2.25 MHz transducer on a 70 degree angle wedge from face A. QA UT Inspector found the welds inspected to be in compliance with AWS D1.5-2002 Table 6.3 and the contract documents. For details please see the ultrasonic testing report TL-6027 dated June 02, 2008.

QA Inspector reviewed ABF and ZPMC QC accepted radiographic (RT) film for bottom plate complete joint penetration (CJP) welds. Radiographic film for welds reviewed were; BP140-001-007, BP086-001-007, and BP059-001-007. RT film for bottom plate welds appear to be acceptable to AWS D1.5 (2002) and special provisions. For details please see radiographic film report TL-6029 dated June 02, 2008.

WELDING INSPECTION REPORT

(Continued Page 2 of 2)

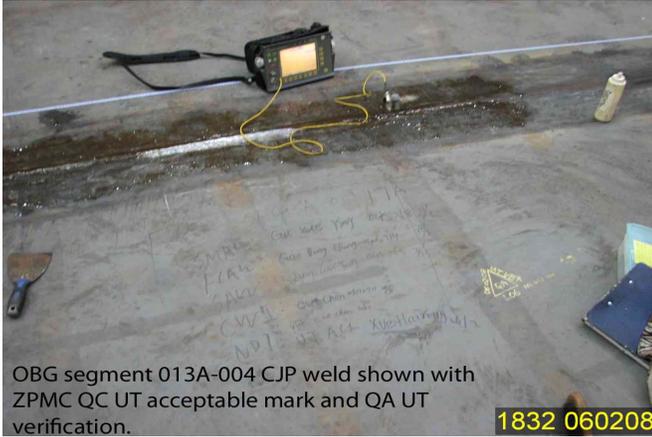

Summary of Conversations:

No significant conversations this day.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Patrick Lowry, 858 344-2712, who represents the Office of Structural Materials for your project.

Inspected By:	Prue,Erik	Quality Assurance Inspector
Reviewed By:	Carreon,Albert	QA Reviewer
