

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave. St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:** Pursell, Gary**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-009643**Date Inspected:** 18-Oct-2009**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1900**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:** Li Ming, Feng Guo.**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** Tower**Summary of Items Observed:**

On this day CALTRANS OSM Quality Assurance (QA) Inspector Umesh Gaikwad was present during the times noted above for observations relative to the fabrication of the SAS Superstructure being performed by Zhenhua Port Machinery Company (ZPMC) at Changxing Island in Shanghai, China. QA observed and/or found the following:

Bay 11 West Tower Lift 3, 85.25M diaphragm to skin A, B, E and fit lugs

This QA inspector performed Magnetic Particle Testing (MT) of approximately 15% and random Visual Testing (VT) of the area previously tested and accepted by ZPMC Quality Control personnel. This QA Inspector generated an MT reports for this date. The members are identified as Tower Components. The weld designations reviewed are as follows.

WSTL3-4B/K-39 (MT Linear Indication observed, Incident Report)

WSTL3-4B/K-28, 29, 38, 56, 57

WSTL3-4B/K-24, 25, 26, 27, 30, 31, 36, 37, 40, 41, 48, 49, 60, 61

This Quality Assurance (QA) Inspector observed the following work in progress:

Bay 10

FCAW welding of weld joint 87 located on ND1-A713C/E.

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

Welder is identified as 057180. ZPMC CWI is identified as Mr. Du Zhi Qun.
The welding variables recorded by QC appeared to comply with WPS-B-T-2132.

FCAW welding of weld joint 4A/B located on NSD1-SPSA3-56.

Welder is identified as 048627. ZPMC CWI is identified as Mr. Gong Liang Zhu.
The welding variables recorded by QC appeared to comply with WPS-345-FCAW-2G(2F)-Repair.

SMAW welding of weld joint 83B located on NSTL3-4B/K.


Welder is identified as 057220. ZPMC CWI is identified as Mr. Wan Wen Zhong.
The welding variables recorded by QC appeared to comply with WPS-345-SMAW-4G(4F)-Repair.

FCAW welding of weld joint 86 located on ND1-A713C/E.

Welder is identified as 037907. ZPMC CWI is identified as Mr. Du Zhi Qun.
The welding variables recorded by QC appeared to comply with WPS-B-T-2132.

During random verification Magnetic Particle Testing (MT) of West tower lift 3, 85.25M diaphragm to skin A, weld WSTL3-4B/K-39 located in the Tower Bay No. 11, Caltrans Quality Assurance (QA) Inspector discovered a linear indication of approximately 10mm in length. This area had been previously tested and accepted by ZPMC NDT personnel. (NDT Inspection Notification sheet # 004423) The attached photographs provide additional detail.

Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

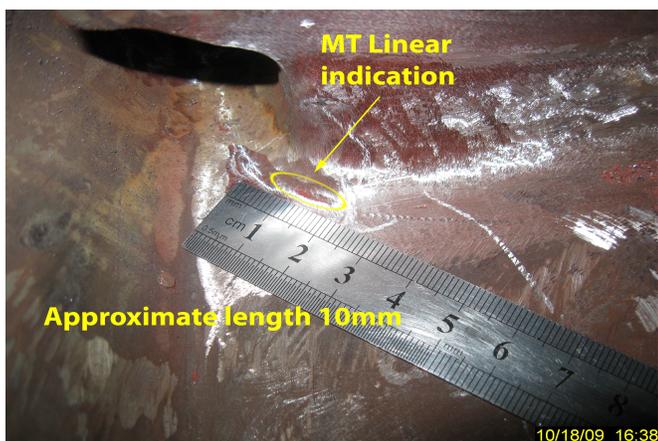

Summary of Conversations:

Only general conversation was held between QA and QC concerning this project.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Serge Sinevod 134-8257-0045, who represents the Office of Structural Materials for your project.

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

Inspected By:	Gaikwad,Umesh	Quality Assurance Inspector
----------------------	---------------	-----------------------------

Reviewed By:	Clifford,William	QA Reviewer
---------------------	------------------	-------------
