

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
 690 Walnut Ave. St. 150
 Vallejo, CA 94592-1133
 (707) 649-5453
 (707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:** Pursell, Gary**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-012390**Date Inspected:** 06-Feb-2010**Project Name:** SAS Superstructure**OSM Arrival Time:** 645**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1845**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China

CWI Name:	NA	CWI Present:	Yes	No
Inspected CWI report:	Yes No N/A	Rod Oven in Use:	Yes No N/A	
Electrode to specification:	Yes No N/A	Weld Procedures Followed:	Yes No N/A	
Qualified Welders:	Yes No N/A	Verified Joint Fit-up:	Yes No N/A	
Approved Drawings:	Yes No N/A	Approved WPS:	Yes No N/A	
		Delayed / Cancelled:	Yes No N/A	
Bridge No:	34-0006	Component:	OBG	

Summary of Items Observed:

On this date Caltrans OSM Quality Assurance (QA) Inspector Larry Viars was present during the times noted above for observations relative to the work being performed.


West of Bay 19-

This QA Inspector performed random visual inspection of OBG segment 9BW internal weld surfaces. ZPMC and ABF QA have not visually accepted the above mentioned welds and repairs are still in process. Areas requiring light grinding were marked for ZPMC personnel. The location of areas requiring weld repair were marked on or adjacent the weld. Caltrans QA observed areas to include but not limited to overlap, arc strikes weld spatter and incomplete fusion areas. Please see attached photos below.

Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

WELDING INSPECTION REPORT

(Continued Page 2 of 2)

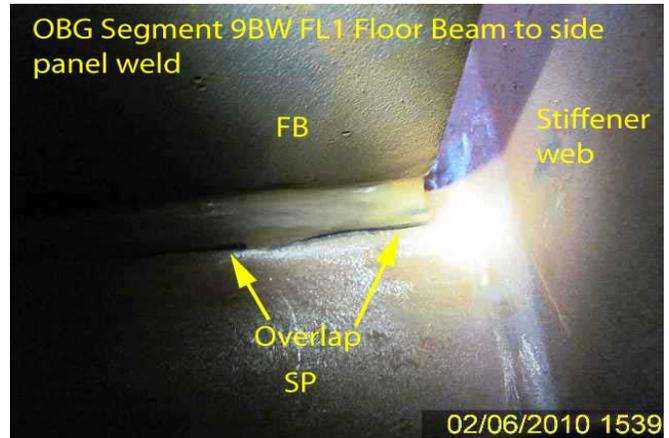

Summary of Conversations:

No relevant conversation occurred between QA and QC this date.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric Tsang, 150 0042 2372, who represents the Office of Structural Materials for your project.

Inspected By:	Viars,Larry	Quality Assurance Inspector
Reviewed By:	McClendon,Timothy	QA Reviewer
