

**DEPARTMENT OF TRANSPORTATION**

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch  
690 Walnut Ave. St. 150  
Vallejo, CA 94592-1133  
(707) 649-5453  
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: xx.28**WELDING INSPECTION REPORT****Resident Engineer:** Siegenthaler, Peter**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-020003**Date Inspected:** 04-Dec-2010**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1900**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** SHANGHAI CHINA**CWI Name:** Mr. An Qing Xing.**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** OBG TRIAL ASSEMBLY**Summary of Items Observed:**

On this day CALTRANS OSM Quality Assurance (QA) Inspector Raghavendra Reddy was present during the times noted above for observations relative to the fabrication of the SAS Superstructure being performed by Zhenhua Port Machinery Company (ZPMC) at Changxing Island in Shanghai, China. QA observed and/or found the following:

This QA Inspector observed the following work in progress:

Lift 11W

Shielded Metal Arc (SMAW) welding of Weld Joint CA091-006&CA3006-002 (11EW+12AW, DP-EP, CW Side), And Welder is identified as 040611; ZPMC Quality Control (QC) is identified as Mr. Zhu Peng. The welding variables appeared to comply with the Applicable WPS-B-P-2214-TC-U4b-FCM-1.

Flux Cored Arc (FCAW) welding of Weld Joint SP686-001-021~030&SP3034-001-083~092 (11EW+12AW, I Rib Hold back, CB Side), And Welder is identified as 053486; ZPMC Quality Control (QC) is identified as Mr. Shi Lei. The welding variables appeared to comply with the Applicable WPS-B-T-2132-ESAB.

LIFT 11E:

The following Non Destructive Testing (NDT) Inspection carried out as per the ZPMC submitted Notification No. 07619.

# WELDING INSPECTION REPORT

( Continued Page 2 of 3 )

## Magnetic Particle Testing (MT)

This QA Inspector performed MT of approximately 15% of the area previously tested and accepted by ZPMC Quality Control personnel. This QA Inspector generated a MT report for this date. The member is identified as OBG 11DE+11EE Transverse splice joint & Temporary attachments Removal area welds. The weld designations reviewed are as follows.


1. OBE11C-006~010(Transverse splice joint weld)
2. OBE11C-006~009(Temporary attachment Removal area)
3. OBE11C-010(Temporary attachment Removal area) found rejected and Incident Report generated for this weld joint,

Incident Report:-

This QA Inspector generated Incident Report on this date.

For further information, please see the attached pictures below.

Unless otherwise noted, all work observed on this date appeared to be in general compliance with the applicable contract documents.

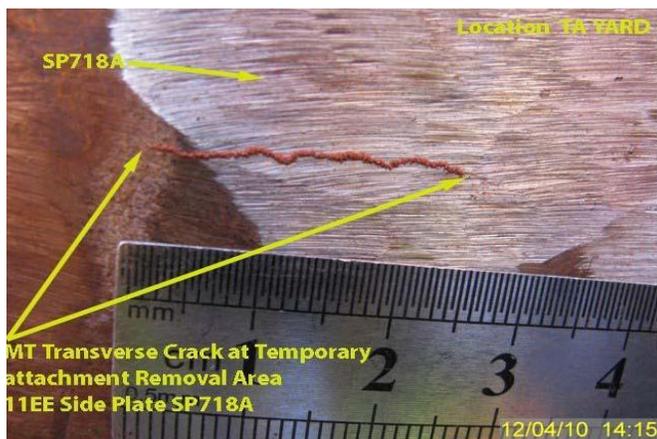

---

---

# WELDING INSPECTION REPORT

( Continued Page 3 of 3 )

---

---

**Summary of Conversations:**

Only general conversation was held between QA and QC concerning this project.

**Comments**

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric Tsang (15000422372), who represents the Office of Structural Materials for your project.

---

<b>Inspected By:</b>	Tharikoppada,Reddy	Quality Assurance Inspector
<b>Reviewed By:</b>	Miller,Mark	QA Reviewer

---