

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave. St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:** Siegenthaler, Peter**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-020465**Date Inspected:** 09-Feb-2011**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1900**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:** Qiu Wen**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** Orthotropic Box Girder (OBG)**Summary of Items Observed:**

On this day CALTRANS OSM Quality Assurance (QA) Inspector Manoj Prabhune was present during the times noted above for observations relative to the fabrication of the SAS Superstructure being performed by Zhenhua Port Machinery Company (ZPMC) at Changxing Island in Shanghai, China. QA observed and/or found the following:

This QA Inspector randomly observed the following work in progress:

Bay 14

WELDING:

Segment 14W

This QA Inspector observed ZPMC qualified welding personnel identified as 066038 perform Shielded Metal Arc Welding (SMAW), weld joint identified as SEG3020E-044; located On Orthotropic Box Girder (OBG) Floor Beam to Longitudinal Diaphragm CJP Weld; ABF Quality Assurance (QA) is identified as Mr. Yan Bao Jia. The Critical Welding Repair Report (CWRR) was B-CWR2735 Rev- 0. This QA Inspector observed a welding current of approximately 162 amps and 23.2 volts and the base material appears to have been being preheated by an electrical heating elements prior to welding. ABF Quality Assurance (QA) Mr. Yan Bao Jia was onsite monitoring the welding variables. The welding variables recorded by QA appeared to comply with applicable WPS-345-SMAW-3G (3F) FCM-Repair-1. See attached photo for further details.

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

This QA Inspector observed ZPMC qualified welding personnel identified as 069683 perform Shielded Metal Arc Welding (SMAW), weld joint identified as SEG3020D-068; located On Orthotropic Box Girder (OBG) Floor Beam to Longitudinal Diaphragm CJP Weld; ABF Quality Assurance (QA) is identified as Mr. Yan Bao Jia. This QA Inspector observed a welding current of approximately 158 amps and 23.4 volts and the base material appears to have been being preheated by an electrical heating elements prior to welding. ABF Quality Assurance (QA) Mr. Yan Bao Jia was onsite monitoring the welding variables. The welding variables recorded by QA appeared to comply with applicable WPS-B-P-2214-TC-U4b-FCM-1. See attached photo for further details.

This QA Inspector observed ZPMC qualified welding personnel identified as 067949 perform Flux Cored Arc Welding (FCAW), weld joint identified as SEG3020AB-054; located On Orthotropic Box Girder (OBG) FB3340 to LD3050A CJP Weld; ABF Quality Assurance (QA) is identified as Mr. Yan Bao Jia. This QA Inspector observed a welding current of approximately 287 amps and 25.5 volts and the base material appears to have been being preheated by an electrical heating elements prior to welding. ABF Quality Assurance (QA) Mr. Yan Bao was onsite monitoring the welding variables. The welding variables recorded by QA appeared to comply with applicable WPS-B-T-2232-ESAB.

Segment 13BW

This QA Inspector observed ZPMC qualified welding personnel identified as 066695 perform Flux Cored Arc Welding (FCAW), weld joint identified as SEG3014F-005; located On Orthotropic Box Girder (OBG) Deck Panel Diaphragm to Upper Floor Beam Flange CJP Weld; ABF Quality Assurance (QA) is identified as Mr. Yan Bao Jia. This QA Inspector observed a welding current of approximately 287 amps and 25.5 volts and the base material appears to have been being preheated by an electrical heating elements prior to welding. ABF Quality Assurance (QA) Mr. Cao Hai Zhou was onsite monitoring the welding variables. The welding variables recorded by QA appeared to comply with applicable WPS-B-T-2232-ESAB.

This QA Inspector observed ZPMC qualified welding personnel identified as 045227 perform Flux Cored Arc Welding (FCAW), weld joint identified as SEG3014F-235; located On Orthotropic Box Girder (OBG) Deck Panel Diaphragm to Upper Floor Beam Flange CJP Weld; ABF Quality Assurance (QA) is identified as Mr. Cao Hai Zhou. This QA Inspector observed a welding current of approximately 282 amps and 26.5 volts and the base material appears to have been being preheated by an electrical heating elements prior to welding. ABF Quality Assurance (QA) Mr. Cao Hai Zhou was onsite monitoring the welding variables. The welding variables recorded by QA appeared to comply with applicable WPS-B-T-2232-ESAB.

Segment 13CE

This QA Inspector performed Magnetic Particle Testing (MPT) Verification Inspection of approximately 15% of the area previously tested and accepted by ZPMC Quality Control personnel. This QA Inspector generated an MT report on this date. The members are identified as Orthotropic Box Girder (OBG) components. The weld designations Verified are as follows.

SEG3007AT-017,018,016,200,201


WELDING INSPECTION REPORT

(Continued Page 3 of 3)

SEG3007X-537,538,539,540,541,559

Nondestructive testing (NDT) notification No.08320

Unless otherwise noted, all work observed on this date appeared to generally comply with the applicable contract documents.

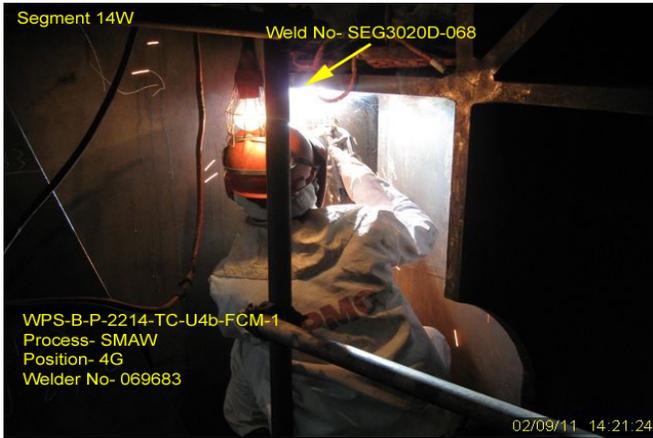

Summary of Conversations:

No significant conversations were reported on this date.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric Tsang phone: 15000422372, who represents the Office of Structural Materials for your project.

Inspected By:	Prabhune,Manoj	Quality Assurance Inspector
Reviewed By:	Peterson,Art	QA Reviewer
