

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave. St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 1.28**WELDING INSPECTION REPORT****Resident Engineer:** Casey, William**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-027771**Date Inspected:** 16-Jun-2012**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1530**Contractor:** American Bridge/Fluor Enterprises, a JV**Location:** Job Site**CWI Name:** William Sherwood**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** SAS Tower**Summary of Items Observed:**

Caltrans Office of Structural Material (OSM) Quality Assurance Inspector (QAI) Joselito Lizardo was present at the Self Anchored Suspension (SAS) job site as requested to perform observations on the welding of components for the San Francisco Oakland Bay Bridge (SFOBB) Project.

At OBG 13W-W2.8 @ 12570 approximately between Y=5000mm to Y=6000mm top deck drop-in plate inside, QA randomly observed ABF certified welder Jeremy Dolman continuing to perform 4G (overhead position) Shielded Metal Arc Welding (SMAW) back welding cover pass on the CJP SPCM splice butt joint. The welder was utilizing 3.2mm diameter E7018H4R electrode implementing Caltrans approved Welding Procedure Specification (WPS) ABF-WPS-D15-1040C-CU. The joint being welded had a single V-groove butt joint with copper plate backing bar that was originally welded from the top using a combination of SMAW and Submerged Arc Welding (SAW) then removed the copper backing plate using carbon air arc gouging and ground smooth. The plates were preheated to more than 150 degree Fahrenheit using Miller Proheat 35 Induction Heating System prior welding. Welding parameters were monitored by ABF/QC William Sherwood. QA noted the working welding parameters of 126 amperes on the 3.2mm diameter E7018H4R electrode. The workmanship and appearance of the completed cover pass deemed satisfactory. During the shift, cover pass back welding on area mentioned above was partially completed and the welder has slowly moved to farther Y location of the same joint wherein he continued the overhead SMAW back welding until the end of the shift.


At OBG 13W/14W top deck splice butt joint inside approximately between Y=2500mm to Y=4000mm, QA randomly observed ABF certified welder Rory Hogan perform 4G (overhead position) Shielded Metal Arc Welding (SMAW) back welding cover pass on the CJP SPCM splice butt joint. The welder was utilizing 3.2mm

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

diameter E7018H4R electrode implementing Caltrans approved Welding Procedure Specification (WPS) ABF-WPS-D15-1040C-CU. The joint being welded had a single V-groove butt joint with copper plate backing bar that was originally welded from the top using a combination of SMAW and Submerged Arc Welding (SAW) then removed the copper backing plate using carbon air arc gouging and ground smooth. The plates were preheated to more than 150 degree Fahrenheit using Miller Proheat 35 Induction Heating System prior welding. Welding parameters were monitored by ABF/QC William Sherwood. QA noted the working welding parameters of 128 amperes on the 3.2mm diameter E7018H4R electrode. The workmanship and appearance of the completed cover pass deemed satisfactory. During the shift, cover pass back welding on area mentioned above was partially completed.

All other related welding activities at the OBG include flush grinding of SMAW back welded splice butt joint at weld location 13W-W2.1 @10100 and 13W-PP121.2 wherein the latter was still in progress at the end of the shift.

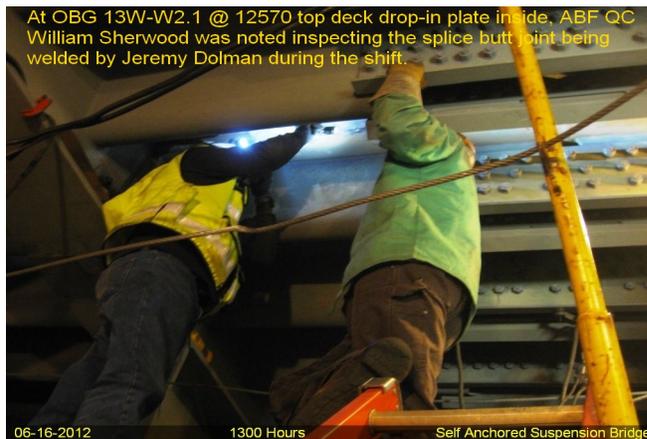

Summary of Conversations:

No significant conversation occurred today.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact SMR Nina Choy 510-385-5910, who represents the Office of Structural Materials for your project.

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

Inspected By:	Lizardo, Joselito	Quality Assurance Inspector
----------------------	-------------------	-----------------------------

Reviewed By:	Levell, Bill	QA Reviewer
---------------------	--------------	-------------