

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave. St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 1.28**WELDING INSPECTION REPORT****Resident Engineer:** Casey, William**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-028368**Date Inspected:** 09-Sep-2012**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1930**Contractor:** American Bridge/Fluor Enterprises, a JV**Location:** Job Site**CWI Name:** See below.**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** OBG**Summary of Items Observed:**

Quality Assurance Inspector (QA) Fritz Belford was at the American Bridge/Fluor (ABF) job site at Yerba Buena Island in California between the times noted above in order to monitor Quality Control functions and the in process work being performed by ABF personnel. The following items were observed:

OBG 12W

This QA observed the following welders working in OBG 12W at various locations:

Authorized welder Chris Bruce #8901:

Welder Chris Bruce was observed welding on welds 12W PP114 W2.1-BW2 (3G, CJP) and 12W PP114 W2.1-BW1 (3G, CJP). The welder was observed utilizing Caltrans approved Welding Procedure Specification's (WPS) ABF-WPS-D15-1030; preheating to the specified temperature of over 150 degrees prior to welding. Other welding parameters observed were as per Welding Procedure Specification's (WPS) noted above and appears to be in order.

This QA randomly observed QC Inspectors Barry Drake checking WPS compliance of welders throughout the day and performing Visual Testing (VT) on items as they become available. This QA also observed QC Inspectors Chris Concha and Patrick Swain performing Ultrasonic Testing Shear Wave (UTSW) on weld 12W PP111.1-C1 internally checking completed weld repairs for rejectable indications. QC Inspector Salvador Merino was observed checking bolt tightness on the longitudinal stiffeners at 12W PP111.1-B1.

Magnetic Particle Testing

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

This QA performed Magnetic Particle Testing (MT) on the following welds:

12W PP111.1-C1:

- 100% Final MT (A & B Sides, MT Accept.)

12W PP111-LS1:

- 100% Final MT. (210, MT Accept.)

12W PP111-LS3:

- 100% Final MT. (230, MT Accept.)

Ultrasonic Testing Shear Wave

This QA performed Ultrasonic Testing Shear Wave (UTSW) on the following weld:

12W PP111.1-C1:

- 10% Final UT (A & B Sides, UT Accept.)

12W PP111-LS1:


- 100% Final UT. (210 each side, UT Accept.)

12W PP111-LS3:

- 100% Final UT. (230 each side, UT Reject.)


This QA observed one (1) rejectable indications at the time of testing. This QA Inspector generated an MT and UT report on this date. The completed and accepted work observed at this location appeared to be in compliance with the contract specifications.

Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

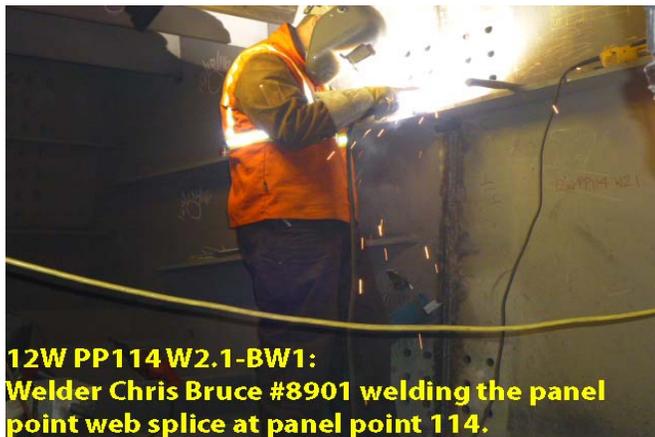

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

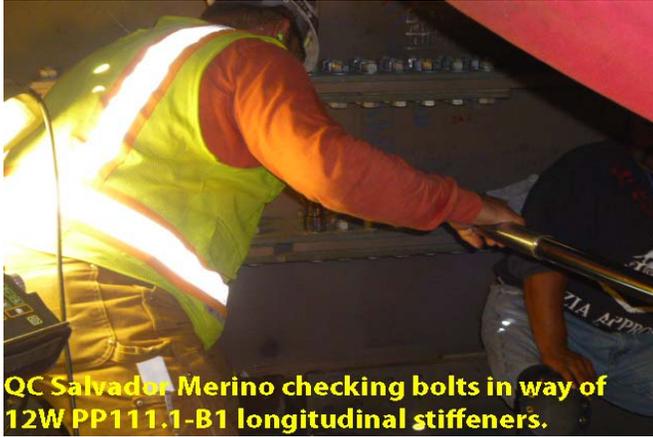

Summary of Conversations:

Conversations relevant to work performed on this date.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Gary Thomas - (916) 764 - 6027, who represents the Office of Structural Materials for your project.

Inspected By:	Belford,Fritz	Quality Assurance Inspector
Reviewed By:	Levell,Bill	QA Reviewer
