

**DEPARTMENT OF TRANSPORTATION**

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch  
690 Walnut Ave. St. 150  
Vallejo, CA 94592-1133  
(707) 649-5453  
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 1.28**WELDING INSPECTION REPORT****Resident Engineer:** Casey, William**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-028852**Date Inspected:** 11-Dec-2012**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1730**Contractor:** American Bridge/Fluor Enterprises, a JV**Location:** Job Site**CWI Name:** Jesse Cayabyab**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** SAS Tower**Summary of Items Observed:**

Caltrans Office of Structural Material (OSM) Quality Assurance Inspector (QAI) Joselito Lizardo was present at the Self Anchored Suspension (SAS) job site as requested to perform observations on the welding of components for the San Francisco Oakland Bay Bridge (SFOBB) Project.

At Tower Base Electro Slag Weld (ESW) 'V' weld joint #W-043 face B, ABF personnel was observed continuing to perform exploratory excavation on welded ESW at various Y locations; Y=1030mm, Y=1055mm, Y=1090mm, Y=1100mm and Y=1130mm due to UT detected defects. The ABF personnel have resumed the exploratory excavation from 60mm deep where they left off Monday. The personnel were noted using only the disc grinder in every 1mm increments of excavation. ABF QC Jesse Cayabyab was observed performing Magnetic Particle Testing (MT) on the following various depths with various indications noted mentioned below. This QA also performed the same test and noted same result. During the shift, the ABF personnel continued the excavation in 1mm increments using the same method of test and verification up to 63mm with indications as noted below. The shift was completed up to this depth of excavation.



The starting depth of excavation on this date was a continuation from the previous excavation. The results of the exploratory excavations are as follows;

1. 61mm in depth -5mm linear indication noted @y=1110mm, X=0.
2. 62mm in depth -2mm transverse indication noted @y=1110mm, X=0.
3. 63mm in depth -no significant indication noted. All previously noted indications have been removed.

# WELDING INSPECTION REPORT

( Continued Page 2 of 2 )

The exploratory excavations at this location have stopped with final excavation profile of 385mm long x 75mm wide x 75mm deep. ABF QC and other personnel were told that the next exploratory excavation will be at ESW 'T'.

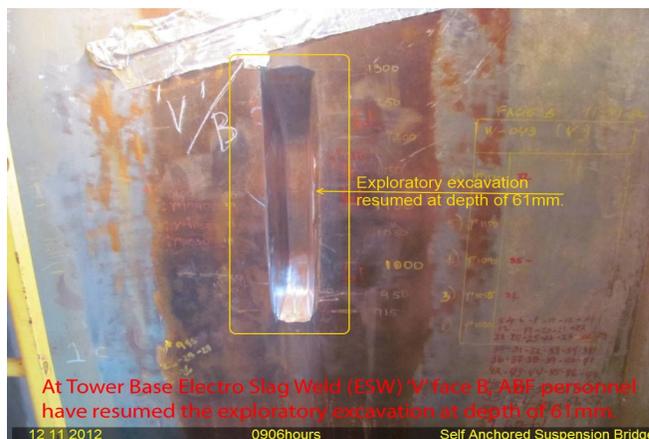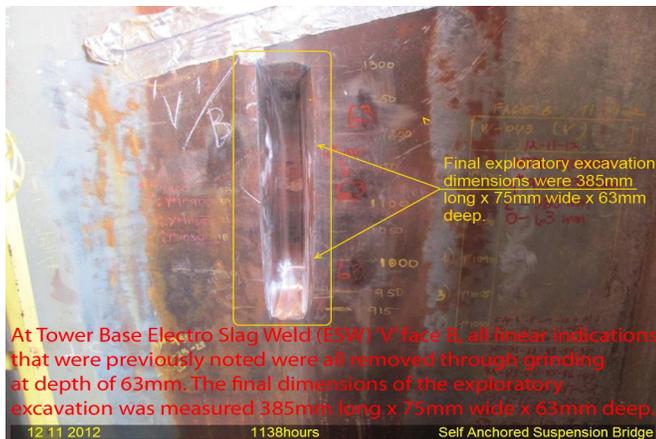

## Summary of Conversations:

No significant conversation today.

## Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact SMR Gary Thomas (916) 764-6027, who represents the Office of Structural Materials for your project.

**Inspected By:** Lizardo, Joselito

Quality Assurance Inspector

**Reviewed By:** Reyes, Danny

QA Reviewer