

DEPARTMENT OF TRANSPORTATION -Toll Bridge Program

333 Burma Rd.
Oakland, CA 94607
(510) 622-5660, (510) 286-0550 fax



*Flex your power
Be energy efficient!*

June 16, 2010

Contract No. 04-0120F4
04-SF-80-13.2 / 13.9
Self-Anchored Suspension Bridge
Letter No. 05.03.01-007577

Michael Flowers
Project Executive
American Bridge/Fluor, A JV
375 Burma Road
Oakland, CA 94607

Dear Michael Flowers,

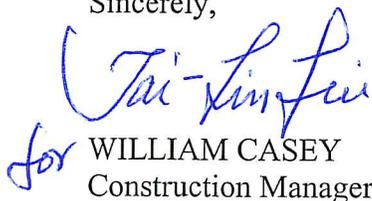
Crossbeam Access Doors

The Department has determined that the crossbeam access hatches as currently detailed will limit the swing to 76° rather than 90°. To correct this problem, ABF is directed to rotate the doors 180° and to mount the hinge mechanisms on the opposite side of the hatch opening. This change affects access openings at crossbeams 4, 7, 12 & 17. Crossbeam 4 was shipped without the doors installed and is on the delivery punchlist as outstanding work. Crossbeams 7, 12 & 17 are in various stages of fabrication at the ZPMC facility. Please notify the Department if the door at crossbeam 7 has already been installed and thus requires rework.

As this change only involves the rotation of the door 180° and does not increase material or labor, there should be no cost increase.

If you have further questions, please contact Gary Lai at the Working Drawing Campus.

Sincerely,


for WILLIAM CASEY
Construction Manager (OBG)

For: GARY PURSELL
Resident Engineer

file: 05.03.01