

Job Stamp 04-0120F4 SFOBB SAS
-------------------------------------

Report No.	_____			
Date	12/21/2007			
Inspectors	Start	0730	Stop	1215
Hours				
Shift Hours	Start	0630	Stop	1215

**ASSISTANT RESIDENT ENGINEER'S CONTRACTOR – ABFJV**

**Weather:** Sunny, cold, Hi 54 F Lo 48 F


**Description of Operation:**

- See Lalit Mathur's diary for ABF labor, equipment, materials and comments.
- **Daily Activity of Regional Steel:**
  - Regional Steel crews start placing P.T. ducts, which are located within Layer B3 (see Fig. 1).

Figure 1



- Place B3 transverse bars, and hoops, which are ultimate butt splices (see Figs 2,3 and 4).
  - Figure 2
  - Figure 3
  - Figure 4

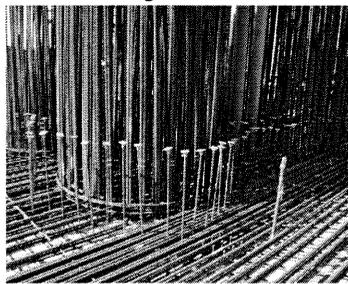

- Regional Steel crews left 12:15.

➤ **Note:**

- Found roughly 20 couplers which have been loosed after the torque (see the video which file name is MOV00409.MPG under X:\SAS\Users\Song\Construction Photos\W2 Cap Beam\2007 12 21 directory). Regional steel crews, mainly Jason and John, tighten them together again.
- Inform Daniel Gomez that the splices in adjacent hoops need to be staggered (see Fig. 4).
- See Pamela Gagnier's diary for punch list
- See Matt Bruce's diary for detailed activities and comments related to post-tensioning, e.g. placing ducts.

**Inspector:**

SeongHyeok Song  Trans Engineer (C)/Asst. Struct. Rep