

Job Stamp 04-0120F4 SFOBB SAS

Const. Calendar:	418			
Project Work Day No.:	628			
Date	02/04/2008			
Inspectors	Start	12:00	Stop	15:20
Hours				
Shift Hours		07:00		17:00

ASSISTANT RESIDENT ENGINEER'S **CONTRACTOR – ABFJV, Sub RPS**

Weather: Sunny with mild temperature - Hi 55 F Lo 37 F (per weather.com forecast)

Description of Operations @ W2 Cap Beam:

ABF

- Clean-up of forms (picking-up tie wire, vacuuming) in the south 1/3 section in preparation for the concrete placement scheduled for Tuesday February 5th.
- Construction of the stay-form blockout for the vertical bars continues in the northwest corner of the W2 cap beam. Also construction of stay forms continued on the north 1/3 section.
- Mobilized concrete placement equipment, installed temperature sensors, and 2"x4" screed guides.
- Continued to install Hinge K embedded plates used to support Macalloy bars, see picture below as there may be a conflict with the transverse tendon.
- VT 1, 7, 14, & 16 blockouts/bearing plates near W2E were still marginally plumb after an attempt to adjust the bearing plates. Spirals for VT 1-16 were fixed by ABF as RPS left the jobsite after lunch. It was difficult to adjust a few of the bearing plates and spirals due to the #43 transverse bars and deviation saddle erection bolts. Silicone caulking was placed around the trumpets/bearing plate again.

RPS

- Placed 5-43L5T02 bars near east bulkhead, see picture below and sheet 481R1.
- Placed #25 formsavers at lower west bikepath blockout, see picture below and sheet 830R1.


Office Work:

- Wrote today's diary.
- Attended weekly staff meeting (Temp. Towers and Caps) meeting at 8:00am.
- Prepared for south 1/3 section concrete placement tomorrow.

Inspector:

Matt Bruce Matt Bruce Transportation Engineer (D)

EA	04-0120F4
Co-Rte-KP (PM)	SF-080-13.2/13.9 (8.2/8.7)
Structure Rep.	Rick Morrow

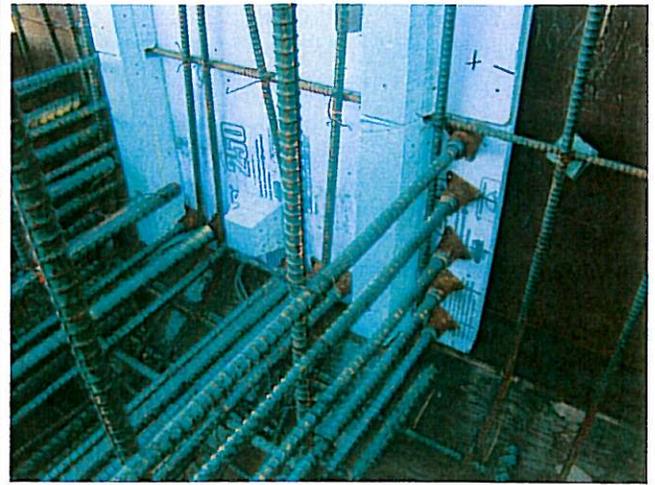

File Name:	DSC00796		
Date:	02-04-08	By Int:	M Bruce
Description: Placement of 5-43L5T02 near the east bulkhead.			

File Name:	DSC00804		
Date:	02-04-08	By Int:	S Song
Description: Placement of #25 formsavers at lower west bikepath blockout.			



File Name:	DSC00811		
Date:	02-04-08	By Int:	S Song
Description: Hinge K embedded plates near W2E.			

File Name:	DSC00814		
Date:	02-04-08	By Int:	S Song
Description: Adjusted spirals near W2E.			