

Job Stamp 04-0120F4 SFOBB SAS

Construction Calendar	401			
Project working days no.	611			
Date	01/18/2008			
Inspectors	Start	7:00	Stop	11:00
Hours				
Shift Hours	Start	6:30	Stop	15:00

Description of Operation:

- See Lalit Mathur's diary for ABF labor, equipment, materials, weather, and comments.
- Daily activity of Regional Steel (R.S.) and ABF
 - R.S. continued to place the vertical bars at north and south solid areas.

Fig. 1 (north)


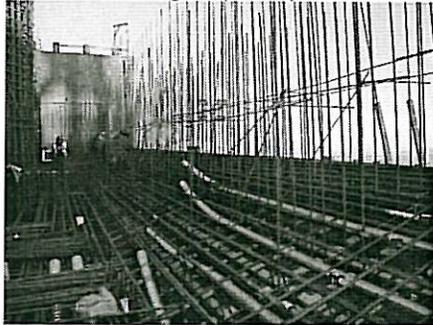



Fig. 2 (south)

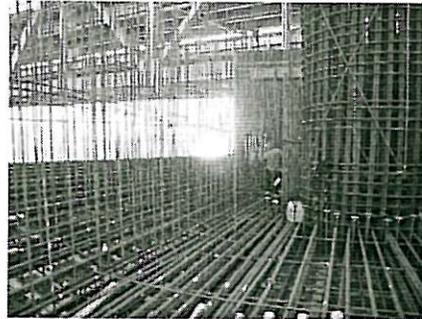

➤ Note

- Informed Lance that WNE column needs to have 5 additional inner hoops.
- Observed that the clearance of the T-headed vertical bar from soffit is much lower than the plan indicated, i.e. plan=2~2.5 inch and actual=1~ 1.5 inch, and ask Lance and R.S. crews to correct the elevation.

Fig. 3 (before the correction)

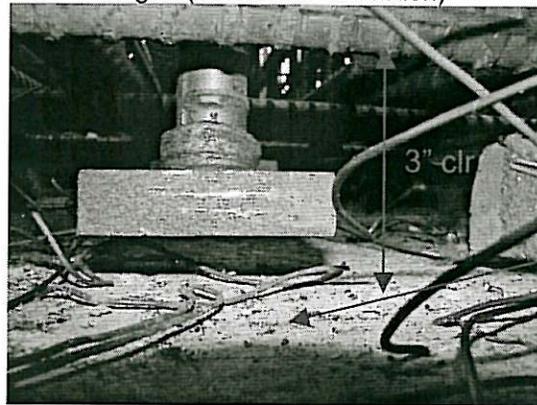

#25 long. bar

3" clr


Soffit

- Had a conversation with T.Y. Lin engineers Alex and Derrik regarding the vertical bars between the cable tie down and the column cages and was informed that they need to be placed between them.
- See Matt Bruce's diary for detailed activities and comments related to post-tensioning and other issues.
- See Pamela Gagnier's diary for detailed conversation with the contractors and decision made.

➤ Punch list

- The spacing of the hoops at ESW column.

Inspector:

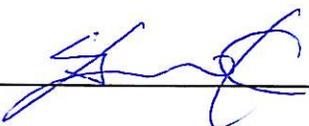SeongHyeok Song  Trans Engineer (C)/Asst. Struct. Rep

REC'D *08 FEB-23 #003584