

Job Stamp
04-0120F4
SFOBB SAS

Report No. 506
Project Work Day No. 716
Date 02-MAY-2008
Shift Hours Start 06:30 Stop 16:00

ASSISTANT RESIDENT ENGINEER'S CONTRACTOR - ABFJV

Weather: Foggy, 59°-65°

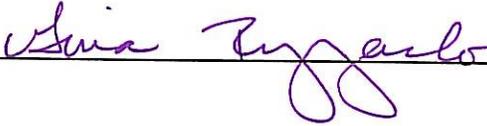
EQUIPMENT AND/OR LABOR:			HOURS - ITEM NO.										REMARKS	
Equip. #	NO. MEN	DESCRIPTION (Of Equipment or Labor)	Item #8 - TOTAL HOURS											
D12-261	1	Manitowoc Crane	7.5											
L-270	-	D185Q Sullivan Air Compressor	IDLE											
96 2-196	-	Power Generator	7.5											
7-154 7-154	-	CAT-IT28B Loader	7.5											
246-01-6015	1	John Deer 270 Excavator	7.5											
		9940 lbs Vertical Drill	IDLE											
DR-13	4	Man Basket Drill Platform	2											
8M70628	2	Dodge 3500 Pick Up Truck	8										Drill Tech	
4G63505	1	Ford F550 Pick Up Truck	8										Drill Tech	
Traylor Dutra	1	Bill White (OE)	7.5											
Traylor Dutra	1	Ken White (OE)	7.5											
Traylor Dutra	1	Randall Lesley (PLDR)	7											
Traylor Dutra	1	Dan Adams (PLDR)	7											
Drill Tech	1	Brad Middleton (FOR)	8											
Drill Tech	1	Luis Martinez (OE)	8											
Drill Tech	1	Nicolas Leon (OE)	8											
Drill Tech	1	Ulises Aguilar (OE)	8											
Drill Tech	1	Gerardo Trujillo (OE)	8											
Drill Tech	1	Sixtos Agurre (OE)	8											

Description of Operation:

- Field Visit, Arrived at Foundations A and B at 6:30am
 - Foundation B1:
 - Drill Tech cleaned up spoils then drilled at the 5 rock bolt locations. Installed rock bolts and centralizers, grouted. Finally, they installed the wire mesh and applied shotcrete to the entire surface.
 - ABF will survey micropile locations on Monday and Drill Tech plan to drill the two battered piles.

- o Foundation A1&B2:
 - Randall pointed out conflict that will arise when installing the anchor bolts. The #25 top bars interfere with the 2" anchor bolt sleeve. Traylor and Regional Steel plan to try to adjust the rebar to make room for the anchor bolts on Monday
- o Sent out S 197R6 and 225R12

Inspector:

Gina Rizzardo  Transportation Engineer/Assistant Structure Rep.

No. 266709

STATE OF CALIFORNIA - DEPARTMENT OF TRANSPORTATION
VENDOR'S CERTIFICATE OF COMPLIANCE
MR-0543 (REV. 5/93) #CT-7541-6020-2

PRECAST CONCRETE PRODUCTS OR Readymix

TO: Drill Tech
STATE HIGHWAY ENGINEER YORBA BUENA ISLAND

We certify that the portland cement, chemical and mineral admixtures contained in the material described below are brands stated and comply with specifications for:

CONTRACT NUMBER: order # 90016473

CEMENT BRAND Cemex MILL LOCATION DAVENPORT
TYPE IF mod

CHEMICAL ADMIXTURE

1. BRAND _____ MANUFACTURER _____
TYPE _____

2. BRAND _____ MANUFACTURER _____
TYPE _____

CHECK BOX IF A CHEMICAL ADMIXTURE WAS NOT USED

MINERAL ADMIXTURE

MANUFACTURER ISC CLASS F

CHECK BOX IF A MINERAL ADMIXTURE WAS NOT USED

DELIVERY DATE (Ready-Mix) 5/2/08 DATES OF FABRICATION (Precast) _____

LIST PRODUCTS TO WHICH CERTIFICATE APPLIES. (Show size and lin. ft. of pipe, etc., delivery slip numbers for ready-mix.)

82834637

MANUFACTURER OF CONCRETE PRODUCTS _____

By: [Signature] AUTHORIZED REPRESENTATIVE SIGNATURE Cemex



San Francisco Plant# 828
 500 Annather Street
 San Francisco, CA 94124
 1-800-476-2764

DATE
 5/2/2008

TICKET NO.
 82834637

P.O. #

PROJECT NO.
 31228072

BILL TO				SHIP TO			
50081790 DRILL TECH (NORCAL -JOB REQ) 2300 WYMORE WAY CONTRA COSTA				34478678 YERBA BUENA ISLAND SAN FRANCISCO YERBA BUENA ISLAND SAN FRANCISCO			
LOAD	LEAVE PLANT	ARRIVE JOB SITE	START DISCHARGE	FINISH DISCH.	LEAVE JOB SITE	ARRIVE PLANT	STAND-BY TIME
12.32.31	12:11:13	05:13:15					
SLUMP	PLANT NO.	TRUCK NO.	DRIVER		MAP ZONE		
2.0 In 1-3"	828	3492	CORTEZ, VICTOR A.		080 0648-FZ		
ORDER	PRODUCT CODE		REFERENCE	USAGE			
90016475 / 1	G-000-3-G-GM-13-1-Z-KKA		160808	SHOTCRETE			
LOAD QTY	CUMULATIVE QUANTITY	ORDERED QUANTITY	U/M	PRODUCT CODE	PRODUCT DESCRIPTION	PRICING	
8.00	8.00 / 8.00		YD3	60808	M13 SHOT 392 KG C+F 25 9.5MM	UNIT	EXTENSION
1.00			EA		G0003GGM131ZKKA FUEL SURCHARGE RM		
1st Service Sent : Truck							
2nd Service Sent : Truck							
DRUM REVOLUTION IS <u>120</u>							
SPECIAL INSTRUCTIONS						SALES TAX	
JOBSITE - MACALA RD, NORTH GATE RD / MAP PG 648 P/2 send a cert of compliance						TICKET TOTAL	
Copied from: 90016424						SUB-TOTAL	
						STAND-BY TIME	
						TOTAL	
						13.00.00	

All terms and conditions contained in the Material Quote and Credit Application and Agreement are hereby incorporated into this document and made a part hereof. This document is subject to the terms and conditions appearing on the reverse side hereof.
 NOTICE: THE STRENGTH OF CONCRETE DESCRIBED IS BASED UPON A SLUMP OF 3 TO 5 INCHES, OR AS SPECIFIED BY THE APPROVED MIX DESIGN WHEN TESTED IN ACCORDANCE WITH ASTM C-94. THE CUSTOMER IS RESPONSIBLE FOR REQUIREMENTS OF ACI 305A AND 306.

THE UNDERSIGNED AUTHORIZED ADDITION OF _____ GALLONS OF WATER.

SLUMP TAKEN: YES NO TEST CYL TAKEN: YES NO

WEIGHMASTER CERTIFICATE

THIS TO CERTIFY that the following described commodity was weighed, measured or counted by a weighmaster, whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed by Chapter 7 (commencing with Section 12700) of Division 5 of the California Business and Professions code, administered by the Division of Measurement Standards of the California Department of Food and Agriculture.

REASON FOR STANDBY: _____
 CUSTOMER ASSUMES RESPONSIBILITY AND /OR LIABILITY FOR ANY PERSONAL OR PROPERTY DAMAGE WITHIN THE CURB AND PROPERTY LINE. ALL CLAIMS MUST BE MADE AT TIME OF DELIVERY.

By Deputy X Al Rathjen
 700DT002CA Weigh Master

RECEIVED AND ACCEPTED BY: _____

CUSTOMER 1 COPY 1586620