

Job Stamp 04-0120F4 SFOBB SAS

Construction Calendar no.	607		
Project working days no.	817		
Date	08/11/2008		
Inspectors Hours	Start	6:30	Stop 17:00
Shift Hours	Start	6:30	Stop 15:00

Assistant Structure Rep.'s Daily Report

Location & Description of Operation	SAS-Temporary towers, Tower A & B Erection
Weather	HI: 74 F Low: 55 F Partly cloudy

Equipment and/or labor			Hours - ITEM no.						Remarks
Equip no.	# personnel	Description (of equipment or labor)	Regular	OT	DT	Rental		IDLE	
	C	Liebherr LR 1300	8						ABF
006-18-4293	C	Ingresoll Compressor	8						ABF
481-93-6013	R	Gnie Boom lift	2						ABF
544D-10	R	Gradall Forklift	2						ABF
	1	Dale Thomas	8						Operator
	1	Doug Greene	8						Oilee
	1	Ed Meyer	8						Foreman
	1	Matt Chamberlain	8						Iron worker
	1	James Sturgeon	8						Iron worker
	1	Serina Lafleur	8						Iron worker
	1	David Lucero	8						Iron worker
	1	Jerry Kubala, Jr.	8						Iron worker

Description of Operation:

- Daily activity of contractors (ABF)
 - Deliver vertical members and link beams of the tower AE and BE (see Fig. 1)
 - Start to assemble the lower portion of the tower AE (see Figs 2 through 4).
 - Installed and pretensioned bolts on the ground (see Fig 2 for the location where bolts are pretensioned on the ground).
 - See Art Pannu's diary for additional contractors' activities and comments.

- Note
 - Checked the certificate of LR1300 crane (see Figs 5 and 6). Next due is 07/30/2009.
 - Superintendent Dan is on site from 06:30 to 07:00, and 13:30 to 15:00.
 - 2 hours O.T.

- Punch list
 - The right top bolt of the east side plate of the tower A west line should be turned more (see 07/22/08 diary for more information).
 - The bolts at the top and bottom of the diagonal bracing splices of the tower B west line are short (see Appendix #1 of 07/29/08 diary for more information)

REC'D *08 SEP-27 #006766



Fig 1

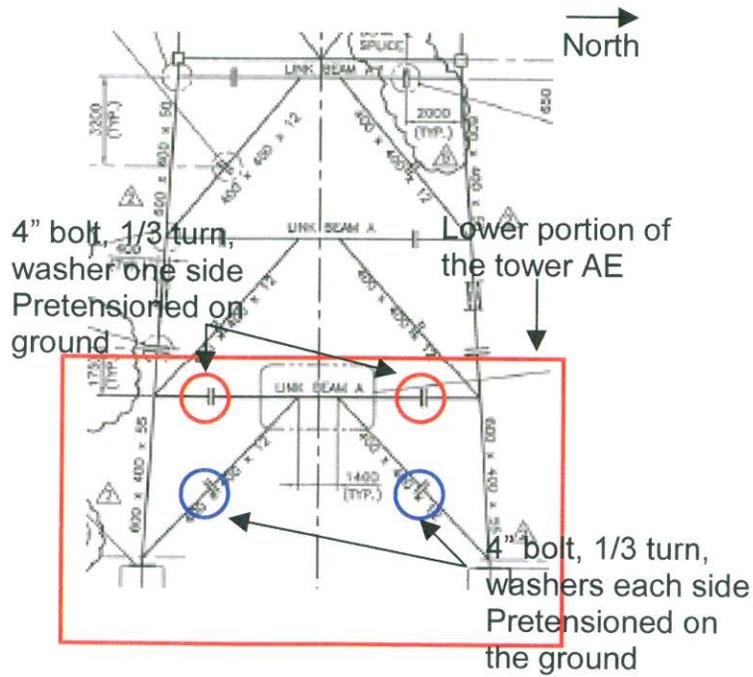


Fig 2



Fig 3



Fig 4



Fig 5.

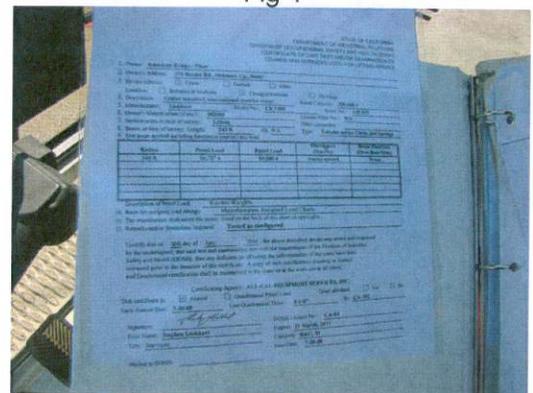


Fig 6

Inspector:

SeongHyeok Song

Trans Engineer (Civil) / Asst. Struct. Rep