



SAS Superstructure

Location: 04-SF-80-13.2 / 13.9

Client Name: CalTrans

Run date 22-Nov-14

Time 4:08 PM

Daily Diary Report by Bid Item

Contract No.: 04-0120F4

Diary #: 002 Const Calendar Day: 144 Date: 30-Jan-2010 Saturday

Inspector Name: He, Philip Title: Transportation Engineer

Inspection Type: No Inspection

Shift Hours: 10:00 am 04:00 pm Break: Over Time: 06:00

Federal ID:

Location:

Reviewer: Liu, Tai-Lin Approved Date: 18-May-10 Status: Approved

04-0120F4
04-SF-80-13.2/13.9
Self-Anchored
Suspension Bridge

Weather

Temperature 7 AM 12 PM 4PM
Precipitation Condition

Working Day [checked] If no, explain:

Diary:

Dispute

Work description.

Observing the contractor to do the preparing job for the OBG erection.

[checkbox]

On pier 7 at the warehouse, workers unloading the bridge cable material from the boat.

About 15 workers were working on the Lifting Frame to prepare for the lifting operation next week.

About 4 workers were working on the Lift 1E cradle frame and the pusher frame.

Observing from the boat at 2pm, five workers worked on the deck of lift 2E, install handrails, kickboard.

After lunch break of the workers:

At the end face of Lift 1E, workers are grinding the edge of the top deck. There are two man lift on the barge OC265 for OBF Lift 1E.

On the pier side of Lift 1E, 2 workers on a man lift (S-125) are installing the first suspender bracket on Lift 1E from bottom and 5 workers work on the deck for this installation. The position of the suspender bracket is on OBG Panel Point 10. Crane WY2006 (RT160-58084) with 1 operator is holding the bracket in place. At about 3pm, two workers start to add a shim plate for the suspender bracket, using hammer to jam it in between the OBG side skin plate and the bottom flange of the bracket.

About 13 workers worked on the lifting frame at the front of shear leg crane barge.

At about 2pm, cable rolls have been fully unloaded from the barge to the side of the warehouse. About 6 workers are finishing up over the site.

All workers start to finishing work from 3:30pm. End of business by 4pm.

04-0120F4 Bid Item: 055 E-L01-SG1.055 E Line Lift 01 Segment 1 Furnish structural steel (bridge)(box girder)

AMERICAN BRIDGE/FLUOR, A JV

Diary:

Dispute

General Comments 055 E-L01-SG1.055

Observing the contractor to do the preparing job for the OBG erection.

[checkbox]

## Daily Diary Report by Bid Item

Job Name: 04-0120F4

Inspector Name He, Philip

Diary #: 002

Date: 30-Jan-2010

Saturday

On pier 7 at the warehouse, workers unloading the bridge cable material from the boat.

About 15 workers were working on the Lifting Frame to prepare for the lifting operation next week.

About 4 workers were working on the Lift 1E cradle frame and the pusher frame.

Observing from the boat at 2pm, five workers worked on the deck of lift 2E, install handrails, kickboard.

After lunch break of the workers:

At the end face of Lift 1E, workers are grinding the edge of the top deck. There are two man lift on the barge OC265 for OBF Lift 1E.

On the pier side of Lift 1E, 2 workers on a man lift (S-125) are installing the first suspender bracket on Lift 1E from bottom and 5 workers work on the deck for this installation. The position of the suspender bracket is on OBG Panel Point 10. Crane WY2006 (RT160-58084) with 1 operator is holding the bracket in place. At about 3pm, two workers start to add a shim plate for the suspender bracket, using hammer to jam it in between the OBG side skin plate and the bottom flange of the bracket.

About 13 workers worked on the lifting frame at the front of shear leg crane barge.

At about 2pm, cable rolls have been fully unloaded from the barge to the side of the warehouse. About 6 workers are finishing up over the site.

All workers start to finishing work from 3:30pm. End of business by 4pm.

04-0120F4	Bid Item: 055	E-L01-SG2.055	E Line Lift 01 Segment 2 Furnish structural steel (bridge)(box girder)
AMERICAN BRIDGE/FLUOR, A JV			

04-0120F4	Bid Item: 055	E-L01-SG3.055	E Line Lift 01 Segment 3 Furnish structural steel (bridge)(box girder)
AMERICAN BRIDGE/FLUOR, A JV			

### Attachment



Installing the 1st suspender bracket at PP10 at Pier 7 - picture 01



Some scratch on the side of the OBG after the sea transportation, Picture 01

## Daily Diary Report by Bid Item

Job Name: 04-0120F4

Inspector Name He, Philip

Diary #: 002

Date: 30-Jan-2010

Saturday



Shear Leg Crane



Workers working on the lifting frame picture 4



Workers working on the lifting frame picture 6



Installing the 1st suspender bracket at PP10 at Pier 7 - picture 03



Workers working on the lifting frame picture 10



OBG Lifts on the barge; picture 3

## Daily Diary Report by Bid Item

Job Name: 04-0120F4

Inspector Name He, Philip

Diary #: 002

Date: 30-Jan-2010

Saturday



Workers working on the lifting frame picture 8



Workers working on the lifting frame picture 9



Workers working on the lifting frame picture 3



OBG Lifts on the barge; picture 2



Workers working on the lifting frame picture 14



Some scratch on the side of the OBG after the sea transportation, Picture 03

# Daily Diary Report by Bid Item


Job Name: 04-0120F4

Inspector Name He, Philip


Diary #: 002

Date: 30-Jan-2010


Saturday

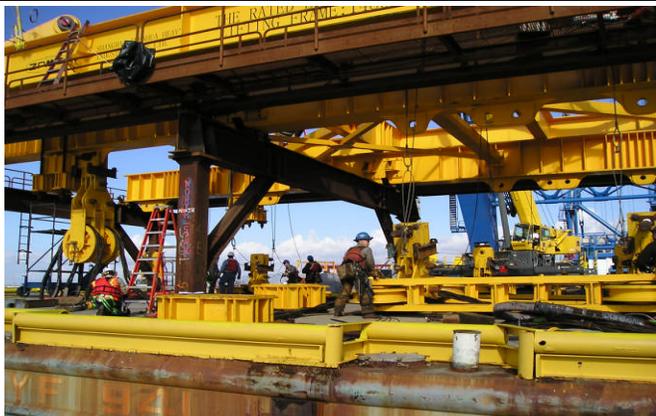

Workers working on the lifting frame picture 13

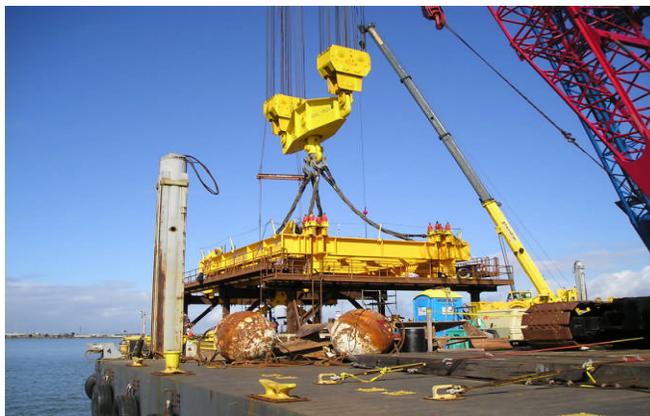

Workers working on the lifting frame picture 2

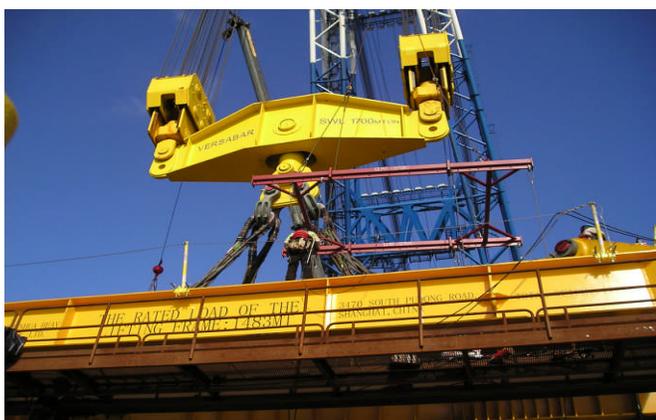

Workers working on the lifting frame picture 12



Installing the 1st suspender bracket at PP10 at Pier 7 - picture 02



Workers working on the lifting frame picture 11



OBG Lifts on the barge; picture 1

## Daily Diary Report by Bid Item

Job Name: 04-0120F4

Inspector Name He, Philip

Diary #: 002

Date: 30-Jan-2010

Saturday



Workers working on the lifting frame picture 7



Workers working on the lifting frame picture 5



Installing the 1st suspender bracket at PP10 at Pier 7 - picture 04



Some scratch on the side of the OBG after the sea transportation, Picture 02



Workers working on the lifting frame picture 1