

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave. St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:** Pursell, Gary**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-003505**Date Inspected:** 14-Jul-2008**Project Name:** SAS Superstructure**OSM Arrival Time:** 2130**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 700**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China

CWI Name:	N/A	CWI Present:	Yes	No
Inspected CWI report:	Yes No N/A	Rod Oven in Use:	Yes No N/A	
Electrode to specification:	Yes No N/A	Weld Procedures Followed:	Yes No N/A	
Qualified Welders:	Yes No N/A	Verified Joint Fit-up:	Yes No N/A	
Approved Drawings:	Yes No N/A	Approved WPS:	Yes No N/A	
		Delayed / Cancelled:	Yes No N/A	
Bridge No:	34-0006	Component:	OBG Fabrication	

Summary of Items Observed:

Caltrans Quality Assurance (QA) Inspector, Mr. Paul Dawson, arrived on site at the Zhenhua Port Machinery Company (ZPMC) facility at Changxing Island, in Shanghai, China, for the purpose of monitoring welding and fabrication of the San Francisco / Oakland Bay Bridge (SFOBB) components. The QA Inspector observed the following:

Orthotropic Box Girder (OBG) Fabrication:


Heavy Bay #1

The QA Inspector performed ultrasonic inspections of approximately 50% length of welds SSDI-SA173A/K-7A/B, SSDI-SA173A/K-13A/B, SSDI-SA16AF/G-88A/B and SSDI-SA16AF/G-112A/B to determine if they comply with AWS D1.5 requirements. Items observed appear to comply with project specifications. See the TL6027 ultrasonic test report and the photograph below for additional information.

ZPMC "Notification of witness inspection document # 00661 dated 7-14-2008 states the above listed welds along with weld SSDI-SA173A/K-20A/B are to have been ultrasonically inspected today. The QA Inspector observed weld SSDI-SA173A/K-20A/B has been marked as "UT REJECT" by ZPMC ultrasonic inspection personnel. See the photograph below for additional information.

WELDING INSPECTION REPORT

(Continued Page 2 of 2)

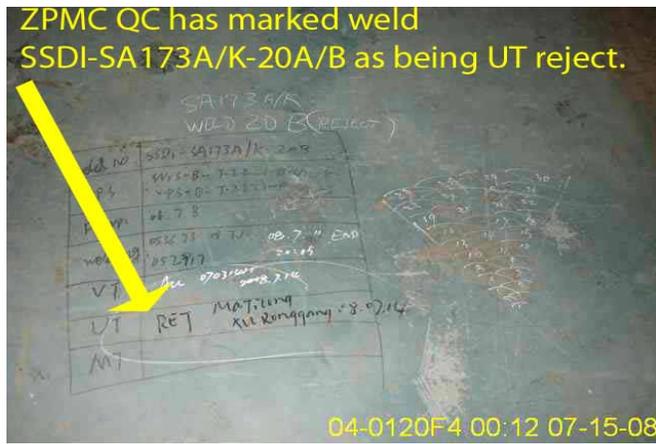

Summary of Conversations:

No significant conversations occurred.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Ady Velasco 13816942685, who represents the Office of Structural Materials for your project.

Inspected By:	Dawson,Paul	Quality Assurance Inspector
Reviewed By:	Carreon,Albert	QA Reviewer
