

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave. St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:** Pursell, Gary**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-013126**Date Inspected:** 09-Apr-2010**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 900**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:****CWI Present:**

Yes No

Inspected CWI report: Yes No N/A**Rod Oven in Use:**

Yes No N/A

Electrode to specification: Yes No N/A**Weld Procedures Followed:**

Yes No N/A

Qualified Welders: Yes No N/A**Verified Joint Fit-up:**

Yes No N/A

Approved Drawings: Yes No N/A**Approved WPS:**

Yes No N/A

Delayed / Cancelled:

Yes No N/A

Bridge No: 34-0006**Component:** OBG Trial Assembly**Summary of Items Observed:**

On this date Caltrans OSM Quality Assurance (QA) Inspector, S. Manjunath Math was present during the time noted above for observations relative to the work being performed.

This QA Inspector randomly observed the following work in progress:

Testing Laboratory at Bay No. 11

Rotation Capacity Test Witness

This QA Inspector witnessed the Rotation Capacity Test for the following at Bolt Testing Laboratory located at Bay No. 11.

Bolt Size: M24 x 100 mm

Rotation Capacity Set # : DHGM240065

Bolt Lot #: NP5612

Nut Lot#: ND1512

Washer Lot#: C08192

WELDING INSPECTION REPORT


(Continued Page 2 of 2)

Temperature and Humidity inside the Laboratory: 16 Degree Centigrade and 60% RH.

Torque Value observed as: 960N-m, 1040 N-m and 1040 N-m.

The tension test performed for lot observed to be in general compliance with requirements.

Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

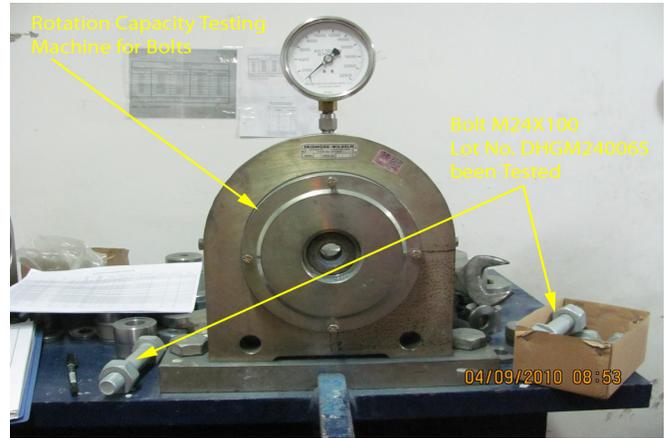

Summary of Conversations:

No relevant conversations.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric T Sang 1500-0042-2372, who represents the Office of Structural Materials for your project.

Inspected By: Math,Manjunath

Quality Assurance Inspector

Reviewed By: Miller,Mark

QA Reviewer