

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave. St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:** Pursell, Gary**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-015119**Date Inspected:** 16-Jun-2010**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1900**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:** Mr. Gong Wei/Xu Tao**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** OBG**Summary of Items Observed:**

On this date Caltrans OSM Quality Assurance (QA) Inspector, Nagalingam Pandaram Pillai was present during the times noted above for observations relative to the work being performed.

In process Inspection

Out Side Yard

This QA Inspector observed the following work in progress:

SMAW in the 4G position for the OBG Segment 11DW, weld No. SSD10A-PP104-223. The welder is identified as #067764. ZPMC QC is identified as Mr. Li Ping. The welding variables recorded by QC appear to comply with WPS-B-P-2214-Tc-U4b-FCM-1.

This QA Inspector observed the following work in progress:

FCAW in the 4G position for the OBG Segment 11DW, weld No. SSD10A-PP104-234. The welder is identified as #201583. ZPMC QC is identified as Mr. Li Ping. The welding variables recorded by QC appear to comply with WPS-B-T-2233-Tc-U4b-F.

This QA Inspector observed the following work in progress:

SMAW in the 4G position for the OBG Segment 11DE, weld No. SEG072A-024. The welder is identified as #054013. ZPMC QC is identified as Mr. Li Ping. The welding variables recorded by QC appear to comply with WPS-B-P-2214-Tc-U4b-FCM-1. Please see the attached picture.

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

Bay #14

This QA Inspector observed the following work in progress:

FCAW in the 2F position for the OBG Segment 13CW side Plate to stiffener , weld No. SP3098A-001-038. The welder is identified as #055491. ZPMC QC is identified as Mr. Guo Xing Hui. The welding variables recorded by QC appear to comply with WPS-B-T-2132.

This QA Inspector observed the following work in progress:

FCAW in the 2F position for the OBG Segment 13CW side Plate to stiffener , weld No. SP3098A-001-052. The welder is identified as #044830. ZPMC QC is identified as Mr. Wang Xu. The welding variables recorded by QC appear to comply with WPS-B-T-2132.

Bay #19


This QA Inspector observed the following work in progress:

FCAW in the 2F position for the OBG Bike Path BK004A, weld No. BK004A4-001-056. The welder is identified as #0622904. ZPMC CWI is identified as Mr. Xu Tao. The welding variables recorded by QC appear to comply with WPS-B-T-2132.

This QA Inspector observed the following work in progress:

FCAW in the 4F position for the OBG Bike Path BK004A, weld No. BK004A4-005-023. The welder is identified as #0500909. ZPMC CWI is identified as Mr. Xu Tao. The welding variables recorded by QC appear to comply with WPS-B-T-2134. Please see the attached picture.

Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

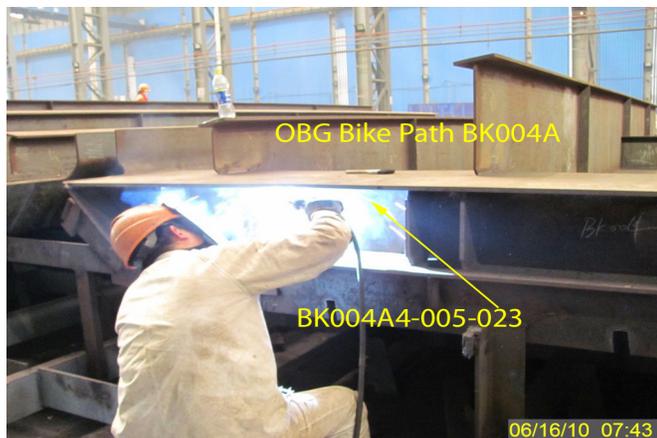

Summary of Conversations:

No Relevant Conversation.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric Tsang 150-0042-2372, who represents the Office of Structural Materials for

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

your project.

Inspected By:	Pillai,Pandaram	Quality Assurance Inspector
----------------------	-----------------	-----------------------------

Reviewed By:	McClendon,Timothy	QA Reviewer
---------------------	-------------------	-------------