

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave. St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:** Pursell, Gary**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-001687**Date Inspected:** 29-Feb-2008**Project Name:** SAS Superstructure**OSM Arrival Time:** 1830**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 730**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China

CWI Name:	NA	CWI Present:	Yes	No
Inspected CWI report:	Yes No N/A	Rod Oven in Use:	Yes No N/A	
Electrode to specification:	Yes No N/A	Weld Procedures Followed:	Yes No N/A	
Qualified Welders:	Yes No N/A	Verified Joint Fit-up:	Yes No N/A	
Approved Drawings:	Yes No N/A	Approved WPS:	Yes No N/A	
		Delayed / Cancelled:	Yes No N/A	
Bridge No:	34-0006	Component:	deck panel	

Summary of Items Observed:


Caltrans Quality Assurance (QA) Inspector, Mike Hasler was present to observe the fitup, welding and related activities associated with the fabricating of Caltrans Mock-up, 77M, 89M, 114M and orthotropic box girders (OBG), for the San Francisco Oakland Bay Self Anchored Suspension Bridge, at Zhenhua Port Machinery Company (ZPMC) facility on Changxing Island.

Item Description	WBS	Dwg No.	Status
1 deck panel	na	na	work in progress

Storage Yard Outside New OBG Fabrication Bays: Caltrans QA Inspector performed visual inspection of the completed submerged arc welding (SAW) cover pass welds; partial joint penetration (PJP) welds joining the closed ribs to deck plate panel DP019-001, u-rib U221, weld 2; u-rib U2176, welds 3 & 4; u-rib U216, welds 5 & 6; u-rib U215, welds 7 & 8 and u-rib U220 weld 9. Caltrans QA observed welding overlap, underfill and incomplete fusion. These indications observed at the weld were marked in yellow paint stick along the distance from the "Y" axis, starting at the weld start to weld completion end. The weld indications observed were recorded on Caltrans spreadsheet for future reference. The following digital picture illustrates deck plate panel DP019-001.

WELDING INSPECTION REPORT

(Continued Page 2 of 2)

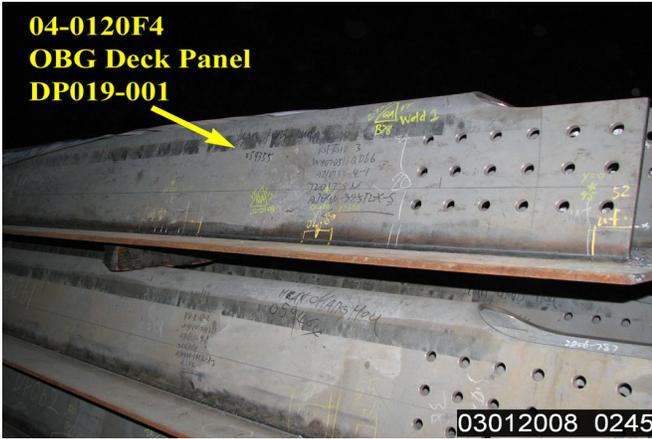

Summary of Conversations:

As identified within the contents of this report.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Mazen Wahbeh, (818) 292-0659, who represents the Office of Structural Materials for your project.

Inspected By:	Hasler, Mike	Quality Assurance Inspector
Reviewed By:	Cuellar, Robert	QA Reviewer
