

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave. St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493


Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:** Pursell, Gary**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-003284**Date Inspected:** 28-Jun-2008**Project Name:** SAS Superstructure**OSM Arrival Time:** 2300**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 730**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Changxing Island**CWI Name:** Li Yan Hua**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** OBG**Summary of Items Observed:**

Caltrans Quality Assurance (QA) Inspector, Larry Viars was present to monitor activities associated with the Production Monitoring Test of Orthotropic Box Girder (OBG) Deck Panel U-rib welds, for the San Francisco Oakland Bay Self Anchored Suspension Bridge, at Zhenhua Port Machinery Company (ZPMC) facility on Changxing Island.

The Caltrans QA Inspector monitored the OBG Production Monitoring Test (PMT) for Deck Panels DP141-001 and DP249-001. The Caltrans QA inspector recorded amperage, voltage and travel speed of the Gas metal Arc Welding (GMAW) root pass and the Submerged Arc Welding (SAW) cover pass. A Visual inspection of the root pass and cover pass was performed by ZPMC, American Bridge Flour (ABF) and the Caltrans QA. The Caltrans QA observed ZPMC QC Mr. Xue Hai Rong perform Ultrasonic testing of the Partial Joint Penetration weld for depth of penetration. Mr. Xue found the PMT welds to be in compliance with contract documents. The Caltrans QA inspector designated locations for Macroetch samples (15 locations). Macroetch samples were evaluated with a 7x optical comparator and sample 1-1 was rejected by ZPMC QC, ABF QC and The Caltrans QA Inspector for a 2.5 mm crack. ZPMC QC stated the PMT for panels DP141-001 and DP249-001 would resume on the following shift. Please see the attached photo of sample 1-1.

WELDING INSPECTION REPORT

(Continued Page 2 of 2)

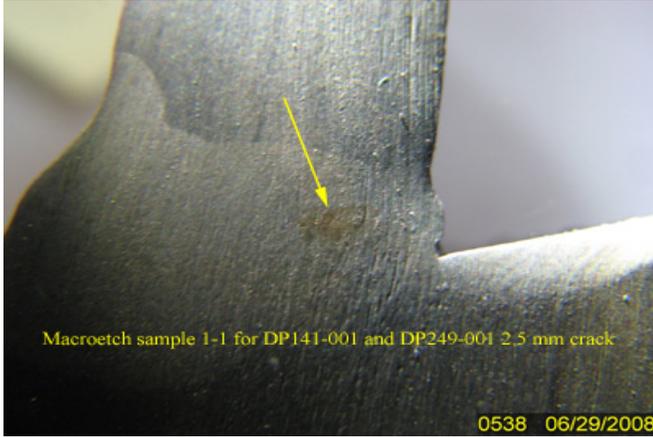

Summary of Conversations:

As identified within the contents of this report.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Ady Velasco, 138 1694 2685, who represents the Office of Structural Materials for your project.

Inspected By:	Viars,Larry	Quality Assurance Inspector
Reviewed By:	Cochran,Jim	QA Reviewer
