

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave. St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:** Siegenthaler, Peter**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-017196**Date Inspected:** 13-Sep-2010**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1900**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:** Mr. Wang Jie/Liu Yan Hua**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** OBG**Summary of Items Observed:**

On this date Caltrans OSM Quality Assurance (QA) Inspector, Nagalingam Pandaram Pillai was present during the times noted above for observations relative to the work being performed.

In process Inspection

OUTSIDE YARD

This QA Inspector observed the following work in progress:

SMAW in the 4F position for the OBG Segment 12AE, weld No: SEG3001H-175/176. The welders are identified as #044479. ZPMC QC is identified as Mr. Li Ping. The welding variables recorded by QC appear to comply with WPS-B-P-2114.

This QA Inspector observed the following work in progress:

SMAW in the 4G position for the OBG Segment 12BE, weld No: SEG3002E-253. The welders are identified as #051013. ZPMC QC is identified as Mr. Li Ping. The welding variables recorded by QC appear to comply with WPS-B-P-2214-TC-U4B-FCM-1.

Bay #16

This QA Inspector observed the following work in progress:

SAW in the 1G position for the OBG Segment 14 Bottom Plate, weld No: BP3101-001-003. The welder is

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

identified as #201917. ZPMC QC is identified as Mr.Guo Pen. The welding variables recorded by QC appear to comply with WPS-B-T-2221-B-L2C-S-2.

This QA Inspector observed the following work in progress:

FCAW in the 2G position for the OBG Segment 13AW Longitudinal Diaphragm, weld No: LD3034-001-063. The welder is identified as #045280. ZPMC CWI is identified as Mr.Wang Jie. The welding variables recorded by QC appear to comply with WPS-B-T-2232-TC-U5-F. Please see the attached picture.

Bay #14


This QA Inspector observed the following work in progress:

SAW in the 1G position for the OBG Segment 13AW, weld No: SEG3013AD-002. The welder is identified as #201917. ZPMC QC is identified as Mr.Xin Chun Hui. The welding variables recorded by QC appear to comply with WPS-B-T-2221-B-L2C-S-2.

This QA Inspector observed the following work in progress:

FCAW in the 2G position for the OBG Segment 13BE, weld No: KP-3008-001-002. The welder is identified as #067079. ZPMC QC is identified as Mr.Wang Xu. The welding variables recorded by QC appear to comply with WPS-B-T-2232-TC-U4B-F. Please see the attached picture.

Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

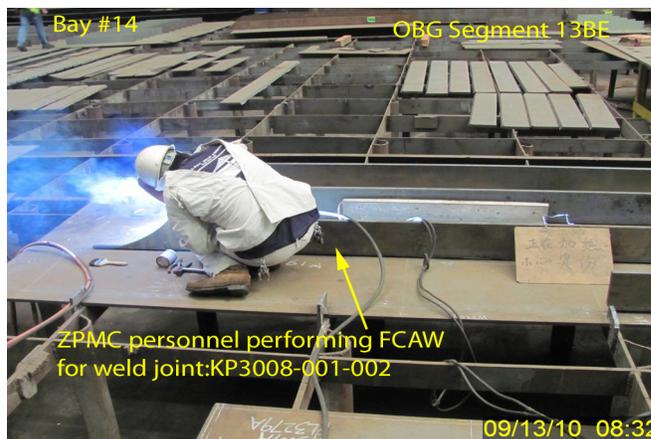

Summary of Conversations:

No Relevant Conversation.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric Tsang 150-0042-2372, who represents the Office of Structural Materials for your project.

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

Inspected By:	Pillai,Pandaram	Quality Assurance Inspector
----------------------	-----------------	-----------------------------

Reviewed By:	McClendon,Timothy	QA Reviewer
---------------------	-------------------	-------------