

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave. St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 99.28**WELDING INSPECTION REPORT****Resident Engineer:** Siegenthaler, Peter**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-022600**Date Inspected:** 09-Apr-2011**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1900**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC) Chanxing Island**Location:** Shanghai, China**CWI Name:** Mr. An Qing Xing**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** OBG Segment**Summary of Items Observed:**

On this date Caltrans OSM Quality Assurance Inspector (QA), Vibin Kumar Selvanayaham, was present during the times noted above for observations relative to the work being performed.

Bay 14

This QA Inspector observed the following work in progress:

Shielded Metal Arc Welding (SMAW) welding of weld joint SEG3020BB-011 located on Vertical Shear Plate to Anchor Plate of OBG Segment 14W. ZPMC Welders are identified as 037932 and 067765. ZPMC Quality Control (QC) is identified as Mr. Zhu Lin. The welding variables recorded by QC appeared to comply with the Applicable WPS-B-P-2214-Tc-U4b-FCM-1.

SMAW welding of weld joint SEG3020BB-038 located on Vertical Shear Plate to Anchor Plate of OBG Segment 14W. ZPMC Welders are identified as 069841 and 066261. ZPMC Quality Control (QC) is identified as Mr. Zhu Lin. The welding variables recorded by QC appeared to comply with the Applicable WPS-B-P-2214-Tc-U4b-FCM-1.

SMAW welding of weld joint SEG3020BB-065 located on Vertical Shear Plate to Anchor Plate of OBG Segment 14W. ZPMC Welder is identified as 045246. ZPMC Quality Control (QC) is identified as Mr. Zhu Lin. The welding variables recorded by QC appeared to comply with the Applicable WPS-B-P-2214-Tc-U4b-FCM-1.

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

Flux Core Arc Welding (FCAW) welding of weld joint SEG3020P-033 located on Deck panel to Anchor Plate at panel point 126.5 of OBG Segment 14W. ZPMC Welder is identified as 066442. ZPMC Quality Control (QC) is identified as Mr. Zhu Lin. The welding variables recorded by QC appeared to comply with the Applicable WPS-B-T-2232-ESAB.



FCAW welding of weld joint SEG3020K-002 located on Deck panel to Floor Beam at panel point 127.3 of OBG Segment 14W. ZPMC Welder is identified as 067520. ZPMC Quality Control (QC) is identified as Mr. Zhu Lin. The welding variables recorded by QC appeared to comply with the Applicable WPS-B-T-2232-ESAB.

FCAW welding of weld joint SEG3020R-002 located on Deck panel to Floor Beam at panel point 126 of OBG Segment 14W. ZPMC Welder is identified as 069469. ZPMC Quality Control (QC) is identified as Mr. Zhu Lin. The welding variables recorded by QC appeared to comply with the Applicable WPS-B-T-2232-ESAB.

FCAW welding of weld joint SEG3020P-011 located on Deck panel to Anchor Plate at panel point 126.5 of OBG Segment 14W. ZPMC Welder is identified as 066239. ZPMC Quality Control (QC) is identified as Mr. Zhu Lin. The welding variables recorded by QC appeared to comply with the Applicable WPS-B-T-2232-ESAB.

This QA inspector observed ZPMC personnel performed Ultrasonic Testing on Side Plate RS Stiffener to Floor Beam weld of OBG Segment 13BW. The weld numbers are identifies as SEG3014C-129, 130, SEG3014E-146, 147, SEG3014G-129, 130 and SEG3014J-129, 130. See the attached pictures.

Unless otherwise noted, all work observed on this date appeared to be in general compliance with the applicable contract documents.

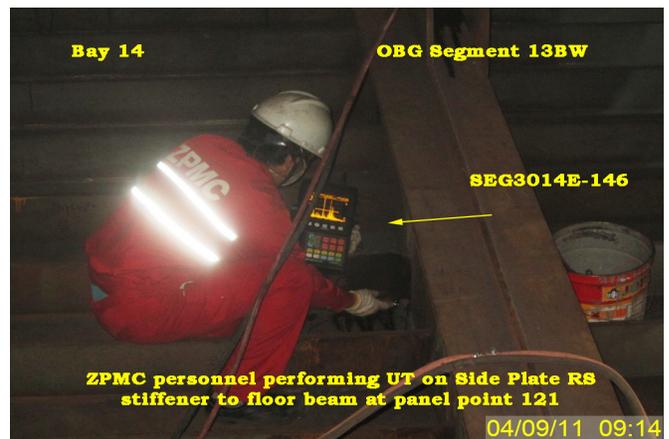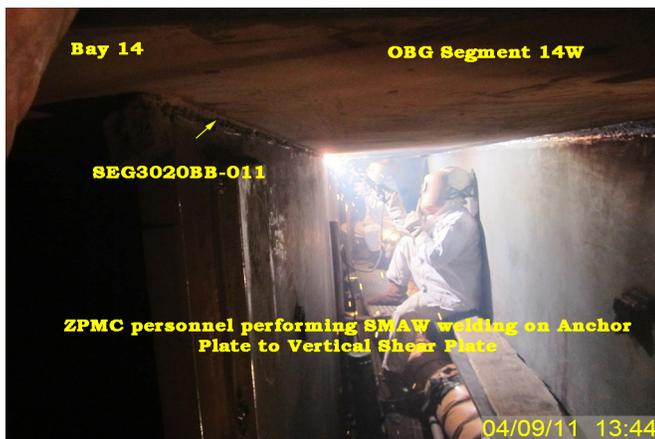

Summary of Conversations:

Only general conversation was held between QA and QC concerning this project.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact , who represents the Office of Structural Materials for your project.

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

Inspected By:	Kumar,Vibin	Quality Assurance Inspector
----------------------	-------------	-----------------------------

Reviewed By:	Patel,Hiranch	QA Reviewer
---------------------	---------------	-------------