

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave. St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:** Siegenthaler, Peter**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-022623**Date Inspected:** 15-Apr-2011**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1900**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:** Liu Hua Jie**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** OBG**Summary of Items Observed:**

On this date Caltrans OSM Quality Assurance (QA) Inspector, Nagalingam Pandaram Pillai was present during the times noted above for observations relative to the work being performed.

Ultrasonic Testing:-

OBG Trial Assembly

This QA Inspector performed Ultrasonic testing (UT) of approximately 10% of the area previously tested and accepted by ZPMC Quality control personnel. This QA inspector generated a (UT) report for this date. The members are identified as 13BE Lifting Lug & 13CE Deck panel Diaphragm. The weld designation reviewed is as follows:

SEG3009K-153
DP3102-001-253
SEG3011L-001
SEG3011K-001
SEG3011J-001
SEG3011H-001
SEG3011G-001
SEG3011F-001
SEG3011E-001

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

SEG3011D-001
SEG3011C-001
SEG3011B-001

In process Inspection:-

OBG Trial Assembly

This QA inspector observed the following work in progress:

SMAW welding of weld joint No: SA3214-001-009 located on OBG Segment 13CE Deck panel Diaphragm. Welder is identified as #066258. ZPMC QC is identified as Mr. Wang Xu. Welding was performed with the weld repair report BWR-20501. The welding variables recorded by QC appeared to comply with the WPS-345-SMAW-3G(3F)-FCM-Repair-1. Please see the attached picture.

This QA Inspector observed the following work in progress:

SMAW in the 3G position for the OBG Segment 13CE Bottom panel stiffener to Floor Beam. The weld joint was designated as: SEG3011H-066. The welder is identified as #051359. ZPMC QC is identified as Mr. Wang Xu. The welding variables recorded by QC appear to comply with WPS-B-P-2213-TC-U4B-FCM-1.

This QA inspector observed the following work in progress:

SMAW welding of weld joint No: DP3089-001-019 located on OBG Segment 13BE Deck panel Diaphragm. Welder is identified as #050969. ZPMC QC is identified as Mr. Wang Xu. Welding was performed with the weld repair report BWR-20485. The welding variables recorded by QC appeared to comply with the WPS-345-SMAW-3G(3F)-FCM-Repair-1.

This QA Inspector observed the following work in progress:

SMAW in the 4G position for the OBG Segment 13AE Floor beam stiffener to Edge panel. The weld joint was designated as: SEG3007F-043. The welder is identified as #068097. ZPMC CWI is identified as Mr. Liu Hua Jie. The welding variables recorded by QC appear to comply with WPS-B-P-2214-TC-U4B-FCM-1.

This QA inspector observed the following work in progress:

SMAW welding of weld joint No: SEG3007F-001 located on OBG Segment 13AE Deck panel diaphragm. Welder is identified as #066163. ZPMC CWI is identified as Mr. Liu Hua Jie . Welding was performed with the weld repair report BWR-20708. The welding variables recorded by QC appeared to comply with the WPS-345-SMAW-3G(3F)-FCM-Repair-1.

This QA inspector observed the following work in progress:


SMAW welding of weld joint No: SEG3007N-005 located on OBG Segment 13AE Deck panel diaphragm. Welder is identified as #066416. ZPMC CWI is identified as Mr. Liu Hua Jie. Welding was performed with the

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

weld repair report BWR-20450. The welding variables recorded by QC appeared to comply with the WPS-345-SMAW-3G(3F)-FCM-Repair-1.

Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

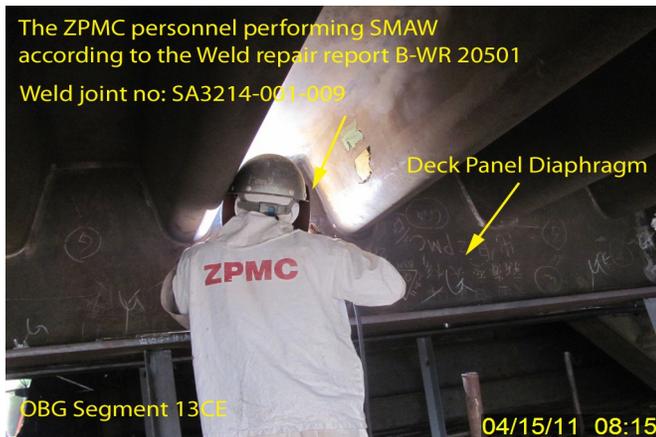

Summary of Conversations:

No Relevant Conversation.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric Tsang 150-0042-2372, who represents the Office of Structural Materials for your project.

Inspected By:	Pillai,Pandaram	Quality Assurance Inspector
Reviewed By:	Patel,Hiranch	QA Reviewer
