

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave. St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 99.28**WELDING INSPECTION REPORT****Resident Engineer:** Siegenthaler, Peter**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-025285**Date Inspected:** 20-Jul-2011**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1900**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai**CWI Name:****CWI Present:**

Yes No

Inspected CWI report: Yes No N/A**Rod Oven in Use:**

Yes No N/A

Electrode to specification: Yes No N/A**Weld Procedures Followed:**

Yes No N/A

Qualified Welders: Yes No N/A**Verified Joint Fit-up:**

Yes No N/A

Approved Drawings: Yes No N/A**Approved WPS:**

Yes No N/A

Delayed / Cancelled:

Yes No N/A

Bridge No: 34-0006**Component:** OBG**Summary of Items Observed:**

On this date Caltrans OSM Quality Assurance (QA) Inspector R. Hernandez was present during the time noted above and conducted observations relative to the work being performed.

The QA Inspector randomly observed the following work in progress:

Trial Assembly 13W

This QA Inspector witnessed the in-process high strength bolt installation on bolts connecting the following connections:

- Longitudinal Diaphragm to Deck Plate vertical connection plates at (W4) line between Panel Points (PP) 120 and (PP) 122.
- Rib stiffeners to Rib stiffeners between W2 and W3 at PP120 to 123.5.
- U-rib stiffeners to U-rib stiffeners between W3 and W4 lines at PP124 to PP124.5.

Bolting on the above named areas is in progress and still requires final tension verification prior to final acceptance. The QA Inspector verified installation of the high strength bolts on a random basis and the results appeared to be in general compliance.

This inspector conducted review of the following high strength bolts brought out to Segment 13 W for installation at connections requiring the size and length required as specified on contract drawings. All bolts were found to have been sampled and tested in accordance with AISC standards and in accordance RCSC 2000 edition:

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

M22x65 - Set No. DHGM2200129, Lot No.(s) PR991Z, PS121Z, & C2442Z.

M27x120 - Set No. DHGM2700041, Lot No.(s) SB571Z, PR731Z, & C1371Z.

M22x65 - Set No. DHGM2700129, Lot No.(s) PR991Z, PS121Z, & C2442Z.

Heavy Dock South 14E

This inspector conducted review of the following high strength bolts brought out to Segment 14E for installation at connections requiring the size and length required as specified on contract drawings. All bolts were found to have been sampled and tested in accordance with AISC standards and in accordance RCSC 2000 edition:

M24x110 - Set No. DHGM2400023, Lot No.(s) MW291Z, MK021Z, & C0018W.


M22x80 - Set No. DHGM220140, Lot No.(s) PS021Z, PS131Z, & C2442Z.

M27x75 - Set No. DHGM270030, Lot No.(s) 8580Z, NZ821Z, & C1169Z.

M22x100 – Set No. DHGM220049, Lot No.(s) MW011Z, MT761Z, & C0428Z.

M24x100 – Set No. DHGM240125, Lot No.(s) PW941Z, PS921Z, & C2556Z.

Unless otherwise noted above all items observed on this day appeared to be in general compliance with the applicable contract documents

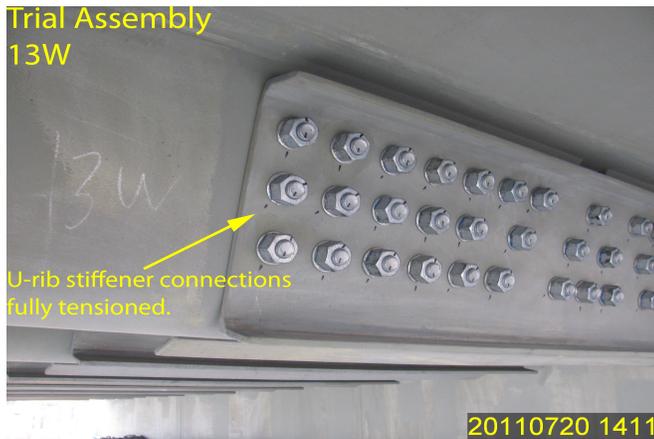

Summary of Conversations:

Pertinent conversations are included in the body of the report.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric Tsang 1500-0042-02372, who represents the Office of Structural Materials for your project.

Inspected By: Hernandez,Rene

Quality Assurance Inspector

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

Reviewed By: Hall,Steven

QA Reviewer