

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave. St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 1.28**WELDING INSPECTION REPORT****Resident Engineer:** Casey, William**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-028538**Date Inspected:** 09-Oct-2012**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1730**Contractor:** American Bridge/Fluor Enterprises, a JV**Location:** Job Site**CWI Name:** See below.**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** OBG**Summary of Items Observed:**

Quality Assurance Inspector (QA) Fritz Belford was at the American Bridge/Fluor (ABF) job site at Yerba Buena Island in California between the times noted above in order to monitor Quality Control functions and the in process work being performed by ABF personnel. The following items were observed:

OBG 12W

This QA observed the following welders working in OBG 12W at various locations:

Authorized welder Chris Bruce #8901:

Welder Chris Bruce was observed performing weld repairs on weld 12W PP111.5 W2.1-BW2 and 12W W2.1-A1 between at panel points 115 and 115.2. Welder was observed utilizing Caltrans approved Welding Procedure Specification's (WPS) ABF-WPS-D15-1000R Rev.2 for Shielded Metal Arc Welding (SMAW). The welder was observed preheating the welds prior to Carbon Arc Gouging and welding. Other welding parameters as inspected by QC Inspector appear to be in compliance with the WPS noted above.

Authorized welder Lin E Yun #9344:

Welder Lin E Yun was observed performing weld repairs on weld 12W PP117 W2.1-BW1 Carbon Arc Gouging (CAG) the weld for repairs. Welder was observed utilizing Caltrans approved Welding Procedure Specification's (WPS) ABF-WPS-D15-1000R Rev.2 for Shielded Metal Arc Welding (SMAW). The welder was observed preheating the welds prior to Carbon Arc Gouging and welding. Other welding parameters as inspected by QC Inspector appear to be in compliance with the WPS noted above.

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

Authorized welder Richard Garcia #5892:

Welder Richard Garcia was observed performing weld repairs on weld 12W W2.1-A1 Carbon Arc Gouging (CAG) rejectable weld indications for repairs between panel points 114.5 and 115. Welder was observed utilizing Caltrans approved Welding Procedure Specification's (WPS) ABF-WPS-D15-3000-4 for Flux Core Arc Welding (FCAW). The welder was observed preheating the welds prior to Carbon Arc Gouging and welding. Other welding parameters as inspected by QC Inspector appear to be in compliance with the WPS noted above.

Non-Destructive Testing (NDT)

This QA performed Visual, Magnetic Particle and Ultrasonic Testing on the following:


Welds at Panel Point 12W PP116 W2.1:

- Weld BW1 (640mm Long x 12 & 14mm Thick. - Accept.)
- Weld BW2 (590mm Long x 22 & 14mm Thick. - Accept)
- Weld BW3 (110mm Long x 22 & 14mm Thick. - Accept)
- Weld BW4 (210mm Long x 12mm Thick. - Accept.)
- Weld PS1 (VT Reject)
- Weld PS2 (VT Reject)
- Weld PS4 (85mm Long x 20mm Thick. - Accept.)

This QA Inspector completed the appropriate report form on this date noting items acceptance or rejection as per applicable code. The completed and accepted work observed at this location appeared to be in compliance with the contract specifications.

This QA observed QC Inspector Fred Michaels performing welding parameter checks such as voltage, amps, electrodes and preheats throughout the day. Also noted were QC Inspectors Scott Krotum, John Pagliero, Brien Conolly and Leo Paparelli performing various Non-Destructive Testing (NDT) on completed weld repairs as they become available for testing. Non-Destructive Testing methods utilized by the QC Inspectors were Visual Testing (VT), Magnetic Particle Testing (MPT) and Ultrasonic Testing Shear Wave (UTSW). QC Inspectors were observed accepting and rejecting welds per applicable code and or contract criteria.

Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

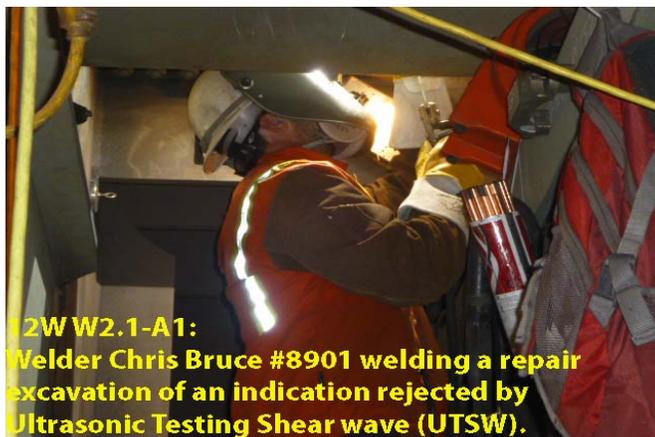

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

Summary of Conversations:

Conversations relevant to work performed on this date.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Gary Thomas - (916) 764 - 6027, who represents the Office of Structural Materials for your project.

Inspected By:	Belford,Fritz	Quality Assurance Inspector
Reviewed By:	Reyes,Danny	QA Reviewer
